
# CLEARINGHOUSE FOR FEDERAL SCIENTIFIC AND TECHNICAL INFORMATION, CFSTI DOCUMENT MANAGEMENT BF TH 410.11

## LIMITATIONS IN REPRODUCTION QUALITY

Accession	1 600 = 24
<b>Ø</b> 1.	We regret that legibility of this document is in part unsatisfactory. Reproduction has been made from best available copy.
<b>≥</b> 2.	A portion of the original document contains fine detail which may make reading of photocopy difficult.
<u></u>	The original document contains color, but distribution copies are available in black-and-white reproduction only.
4 <b>.</b>	The initial distribution copies contain color which will be shown in black-and-white when it is necessary to reprint.
<u></u>	Limited supply on hand; when exhausted, document will be available in Microfiche only.
<u></u> 6.	Limited supply on hand; when exhausted document will not be available.
	Document is available in Microfiche only.
<b></b>	Document available on loan from CFSTI (TT documents only).
<u></u>	

Dm

Processor:

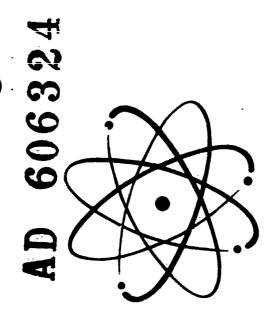

DEVELOPMENT OF AN IMPROVED JAN 6299

#### FINAL REPORT

1 May 1961 through 30 June 1964

CONTRACT NO. DA-36-039-SC-85953

ORDER 6008-PP-61-81-81


Industrial Preparedness Group USASSA

Philadelphia, Pennsylvania

COPY Z OF 3 5mm

HARD COPY \$.6.00

MICROFICHE \$.1.50

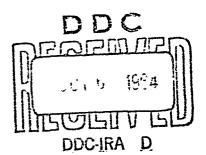

TUBE DEPARTMENT



#### DEVELOPMENT OF AN IMPROVED JAN 6299

#### FINAL REPORT

1 May 1961 through 30 June 1964

- OBJECTIVE: (1) To obtain better performance and greater reliability from the JAN 6299 by evaluating and adapting the latest tube technological advancements.
  - (2) To build 1000 tubes capable of passing Signal Corps Technical Requirements SCS-90 dated 1 July 1960.

CONTRACT NO. DA-36-039-SC-85953

SIGNAL CORPS TECHNICAL REQUIREMENTS SCS-90, 1 July 1960

Report Prepared By:

D. L. Cook

### TABLE OF CONTENTS

ABSTRACT	•	•	•	•						
PURPOSE		•	•	•	•	•	•		•	۲.
NARRATIVE	•		•	•	•	•	•	•	•	3-70
CONCLUSION	s.	•	•	•	•	•	•	•	•	71-72
PUBLICATION AND CON	ns, lect Ferences					•	•	•		73-77
IDENTIFICA	TION OF	rechn:	ICIAN	S ,	•	•	•	•	•	78-83
APPENDIX A	Specifica	ation								
APPENDIX B Limit	ed Produc	ction	Equi	pment						
APPENDIX C	ssing Spe	cific	eation	n						
APPENDIX D Quali	tv Contro	ol Mar	nıal							

### LIST OF ILLUSTRATIONS

Figure		Page
1	Eccentricity Gauge	Ļ
2	Configuration Of Preseal And Anode Seals	6
3	Temperature Control System	9
L <sub>i</sub>	Cathode Spray Booth	11
5	Life Rack	12
6	High Temperature Life Rack	15
7	Surface Conditions And Corresion Of The 6299 During Humidity Test	19-22
8	Improved Exhaust Fixture	33
9	Probability Curve - Heater Terminal Eccentricity	34
10	Probability Curve - Getter Terminal Eccentricity	35
11	Probability Curve - Cathode Terminal Eccentricity	36
	LIST OF TABLES	
Table		Page
I	Electrical Characteristics - Design Test 6299 PEM Pilot Run	25
II	Humidity Test Data 6299 PEM Pilot Run	26
III	High Temperature Life Test Data 6299 PEM Pilot Run	27-28
IV	1000 Hour Life Test Data 6299 PEM Pilot Run	29-30
v	Extended Life Test Data	39-70

#### ABSTRACT

The period covered by this report is from 1 May 1961 through 30 June 1964. No work was performed from 30 April 1962 to 17 September 1962 when manufacturing facilities were being transferred from Scranton, Pennsylvania to Owensboro, Kentucky.

The pilot run has been completed; test data is shown in Project VIII.

Results from improved alignment and concentricity, optimization of cathode coating and improved exhaust fixturing are now being applied to regular production tubes.

Best results during humidity test have been obtained by improving plating techniques and controls to minimize metal shell corrosion.

The improved tubes have given superior life test results with the anode seal temperature at 225° C.

The inverted cathode support ring results in cathode subassemblies with better uniformity and increased ruggedness.

The temperature controller has been shown to decrease operator skill necessary to perform uniform exhaust cycles.

The extended life test has completed 1795 hours. The complete data and failure analysis will be presented in an addendum to the Final Report.

#### **PURPOSE**

The purpose of this contract is to evaluate certain areas of advanced tube manufacturing techniques and apply them where feasible to JAN 6299 to result in a more reliable and better performing tube. The objective requirements for the improved tube are Signal Corps Technical Requirement SCS-90 (Improved JAN 6299) and operation at a tube temperature rating of 225° C. The areas investigated were:

- 1. Improved alignment, concentricity and ceramic strength.
- 2. Improved anode to ceramic seal.
- 3. Temperature control at exhaust.
- 4. Improved application of cathode coating.
- 5. Improved cathode mounting.
- 6. Improved processing for higher temperature operation.
- 7. Improvement in humidity testing.
- 8. Improved exhaust fixturing.
- 9. Extended life test and tube failure analysis.


#### NARRATIVE

#### Project I IMPROVED ALIGNMENT, CONCENTRICITY, AND CERAMIC STRENGTH

All eccentricity dimensions presently listed for JAN 6299 are measured with respect to the centerline of the tube using a go, no-go type of gauge as outlined in the existing MIL-E-1/484B specification. Since actual eccentricity measurements would be required for a proper evaluation of improved tube alignment as a result of using tighter dimensioned parts, it was decided to build a gauge capable of providing this type of information. For reasons of simplicity in gauge construction, the grid terminal of the tube was used as a reference and the eccentricity of the anode, cathode, getter, and heater pin terminals were measured from this point. An illustration is shown in Figure 1.

In an effort to improve the alignment and concentricity of the tube, the ceramics and metal parts have been made to tighter tolerences. The ceramic composition has been changed from forsterite to 96% alumina in the heater, getter, and anode ceramics for greater strength. The cathode ceramic, when changed to 96% alumina, produced a median Cgk of 4.81 pf. This is an increase of 31.8% over the bogy value of 3.65 pf. Redesign of the cathode ceramic to compensate for a change of this magnitude, it is felt would be a major design change.

The improvements made in this project enable improved exhaust fixturing (Project IX) to further improve alignment and concentricity of the tube.

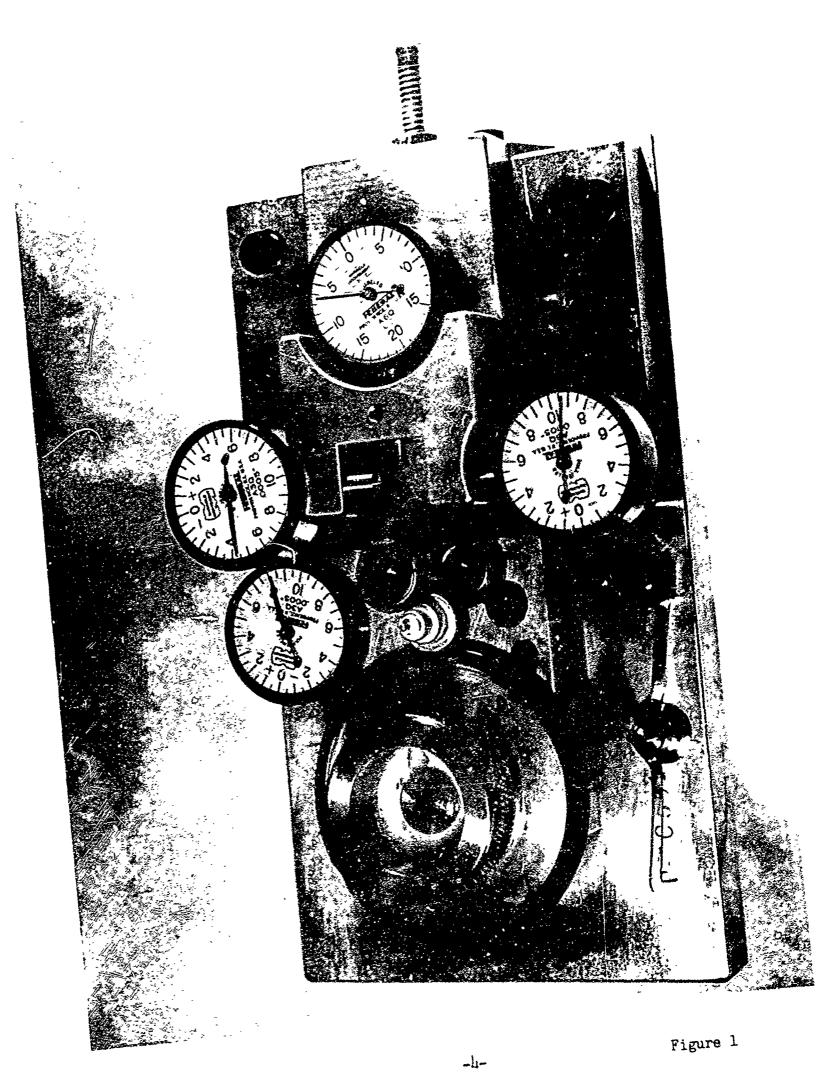

Eccentricity Gauge


#### Project II IMPROVED ANODE SEAL


The general configeration of the present design and the hard solder designs is shown in Figure 2.

The getter ceramic was redesigned to provide a better sealing surface for the hard solder seals. The material was changed from forsterite to 96% alumina for improved strength. The two metal shells were changed from copper clad steel to #142 nickel-iron alloy to obtain a closer expansion match. A new getter assembly was obtained to fit the new configeration. The butt seals were obtained utilizing silver-copper eutectic.

The anode seal is a butt seal using silver-copper eutectic. Care must be taken when metalizing this seal to prevent grid-plate capacitance from being too high.

It was found during the course of the contract that the metalizing was not giving consistently strong seals. A much better seal was obtained by using a metalizing mix of finer particle size to give better adhesion to the ceramic at the butt seals.

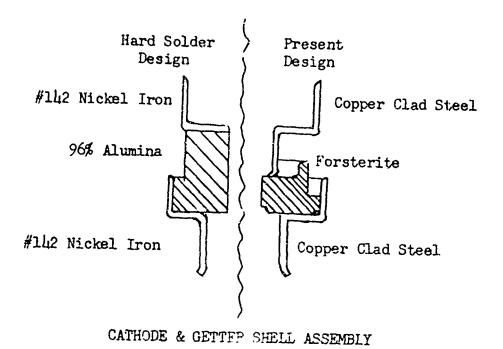

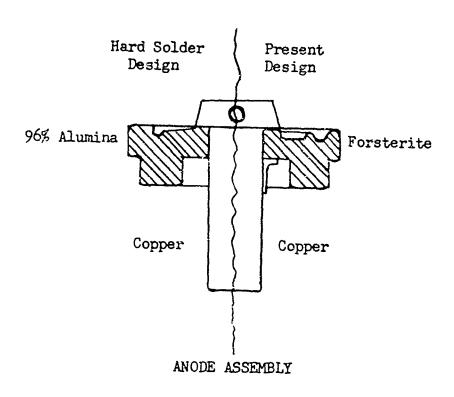

CONFIGURATION OF PRESEAL AND ANODE SEALS

Figure 2

#### Project III TEMPERATURE CONTROL AT EXHAUST

One of the major factors contributing to the variation experienced in tubes is the lack of temperature control at exhaust. A molybdenum oven encloses the tubes in a fixture and RF energy is used to heat the oven, outgassing and sealing the tubes.


The temperature controller shown in Figure 3 was used to regulate the RF energy input during exhaust processing. Several trial neating schedules were examined, with the best results obtained using a schedule approximating the schedule being used in production.

The temperature controller was used to control processing on two exhaust sets during the day shift and the method of observation of Isobutyl Methacrylate and titanium hydride pressure breakdowns was used to indicate the manual settings on the night shift as in the last quarter.

An evaluation was undertaken of the difference in exhaust losses by the two methods. There were 2320 tube mounts exhausted by the manual method and 1580 tube mounts exhausted in conjunction with the temperature controller. The temperature controller method had 2.3% less exhaust shrinkage than the manual method. This would indicate the temperature controller gives more consistent processing at exhaust resulting in better uniformity of seals.

Test data was tabulated for 1293 of the tubes processed at exhaust by the temperature controller and 1500 tubes which were processed at exhaust by the manual control method. The tubes with exhaust processing regulated by the temperature controller had a 5.6% improvement in yield. This also indicates improved processing which is resulting in more consistent tube quality.


The temperature controller does decrease the operator skill required to perform a uniform exhaust cycle and therby insures a more consistently uniform product.

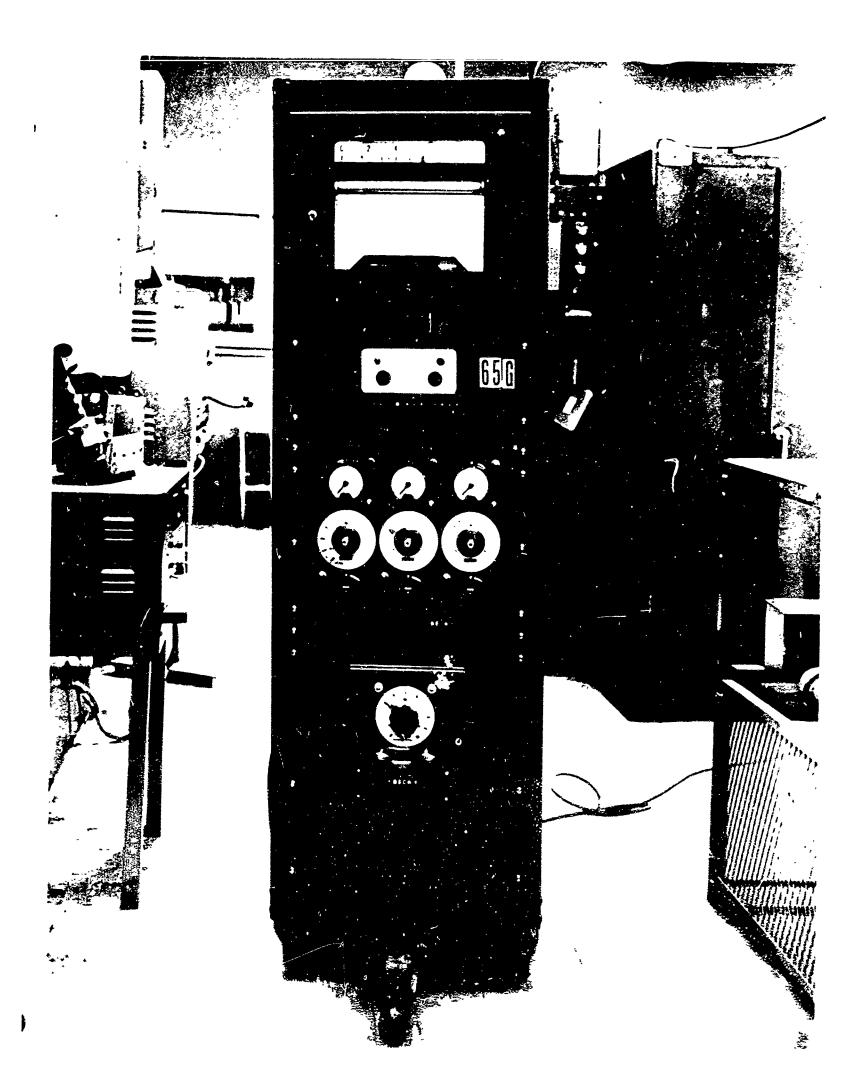


#### Project IV OPTIMIZE CATHODE COATING

In order to reduce variations in cathode coating density, an evaluation of cathode spray guns, spray fixtures and cathode density was undertaken. A Paasche A - Automatic spray gun was composed with the DeVilbiss spray gun in use and found to give more uniform results. An improvement was made in fixturing used to hold the cathode during the spraying operation to prevent over spray. Production controls were established to maintain the proper spray density.

fixtures continue to give uniform results in production. An illustration of the spray booth is shown in Figure 4. The life rack used for evaluation of this project is shown in Figure 5. The spray density life tests indicated for favorable life test results, the density should be greater than 1.0 mg/mm<sup>3</sup>. Cathode spray density has been adjusted from 0.9 - 1.05 mg/mm<sup>3</sup> to 1.25 - 1.35 mg/mm<sup>3</sup> on production tubes. The 1.25 - 1.35 mg/mm<sup>3</sup> density gave good life test results and is easier to activate than the higher density groups. The spraying of the higher cathode densities are also more difficult to control in production with the present cathode spray equipment. In view of data derived in this test, coupled with manufacturing experience, it is felt that the 1.25 - 1.35 mg/mm<sup>3</sup> density group will greatly improve the quality of the tube.

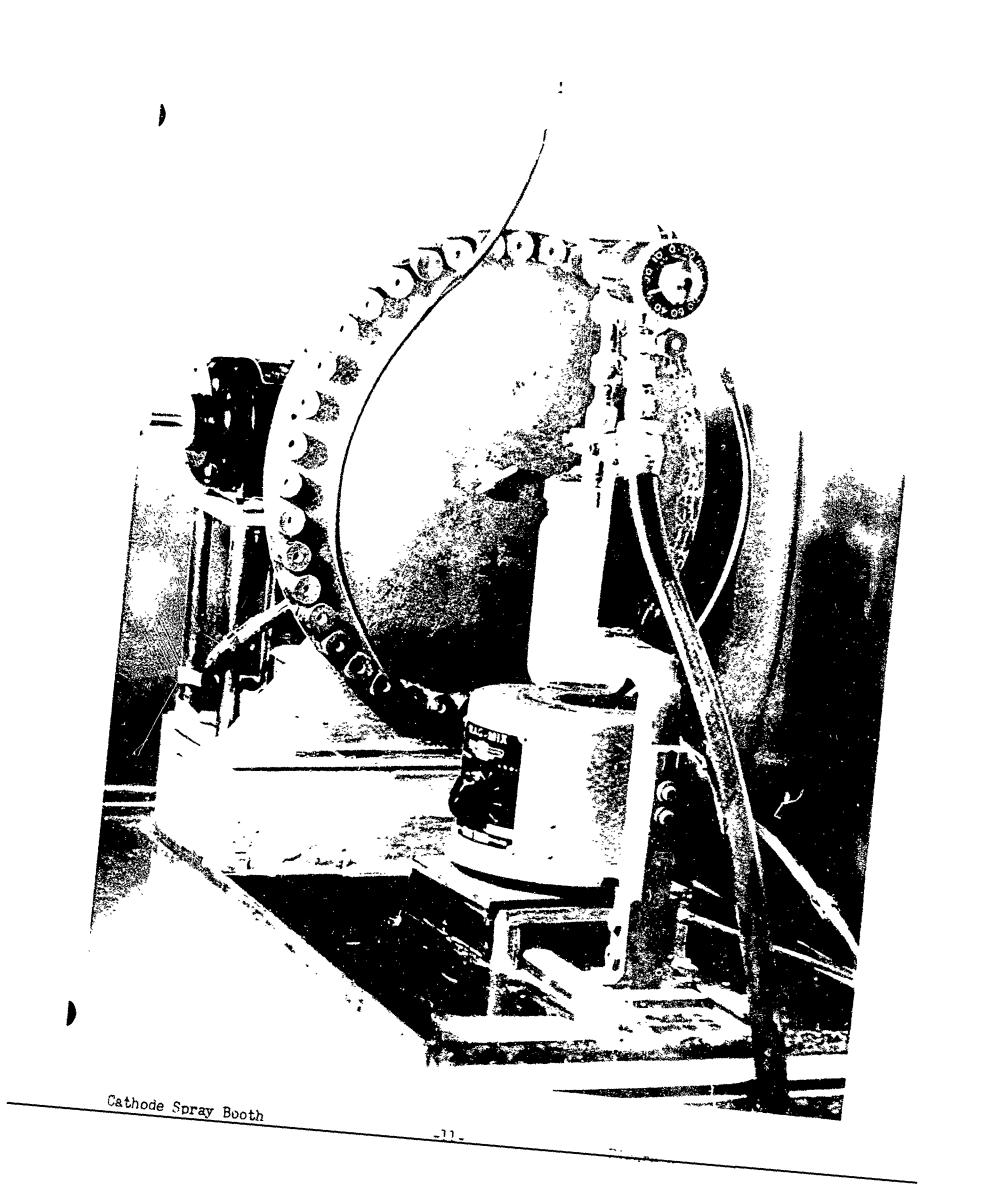

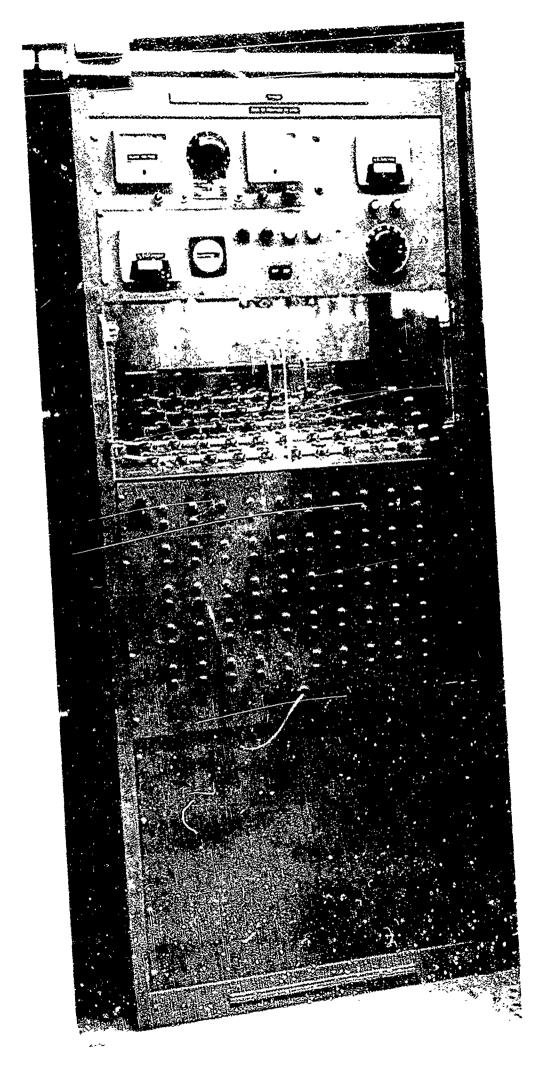

Life Rack -12- Figure 5

#### Project V IMPROVED CATHODE MOUNTING

Two methods of improving cathode mounting were investigated, a brazed cathode support ring assembly and a welded cathode support ring assembly. These two constructions were built with various cathode foil thicknesses and cathode temperature was measured for each construction. These were then compared with the present construction 6299. The most promising construction of each type was then sealed into tubes. The construction where the cathode is welded to the cathode support ring could not be made with satisfactory yields although cathode temperature appeared to be correct. The cathode assembly with the cathode support ring brazed to the cathode gave satisfactory results. This construction utilized .00045" cathode foil material. A more rugged assembly with better contact to the cathode shell is realized by use of this method. The variations due to tilting and canting of the individual clips of the old method of assembly are eliminated.

#### Project VI HIGH TEMPERATURE OPERATION


An evaluation was performed on tubes to obtain satisfactory operation with the anode seal at 225° C. A major problem encountered was deterioration of the plating. Luring high temperature life, the copper plating diffuses through the gold plating of the JAN 6299. This causes a very poor contact surface which results in degradation in high frequency performance. The solution to the diffusion of plating was to plate nickel over the copper, then gold over the nickel. This nickel barrier prevents the deterioration of the plating and good high frequency results are obtained.

Most failures due to air leakers of the regular construction 6299 during the evaluation were found to be at the anode seal. To eliminate this weakness, the hard solder seals at the anode and preseals were utilized. This increases reliability of the tube under high temperature life conditions.

A. C. aging will be used to process tubes for high temperature life. Results have been good using this type aging. The cathode structure is rather cool for this tube to operate adequately as an h.F. oscillator from field results where it was used in this application. R.F. aging is more expensive initially and raintenance is of a higher cost.

Life test results have shown the construction with three of the seals of hard solder construction is superior to the regular construction on life when the anode seal is run at 225° C.

An illustration of the high temperature life rack is shown in Figure 6.

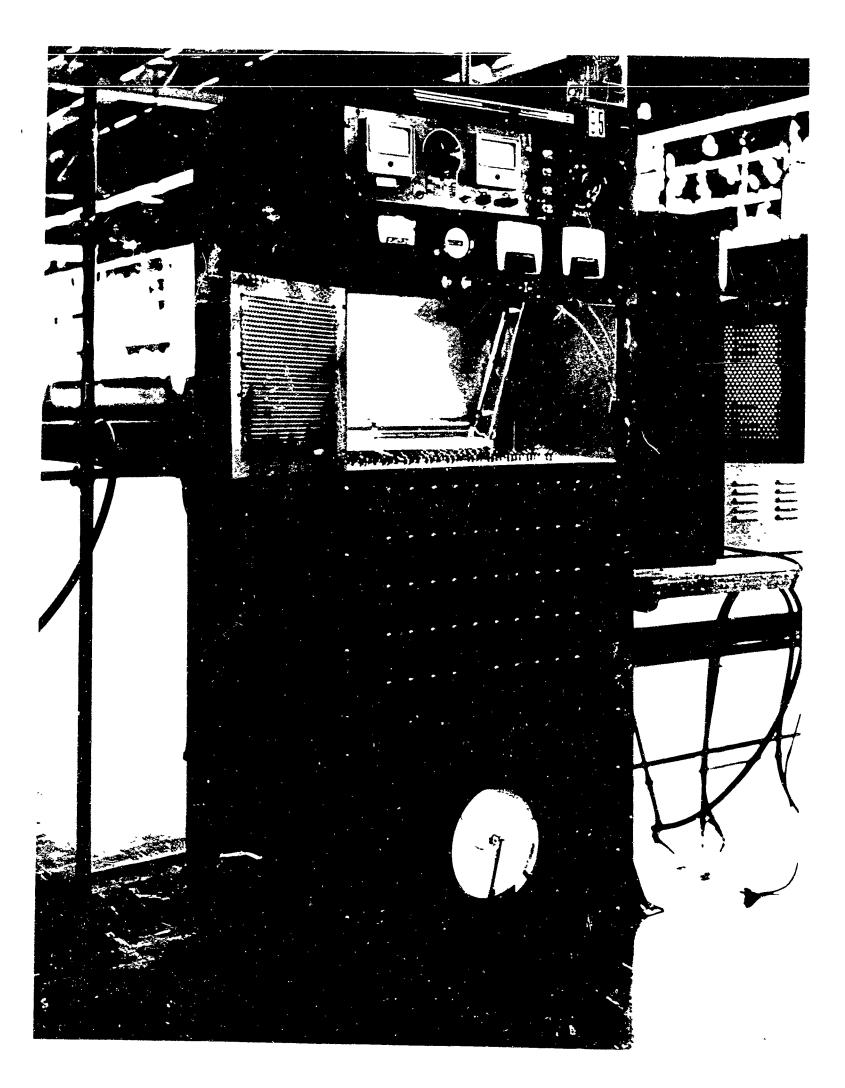

High Temperature Life Rack

#### Project VII HUMIDITY TESTING

It has been demonstrated by gas cooling curves and mass spectrometric gas content analysis that the failure mechanism of the JAN 6299 when subjected to a temperature of 100° centigrade and 100% humidity is due to a build up of hydrogen gas pressure in the tube. The increased mobility of the hydrogen gas as compared to air causes a marked increase in heater current over that found in a tube which is an air leaker.

The conclusion reached after work on this problem is the failure mechanism is due to hydrogen permeation of the JAN 6299's metal shell. The shell material is .010" thick 10-80-10 copper clad AISI 1010 steel alloy. After processing of the tube is complete, a cupper-gold electroplating is performed. If there is the slightest pinhole in the protective coating, the base metal of the metal shell will corrode when subjected to the conditions of the humidity test chamber. The hydrogen generated by the corrosion reaction diffuses through the steel wall and recombines as H2 inside the tube if no barrier exists. Tubes that show obvious corrosion but no indication of hydrogen, probably have long diffusion paths as a result of the location of the corrosion and/or the presence of a continuous copper layer on the inside surfaces which acts as a fairly effective barrier at the temperature in question.

The hydrogen must be formed at the base metal in order to permeate into the tube. Examination of lend-metal and lead-ceramic boundaries of tubes before and after humidity test have not shown any change in condition. Since lead's susceptibleness to hydrogen permeation is very slight

or nil at these temperatures, it is felt that seal corrosion does not contribute to hydrogen permeation. Also tests in which the seal areas were covered with a protectant, showed no significant improvement over other tests. In fact, several groups where there is doubt of the curing of a silicene which was used, an apparent severe attack upon the plating over the tube in general was observed (confinement of the silicene to the seal area only being difficult - a considerable amount came in contact with the metal shell). Failure rates were very high. In general, when lower corrosion rates were observed on the metal shell there were lower failure rates due to hydrogen permeation.

Several lots of tubes which showed good results on humidity test had different processing dates up to the plating operation. With a common plating operation, good results were obtained.

A noted improvement was obtained in humidity test results when the gold plating bath was corrected to give a better plating. The gold content had been allowed to drop to a low level by an inaccurate method of measuring gold content. When this was corrected, corrosion of tube subjected to humidity test was reduced.

During the plating operation, hydrogen also permeater into a percentage of tubes. The hydrogen forms at the base metal due to the plating reaction and if a suitable diffusion path exists, the tube will become filled with hydrogen.

ight

£

tric

1p-

а


of

ive

In order to reduce this plating hydrogen permeation and also to give more copper barrier for the resistance of hydrogen penetration during the humidity test conditions an improved method of removing excess lead from the metal parts has been developed. The existing method was to chuck the tube to a motor and while rotating at a high speed, remove the lead with a file. This was highly dependent on operator technique and in most cases much of the outer copper clading was removed, allowing the base metal to become exposed. The improved method utilizes a rotating wire brush. The lead is removed by this brush and very little copper clading is removed.

Shown in Figure 7 are some illustrations of corrosion and possibile flaws in the platings and copper clading. The grid flange shown where virtually all clading has been removed was cleaned by the old method of using a file on the tube.


In summary, the failure of the 6299 during humility test has been found to be due to hydrogen permeation of the base metal of the tube's shell. Best minimization of this problem has been obtained by improved cleaning methods and improved plating techniques which give protection to the base metal of the tube's shell.

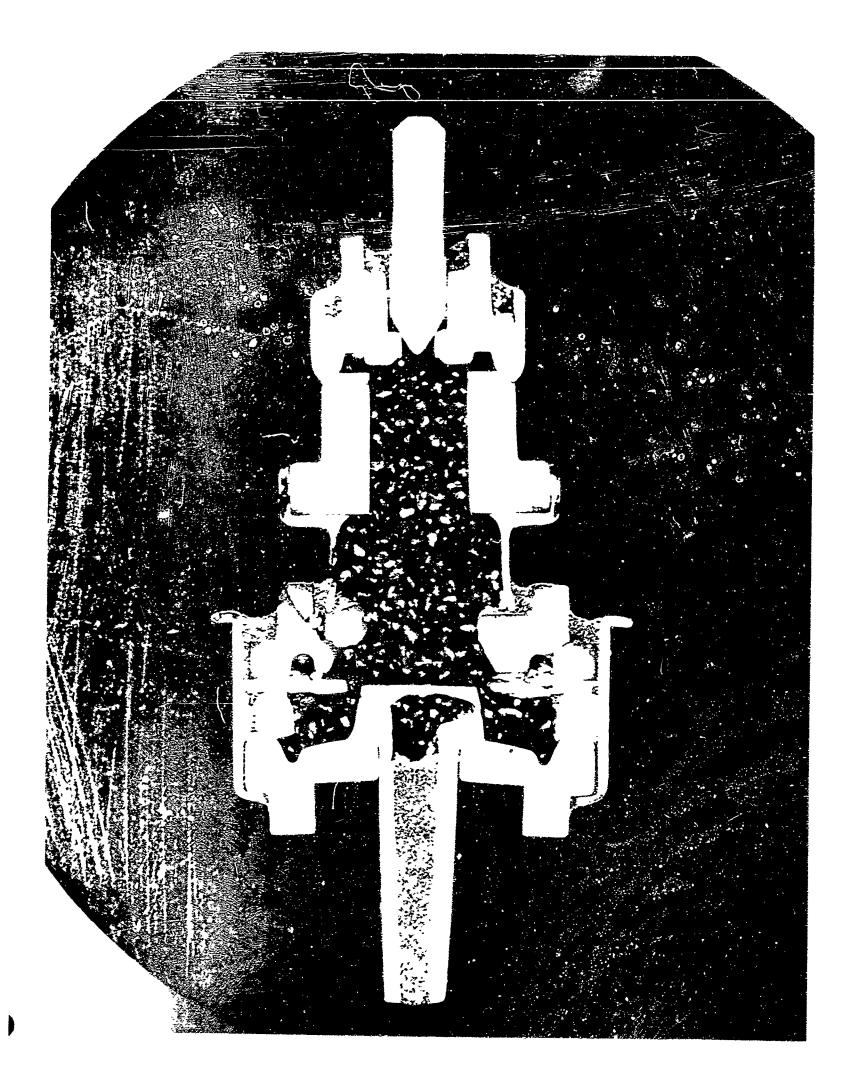

Surface Conditions and Corrosion Of The 6299 Puring Humidity Test



50X

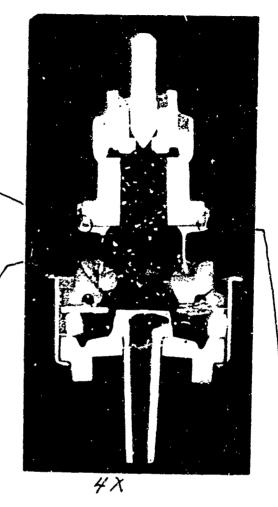

6299 tube- Cu clad 1010 with

Ext Ni clentroplate + innersion Au.

39 days at 100°C., 100% humidity.

Localized bose metal corrosion

has progressed nearly through

thickness of flouge. -20-



Figure 7 B

- A4 - Ni - Electroplated Cú - Clad Cu - Steel base netal -Electropleted Steel base

Cu clad 1010 by a Cu clad 1010 by a Cu + Ni cketroplate + ejectroplated Au. + the constinuity in the Cu cladding is typical of several areas in one cross sectional plane. Etchant. NHyOH+ H2O2 500X.

Same as above, but different area.
Note absence of Cu cladding.
Base metal has exidized uyder the electroplate.
Note base metal grain distortion at surface.
Etchant: WHYOH + H.O. C. Nital

-Au
-N;
-Flectroplated
Cu
-430 stm. stl
base metal

Note: None of the tubes with alumina ceramics showed any Cu rating-N' plated directly

Cu clad 430 stainless steel base metal

Cut Ni electroplate

the electroplate

the absence of

Cu clodding.

Penetration of

moisture und air

through a detect


in the pluting


has essent orrasion

of base metal

Etchont: NHyphth'

5012.

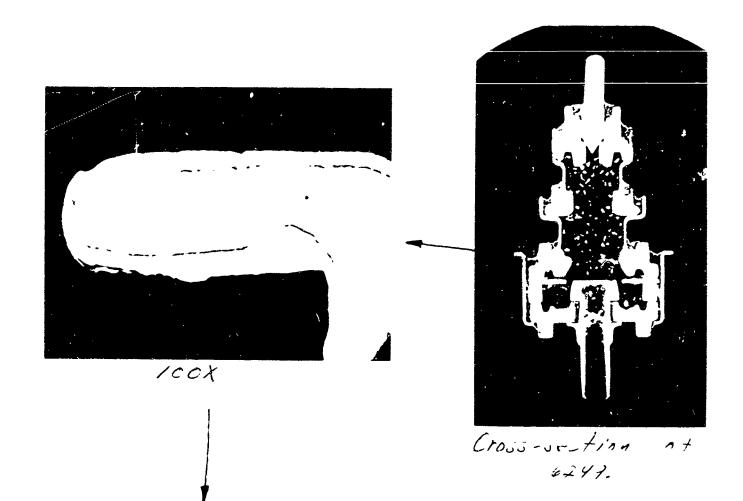

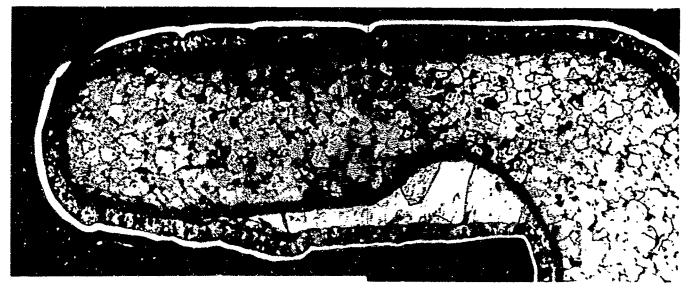

200X

Cu clad 1010 bose. Cut Ni electroplate + immersion Ha.

Note variation in cladding and cleetroplating
over a relatively small area.

Etchant: NHy M+ Hair; Nital.

#### Project VIII ENGINEERING SAMPLES AND FILOT RUN

Engineering samples were submitted in April, 1962. After transfer of facilities from Scranton to Owensboro, another group of engineering samples were submitted in February, 1963 showing work done to that point.

Preproduction samples were constructed incorporating the improvements made under the various projects.

Alumina heater, getter, and anode ceramics were used with hard solder seal construction being utilized for the preseal assembly and anode seals. Parts were used with the tightened tolerances. The improved cathode construction was used and the cathode spray techniques developed were used in coating the cathode. The tubes were exhausted in the improved exhaust fixturing in conjunction with the temperature controller. The wire brush method of cleaning was used to remove excess lead after exhaust. The tubes were d-c and a-c aged and copper-nickel- gold plated.

A mutually acceptable working specification was established for preproduction and pilot run testing. This specification is shown in the appendix. The preproduction run conformed to the test specification.

The pilot run was started on 24 January and was terminated on 14 February due to poor yields. The tubes had very poor emission and this was caused by the cathode temperature being approximately 50°C. too cool. This problem was caused by increased copper flow while brazing the cathode assembly. The length of the legs of the cathode su port ring was shortened and cathode temperature has been adjusted to the proper value. Considerable delay and excessive subassembly and tube losses were experienced due to inconsistent metalizing of the high alumina ceramics used in the hard solder seals. Stronger and much more consistent hard solder seals have been obtained by using finer particle size in the metalizing mix.

1/4

The 2000 tubes produced in the pilot run were scrapped as well as in-process cathode, ancde and preseal subassemblies.

A new pilot run was begun with the cathode temperature corrected to the normal value and with the three hard solder seals utilizing the finer particle size metalizing mix.

ELECTRICAL CHARACTERISTICS 6299 PEM Pilot Run

Table I

なだせる	₹5°°	TD 40 J*	-Λ. ω	1	Tube
300 300 300 300 300 300 300 300 300 300	800 100 100	8 2 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3	306 306 306 306	906 105 105	If
	S. S. C. S	565		• • • • • • • • • • • • • • • • • • •	। हिं
12.8 13.2 14.0	こればい	7 th th	13.6	15.6 15.6	Sm
7.7.1 1.06 1.00	110	124	811 811 901	136 111	Mu
120 120 120 120	1255 5655	150 150	136 138	136 130	ទូ
17.2 17.6 18.0 18.0					
7.857	7.87.	7.2.2 7.2.2.	\$7.7 \$0.70	7.2 7.8	N N
11.6	11.0	8. 11. 8.	; ; ; ; ;	10.1 10.1 10.1	Gažii 3000
13.0		8°31 8°31	# # # • • • •	13.1 13.4	K N
3.50	,	00°00 00°00 00°00	0,00 0,00,00 0,00,00	3.70 3.35	Cin
1.76 1.80 1.76	7.1.1.3 8883	11.2	1.74	1.66 1.70	Cgp
510. 110. 510.	310.	610. 110.	.014 910.	.015 Pf	Cout
4444					
0 + + + + + 0 0 0 0 0 0 0 0 0 0 0 0 0 0	5 0 0 0 V 2 2 2 1	20+ 20+ 20+ 1-	* + + \$ 0 \$ 0 \$ 0	+0+ +05 <b>B</b>	Ндр
w ~ ~ ~ i	0 N N C	<b>ω <u>←</u> ω</b>	ω <b>, ν</b> ω	r ω ξ	bvib
7755	0 0 0 0	200	, , , , ,	7.6	Ik

Table II

HUMIDITY TEST DATA

6297 PEM Pilot Run

Days	0	5	6	9	10
Tube No.					
1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20	305 309 308 310 307 309 304 315 319 310 309 300 311 301 306 310 307	305 310 305 318 310 310 305 320 318 322 310 310 300 310 300 305 305	308 310 305 315 308 309 305 312 313 320 310 308 300 310 300 310 306 312	310 310 305 310 308 307 310 312 312 320 310 307 302 310 400 310 303 308 310	310 308 305 310 305 308 312 313 318 310 308 303 311 720 310 305 308 310

% Rejects (10 Days) = 1/20 = 5%

Table III

#### HIGH TEMPERATURE LIFE TEST D'TA

#### 6299 PEM Pilot Run ELECTRONIC TUBE LIFE TEST DATA

Eb-200 VDC Ambient Temp.=75° C. Life Test Conditions: Ef=6.3V RK/Tb=10Ma

Accum. Hrs. 0 500

### Test Characteristic/Tube No. 1

If	307	307
RGK	5+	5+
RGP	50+	50+
Eg	.40	.30
Gm	14.9	13.7
Mu	129	131
ľk	7.3	6.2
Eb	149	157
N	7.5	7.6
G	18.8	17.2
Cin	3.49	3.50
Cgp	1.68	1.69

### Test Characteristic/Tube No. 2

303	306
	5+
50∻	50+
•59	.65
14.3	13.2
113	115
4.1	4.4
124	121
7.9	8.6
17.1	17.0
3.93	3.82
2.00	2.13
	5+ 50+ •59 14.3 11: 4.1 124 7.9 17.1 3.93

# HIGH TEMPERATURE LIFE TEST DATA

## 6299 PEM Pilot Run ELECTRONIC TUBE LIFE TEST DATA

Eb-200 VDC Ambient Temp.=75° C

Ef=6.3V RK/Tb=10Ma

Accum. Hrs. 0 500

# Test Characteristic/Tube No. 3

If	301	303
RGK	5+	5+
RGP	50+	50+
Eg	.45	•39
Gm	14.9	12.8
Mu	118	118
Ik	4.4	3.3
Er	144	150
N	8.4	8.3
G	17.6	17.6
Cin	3.43	3.20
Cgp	1.71	1.72

# Pest Characteristic/Tube No. 4

If	314	307
RGK	5+	5+
RGP	50+	50+
Eg	•26	.70
Gm	13.9	15.9
Mu	126	124
Ik	5.5	7.2
Eb	144	111
N	7.7	7.5
G	18.1	18.0
Cin	3.42	3.33
Cgp	1.68	1.68

Table IV 6299 PEM Filot Run

# 1000 Hour Life Test Data

Life Test	t Conditio	ns:	Et =	200 6 <b>.</b> 3	VDC V	: Rk/Ib = 10 <b>Ma</b>
Accum. Hi	rs.0	140	)	55	88	1009
Test Char	racteristi	c/ <u>Tub</u>	e No.	1		
If RGK RGP Eg Gm Mu Ik Eb Noise Gain Cin	307 5+ 50+ .50 16.2 120 8.6 133 7.6 19.1 3.54 1.75	5+ 50+ 15.	9	5+ 50 •3 15	+ 0 •5	311 5+ 50+ •17 14.3 123 6.0 159 7.6 18.0 3.44 1.78
Test Char	acteristic	/Tube	e No.	2		
Eb Noise Gain Cin	309 5+ 50+ .45 15.9 127 5.5 143 7.3 19.4 3.56	5+ 50+ 16.0	ı	5+ 50+ •35 15•	; ,9	311 5+ 50+ •24 15•5 127 4•6 150 7•4 18•8 3•51 1•68

6299 PEM Pilot Run

# 1000 Hour Life Test Data

Life Tes	t Conditi	Eb ons: Ef	- 200 VDC = 6.3 V	RK/Ib =	10 Ma
Accum. H	rs.0	140	558	1009	
Test Cha	racterist	ic/Tube No	o. 3		
If RGK ROP Eg Gm Mu Ik Eb Noise Gain Cin Cgp	306 5+ 50+ .45 13.7 112 6.5 143 7.9 17.7 3.41 1.69	5+ 50+ 13.6 7.6	5+ 50+ •39 13•3	310 5+ 50+ .26 12.4 112 5.0 150 7.6 17.8 3.10 1.69	

#### Project IX IMPROVED EXHAUST FIXTURING

The purpose of this project is to further improve alignment and concentricity of the tube beyond that attained in Project I. Improvements made in Project I were attained by reductions in tolerences of tube parts. The basic limitation in making this improvement is the fixtures used to hold the tube's parts during the exhaust and sealing cycle. Materials and design of fixtures were such that warping of the fixture took place during exhaust.

The improved exhaust fixture shown in Figure ô was selected from six designs as giving best results. The center shaft immediately below the fixture top was turned down to allow increased pressure on the tubes during the exhaust cycle.

Cathode, getter, and heater pin eccentricity data were taken on 102 regular production tubes solected at random. After a familiarization and debugging run. 110 tubes were exhausted in the improved exhaust fixtures and eccentricity data was taken. Eccentricity data was taken with the eccentricity gauge (P69087-2390591 Rev 0) as presented in the Second Quarterly Report. Probability plots of that data are shown in Figures 9, 10, and 11.

The data shows the greatest improvement in heater pin eccentricity. This is the area where the most deterioration was caused by the old exhaust fixtures. The getter eccentricity appears to have improved by having less tubes with very large eccentricities. Anode eccentricity should not be effected by the improved exhaust fixturing.

There appears to be little difference in cathode eccentricities.

A successful reduction of cathode eccentricity should also further improve getter and heater pin eccentricity.

C..... (11 1...)

, , , , , , , , , , , , , , , , , , ,		
	•	
ing the second of the second o		
Wanted to the second	The state of the s	
	,	
	*	
ST STILL BURGE (A)		
ST STL BRACES (=)	• •	
	man and the second of the seco	
~ ·	-1, AND 0-60 NE N - 177.115	·
	The second secon	
	manus (s. 1900). A company of the same page of the same state of t	•
	- TUNGCTON SP- NG	
MOLYBDENUM-	- in	
MOLYBURNUM		
\ <b>*</b>		
MULYBOENUM -	- Pro natu	
	mana dan dan manan dan dan dan dan dan dan dan dan dan	
	The state of the s	
اسا		
	ن	
	- NULY 205 NUM	
<u></u>	/	
	The state of the s	
	. 47% y	
	•	
<b>!</b> .		
house, and an		
	Matter that American streets a first a commencement of the state of th	
4		
1	,	
3 CERAN CS	,	
1		
i J		
· ·		
L & EACTEN		
1 Oct 22 - 62		


1611


. . . .

	0	ડ		300°	. 012	· 5	, j.j.	· 151	عرد.	• > > > > > > > > > > > > > > > > > > >	. 73.	·	٠,٠	a7c.	・ が ら	720.			
Fig	9											ļ							
Figure 9																			
			; ;										., .						
		6	:- : :	<u> </u>			ļ : .	ļ	 			:	1						
•							.: <u></u> .   										HF.A.TE		
			i,	1	-		;	•	•				,				वितित स		
ā			1	14				· · · · · · · · · · · · · · · · · · ·	† ; ;	1		1							
•				A.	TX.		• • • • • • • • • • • • • • • • • • •	<del>******</del>			-						33		
S		<del>.  </del> :  .			\		1 1 5	• . • •-	1	, ,	*- *				· · ·				
<b>5</b>		-			1			** * ****	*								7		
-46-				•.	<u> </u>			Ç	\$ 5			•							
8				· · · · · ·						,						.:			
a 10				***			1		` <b>.</b> ``			,							
		,	•	•							and the same of					:::-			
8			:: † !	,							- 4	- <u></u>					<del>-</del>	<del></del> .   .	
		10:10:1		<u>जिं</u> गाः इ						1	٠., ا	<del></del>			( )	,	,	-	
3		Ting Boyus	- 1	Prince			;	; 1		1	٠,	(-	`\		1	•	••	1	
•		1 1 1 1 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	- 1.	· ·			·	• • • • • • • • • • • • • • • • • • • •	1		**************************************	*****				,,,,			
9		12		 5	-		•	, 1	í	- 1	***************************************					4.7	*****		
3															* ******				
3		1 '							<u></u>										

PROBABILITY PAPER

GENERAL ELECTRIC COMPANY, SCHENECTADY, N. Y., U.

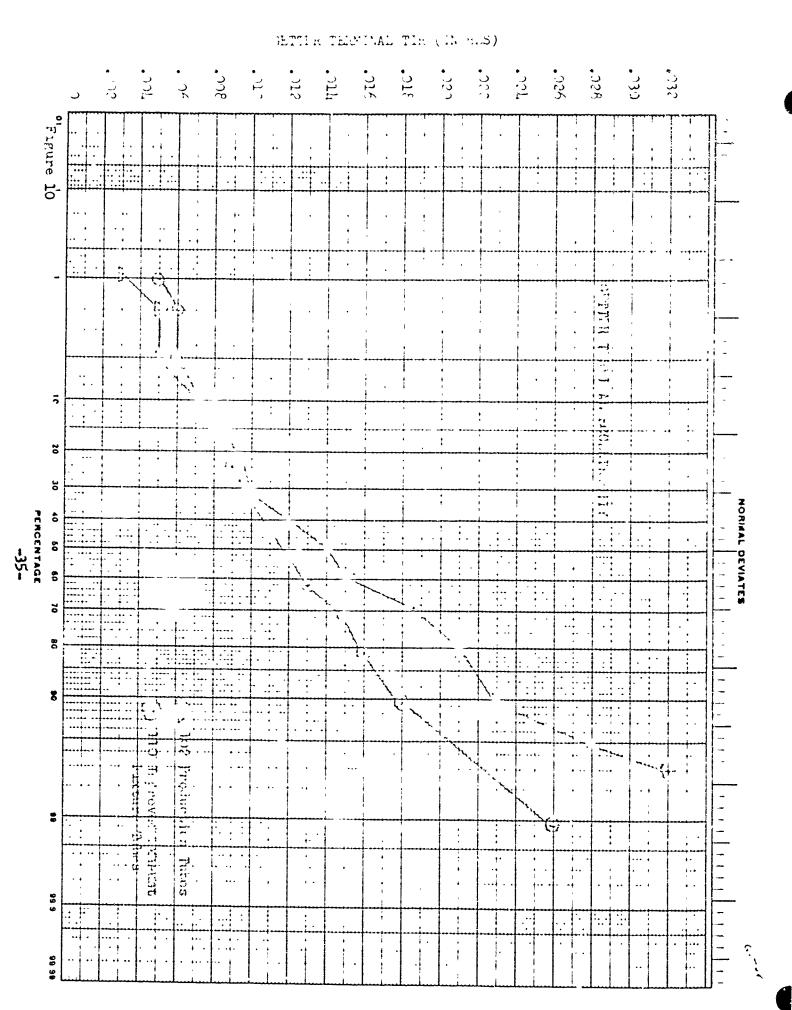

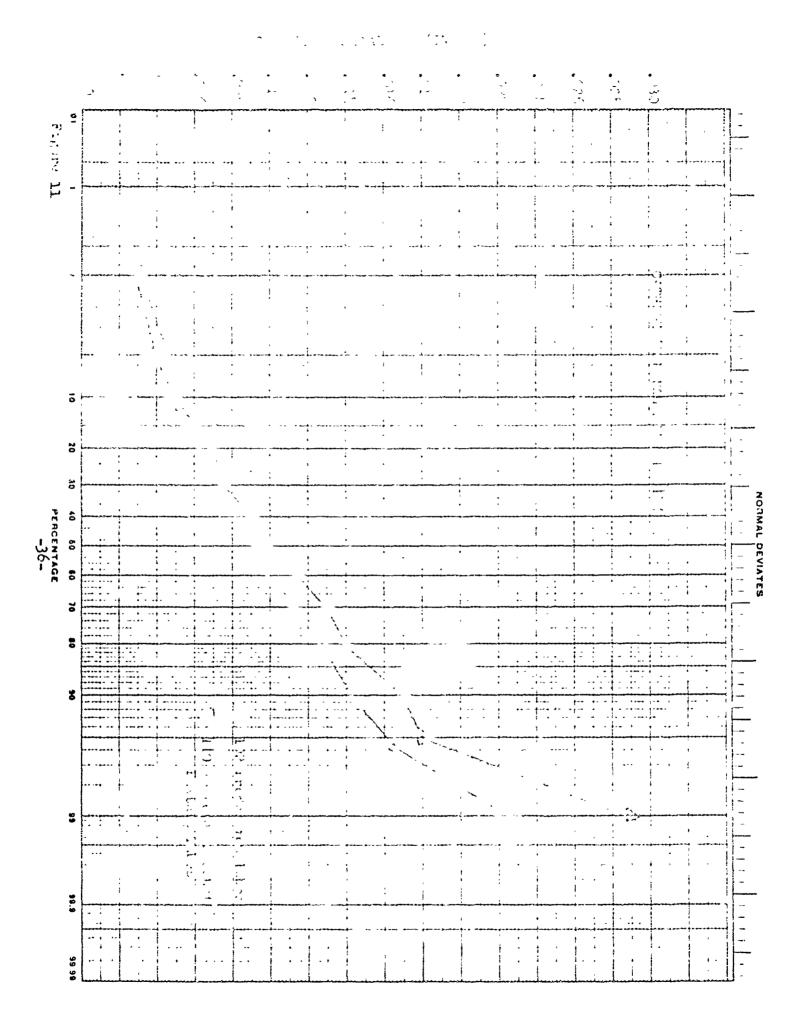

#### Project X EXTENDED LIFE TESTING

This contract and the present MIL specification on the JAN 6299 specify 1000 hour life test. It is well recognized that much longer life than 1000 hours of operation is desired in many Signal Corps equipments. The purpose of this project is to determine the life results of the improved tube to 5000 hours and to determine the nature of any resulting failures so that information can be made available for possible tube or manufacturing improvements.

Control tubes were constructed for extended life testing. These tubes are standard JAN 6299's; however, they do include some of the benefits of the improved cathode spray project. Cathodes were sprayed with the Paasche A-automatic spray gun and the improved masking fixtures were used. The cathodes were sprayed to the density being used prior to optimization of cathode spray.

Tubes were constructed utilizing the improvements developed during the contract. These tubes and the control tubes were placed on life test.

Life test has now completed 1795 hours. Tube No. 8 of the test group failed as an air leaker at 566 hours. These tubes were constructed before the improvements in metalizing techniques were achieved. The hard solder seals are now stronger as a result of the change to finer particle size of the metalizing mix.

All remaining tubes still meet the 1000 hour life test end point. The improved tubes show 7% less median transconductance degradation than the control tubes. The grid voltage degradation is about 20% more in the improved tube. Noise figure, capacitances, and amplification factor are generally stable for both groups of tubes. Life test data is shown in Table V.

The complete 5000 hour life test data and the analysis of mode of failure will be presented in an addendum to the Final Report.

Table V
EXTENDED LIFE TEST
6299 Control Tubes

Life Test Condi+ions: Ef = 6.3 V RK/Ib = 10 Ma  Accum. Hrs.0	T.2.C. m			= 500 ADC		
Test Characteristic/Tube No. 1  If 308 Eg .75 .65 .60 .59 .45 Mu 110 107 108 110 112 Sm 16.1 16.0 15.9 15.8 15.4  Ik 7.0 Eb 115 Cain 18.4 Noise 7.4 7.6 7.6 7.8 7.6 Cin 3.83 3.89 3.91 3.91 3.92 Cgp 1.72 1.72 1.72 1.73 Cok 016 016	Luie T	est Condi+	ions: Ef	≈ 6.3 V R	K/Ib = 10	Ma
If 308  Eg .75 .65 .60 .59 .45  Mu 110 107 108 110 112  Sm 16.1 16.0 15.9 15.8 15.4  Ik 7.0  Eb 115  Cain 18.4  Noise 7.4 7.6 7.6 7.8 7.6  Cin 3.83 3.89 3.91 3.91 3.92  Cgp 1.72 1.72 1.72 1.71 1.73	Accum.	Hrs.O	108	245	406	566
Eg .75 .65 .60 .59 .45  Mu 110 107 108 110 112  Sm 16.1 16.0 15.9 15.8 15.4  Ik 7.0  Eb 115  Cain 18.4  Noise 7.4 7.6 7.6 7.8 7.6  Cin 3.83 3.89 3.91 3.91 3.92  Cgp 1.72 1.72 1.72 1.71 1.73	Test C	haracteris	tic/Tube No	<u>o. 1</u>		
Mu 110 107 108 110 112 Sm 16.1 16.0 15.9 15.8 15.4 Ik 7.0 Eb 115 Gain 18.4 Noise 7.4 7.6 7.6 7.8 7.6 Cin 3.83 3.89 3.91 3.91 3.92 Cgp 1.72 1.72 1.72 1.72 Cok 016 016	Ţī,	308				
Mu 110 107 108 110 112 Sm 16.1 16.0 15.9 15.8 15.4 Ik 7.0 Eb 115 Gain 18.4 Noise 7.4 7.6 7.6 7.8 7.6 Cin 3.83 3.89 3.91 3.91 3.92 Cgp 1.72 1.72 1.72 1.73 Cok 016 036			.65	.60	<u>,</u> 59	.15
Sm 16.1 16.0 15.9 15.8 15.1 1k 7.0 Eb 115 Cain 18.4 Noise 7.4 7.6 7.6 7.8 7.6 Cin 3.83 3.89 3.91 3.91 3.92 Cgp 1.72 1.72 1.72 1.73 Cpk 016 016 016 016 016 016 016 016 016 016						
Eb 115 Gain 18.4 Noise 7.4 7.6 7.6 7.8 7.6 Cin 3.83 3.89 3.91 3.91 3.92 Cgp 1.72 1.72 1.72 1.71 1.73 Cpk 016 016			16.0	15.9		
Gain 18.4 Noise 7.4 7.6 7.6 7.8 7.6 Cin 3.83 3.89 3.91 3.91 3.92 Cgp 1.72 1.72 1.72 1.71 1.73						
Noise 7.4 7.6 7.6 7.8 7.6 Cin 3.83 3.89 3.91 3.91 3.92 Cgp 1.72 1.72 1.72 1.71 1.73						
Cin 3.83 3.89 3.91 3.91 3.92 Cgp 1.72 1.72 1.72 1.71 1.73			2.4	~ /		
Cgp 1.72 1.72 1.71 1.73			-			
Cok 016 016						
1021		•				
Test Characteristic/Tube No. 2	Test Ch	aracterist	ic/Tube No	• 2		•021
If 305						
Εσ 30 20 20 20		- •	30	**	. •	
Mi 108 109 109 30 30	_				-	
Sm 12 5 12 6 12 6	Sm				-	•
Ik 6.8 12.6 12.4 12.4 12.0	Ik			TC 911	±2.44	12.0
Eb 152		152				
Gain 17.6						
Noise 8.0 8.3 7.8 8.3 8.1				7.8	8.3	8.1
Cin 3.61 3.61 3.61 3.62						
Ogp 1.79 1.78 1.78 1.79						
Cpk .012 .003 .012 .013	opk	•015	•003	.012	.011	

### 6299 Control Tubes

Eb = 200 VDC
Life Test Conditions: Ef = 6.3 V RK/Ib = 10 Ma
Accum. Hrs.726 866 1004 1286

	20/	0//	3.00)	3006	31.00	3 500
Accum. H	lrs./20	866	1004	1286	1760	1795
Test Cha	racterist	ic/Tube No	. 1			
If			306			
Eg	•59	<b>.</b> 50	•59	•59	•38	•36
Mu	112	113	115	114	115	113
Sm	15.4	15.3	15.6	14.7	14.4	13.0
Ik			7.9			
Eb			128			
Gain	^	4	18.3			
Noise	7.8	7.6	7.5	7.7	7.3	7.2
Cin	3.92	3.91	3.90	3.87	3.86	3.87
Cgp	1.73	1.72	1.72	1.72	1.72	1.72
Cpk	.016	.016	.016	.01.7	.016	.015
Test Cha	racterist	ic/Tube No	. 2			
If			300			
Eg	•39	•39	.30	۰39	•30	.11
Mu	109	110	110	iii	111	109
Sm	11.8	11.8	11.6	11.4	11.0	10.0
Ik			7.0			
Eb			15.3			
Gain			17.4			
Noise	8.2	8.0	8.0	8.3	7.7	7.9
Cin	3.61	3.61	3.60	3.60	3.59	3.59
Cgp	1.79	1.79	1.79	1.78	1.78	1.78
Cpk	.012	.014	.011	.013	.011	.014

EXTENDED LIFE TEST

### 6299 Control Tubes

Eb = 200 VDC Life Test Conditions: Ef = 6.3 V RK/Ib = 10 Ma Accum. Hrs.0 108 245 106

Accum. H	rs.0	108	245	406	566
Test Cha	racteristic	Tube No.	3		
If Eg Mu Sm Ik	305 .70 106 15.9 7.6	.65 105 16,3	.65 106 15.8	.65 107 15.6	.65 105 15.8
Eb Gain Noise Cin Cgp Opk	121 18.8 6.8 3.90 1.77 .016	6.9 3.89 1.77 .016	6.8 3.89 1.78 .016	7.3 3.87 1.77 .01	7.2 3.90 1.79 .017
Test Char	racteristic	Tube No.	<u>li</u>		
If Eg Mu Sm Ik Eb	308 .45 119 14.5 4.0 142	•39 119 14.4	.30 118 13.5	.30 120 14.0	.15 121 11.7
Gain Noise Cin Cgp Cpk	18.2 7.5 3.88 1.71	7.3 3.87 1.70 .014	7.3 3.56 1.70 .014	7.5 3.87 1.70 .014	7.4 3.87 1.72 .016

Eb = 200 VDC Life Test Conditions: Ef = 6.3 V RK/Ib = 10 Ma										
Accum. Hr	s.726	866	1004	1286	1490	1795				
Test Char	Test Characteristic/Tube No. 3									
If Eg Mu Sm Ik Eb Gain	.65 107 1.5.7	.59 106 15.li	301 .65 106 15.2 7.2 124 18.8	.60 108 15.0	.59 107 14.5	.52 105 14.2				
Noise Cin Cgp Cpk	7.0 3.90 1.79 .016	7.0 3.90 1.78 .017	7.0 3.90 1.78 .016	7.1 3.89 1.78 .016	7.0 3.88 1.78 .015	6.9 3.88 1.78 .016				
	racteristic	/ rube no.								
If Eg Mu Sm Ik Eb Gain	.30 120 13.8	.30 120 14.0	303 •39 120 14.0 4.7 54 18.4	.39 120 13.9	.25 121 13.4	.26 119 13.8				
Noise Cin Cgp Cpk	7.5 3.86 1.71 .015	7.4 3.86 1.71 .010	7.2 3.85 1.71 .016	7.4 3.84 1.71 .015	7.1 3.84 1.71 .015	7.3 3.84 1.71 .015				

EXTENDED LIFE TEST

## 6299 Control Tubes

Eb = 200 VDC Life Test Conditions: Ef = 6.3 V RK/Tb = 10 Ma

THE LEST COUGITIONS: EL = 0.0 A KV 10 = TO MS							
Accum. H	rs.0	108	245	406	566		
Test Cha	racteristic	Tube No.	<u>5</u>				
If	308						
Eg	•45	•39	•39	.28	.30		
Mu	127	125	124		125		
Sm	14.0	13.9	13.9	13.8	13.5		
Ik	5.7						
Eb	149						
Gain	18.2						
Noise	7.6	7.3	7.2	7.5	7.7		
Cin	3.60	3.61	3.60	3.60	3.62		
Cgp	1.70	1.71	1.71	1.70	1.71		
Cpk	.012	.013	.013	.012	.013		
Test Char	racteristic	Tube No.	6				
If	309						
Eg	•39	•39	•30	13.1	.12		
Mu	114	114	110	115	114		
Sm	13.3	13.0	12.8	13.1	10.8		
Ik	7.6						
Eъ	146						
Gain	18.0						
Noise	7.6	7.7	7.6	7.8	7.9		
Cin	3.53	3.53	3.53	3.52	3.54		
Cgp	1.75	1.75	1.75	1.75	1.76		
€7k	.012	•013	.012	.012	.013		

### 6299 Control Tubes

Eb = 200 VDC Life Test Conditions: Ef = 6.3 7 RK/Tb = 10 Ma

D. 100	o conaror	0.m. Dr	J. J. 9 141	, 10 10 11	~	
Accum. H	irs.726	866	1004	1286	1490	1795
Test Cha	racterist	ic/Tube No	• 5			
If			301			
Eg	.19	•25	•25	•30	•25	.10
Mu	127	127	127	128	128	125
Sm	13.3	13.1	13.0	13.0	12.4	12.0
Ik			6.6			
Eb			163			
Gain			17.5	- 0		- 0
Noise	7.5	7.6	7.5	7.8	7.3	7.8
Cin	3.59	3.59	3.58	3.58	3.56	3.56
Cgp	1.72	1.71	1.71	1.71	1.72	1.71
Cpk	.012	.013	.012	.014	.013	.013
Test Cha	racterist	ic/Tube No	6			
If			307			
Eg	•30	•20	•30	•30	.19	.13
Mu	115	116	115	116	115	111
Sm	12.6	12.4	12.1	12.1	10.9	11.6
Ik			7.6			
Eb			162			
Gain			17.2	_		
Noise	7.9	7•7	8.1	8.1	7.5	7.6
Cin	3.52	3.52	3.51	3.50	3.50	3.49
Cgp	1.76	1.75	1.75	1.75	1.76	1.75
Cpk	.013	.008	.012	.014	<b>.01</b> 0	.012

EXTENDED LIFE TEST

## 6299 Control Tubes

Eb = 200 VDC Life Test Conditions: Ef = 6.3 V RK/Tb = 10 Ma								
Accum. Hr	s <b>.</b> 0	108	245	406	566			
Test Char	acteristic,	Tube No.	<u>7</u>					
If Eg Mu Sm Ik Eb	304 •55 113 16•2 7•5 128	.65 111 16.7	.59 109 16.3	.55 113 16.5	.30 113 16.2			
Gain Noise Cin Cgp Cpk Test Char	18.8 6.8 3.84 1.72 .015	7.2 3.86 1.72 .015	7.0 3.86 1.72 .015	7.1 3.87 1.72 .014	7.3 3.89 1.73 .315			
If Eg Mu Sm Ik Eb	313 •99 87.0 14.0 7.2 106	.60 88.9 16.3	.90 86.4 13.2	.90 37.9 13.7	.79 88.7 12.6			
Gain Noise Cin Cgp Cpk	18.2 7.3 3.64 1.88 .18	7.3 3.66 1.89	7.2 3.65 1.89	7.7 3.65 1.88	7.9 3.65 1.70			

### 6299 Control Tubes

Eb = 200 VDC Life Test Conditions: Ef = 6.3 V RK/Ib = 10 Ma Accum. Hrs.726 - 866 1004 1286 1490 1795 Test Characteristic/Tube No. 7 If 300 .59 .59 · 113 .50 .50 .50 -40 Eg 114 114 Mu 114 177 113 15.9 Sm15.9 15.3 15.8 15.3 15.2 8.5  $\mathbf{I}\mathbf{k}$ ZD 132 17.9 Gain 7.0 7.0 7.3 Noise 7.1 7.0 7.0 3.89 3.89 3.88 3.86 3.86 Cin 3.88 1.72 Cgp 1.73 1.72 1.72 1.72 1.72 .015 Cpk .012 .014 .016 .015 .015 Test Characteristic/Tube No. 8 309 4 If .35 .85 .85 Eg .89 .80 .71 67.8 98.0 86 88.5 89.0 Mu 88.0 12.7 12.2 Sm13.0 13.0 12.7 12.0 Ik 6.3 Eb 114 16.4 Gain Noise 7.7 ·7.2 7.3 7.5 7.7 7.2 3.61 3.58 Cîn 3.63 3.58 3.64 3.60

1.90

.017

Cgp

Cpk

1.90

.018

1.90

.018

1.90

.012

1.90

.019

1.90

.018

EXTENDED LIFE TEST

#### 6299 Control Tubes

Eb = 200 VDC Life Test Conditions: Ef = 6.3 V RK/Tb = 10 Ma

File le	st conditi	lons; LI =	. 0.3 v uv	1/10 = 10 M	a
Accum. 1	Hrs.0	108	245	406	566
Test Ch	aracterist	ic/Tube No	9		
If	305				
Eg	.65	•70	<b>.</b> 65	.65	.65
Mu	98.3	97.2	97.9	98.2	98.7
Sm	13.6	14.1	13.9	14.0	13.4
Ik	<i>6.</i> 0				
Eb	127				
Gain	18.1		_		
Noise	7.2	7.3	7•4	7.4	7.3
Cin	3.69	3.69	3.69	3.69	3.70
Cgp	1.78	1.78	1.78	1.77	1.79
Cpk	.016	•016	.016	.015	.010
Test Cha	aracterist	ic/Tube No	. 10		
If	309				
Eg	•39	•59	•50	•45	.15
Mu	118	116	115	116	116
Sm	12.7	13.9	13.2	13.8	11.6
Ik	5•3		-	_	
Eb	110				
Gain	17.8				
Noise	7.8	8.4	٤.2	7.9	7.8
Cin	3.86	3.80	3.80	3.80	3.81
Cgp	1.74	1.75	1.75	1.75	1.75
Cpk	.014	با10.	.014	.013	.014
		•			

Eb = 200 VDC Life Test Conditions: Ef = 6.3 V RK/Tb = 10 Ma									
Accum. Hi	rs.726	866	1004	1286	1490	1795			
Test Char	Test Characteristic/Tube No. 9								
If Eg Mu Sm Ik Eb Gain	.65 100 13.3	.59 9 <b>9.</b> lı 12 <b>.</b> 9	301 •59 100 12.7 6.4 131 18.3	.60 100 12.5	.45 100 11.4	.37 100 11.5			
Noise Cin Cgp Cpk	7.3 3.70 1.79 .016	7.3 3.69 1.78 .017	8.1 3.69 1.79 .016	7.3 3.68 1.79 .016	7.3 3.67 1.79 .016	7.6 3.67 1.78 .016			
	acteristic	Tube No.	<del></del>						
If Eg Mu Sm Ik Eb	.30 116 13.0	.45 116 13.7	305 •49 •16 •13.8 8.0 •141 •18.6	.45 116 13.5	.45 115 12.9	.31 115 12.6			
Gain Noise Cin Cgp Cpk	7.7 3.80 1.76 .015	7.7 3.77 1.75 .715	7.5 3.79 1.75 .014	7.7 3.78 1.75 .013	7.3 3.76 1.75 .010	7.6 3.76 1.75 .014			

#### 6299 Control Tubes

Eb = 200 VDC

Life Test Conditions: Ef = 6.3 V RK/Ib = 10 Ma

Accum.	Hrs.O	108	245	406	564
Test Ch	aracterist	cic/Tube No	0.11		
If Eg	310 •50	•50	•55	.48	.45
Mu	129	127	124	127	125
Sm Ik	16.5 6.1	16.8	17.0	16.6	16.5
Eb	125				
Gain	18.4				
Motse	7.3	7.3	7.4	7.5	7.4
Cin	3,92	3.93	3.93	3.95	3.96
Cgp	1.72	1.72	1.72	1.72	1.73
Cpk	•013	.014	.013	.013	.514
Test Cha	aracterist	ic/Tube No	. 12		
If	309				
Eg	.45	•39	•39	•39	.19
Mu	112	112	112	113	113
Sm	13.2	13.1	13.0	13.0	11,0
Ik	6.8				
Eb Gain	149				
Noise	17.7 7.4	7.4	7 7	7 B	7 4
Cin	3.65	3.64	7•7 3•63	7.8 3.6կ	7.6 3.64
Cgp	1.71	1.71	1.71	1.70	1.71
Cpk	.014	.014	.014	.014	,014

Life T	est Condit	Eb ions: Ef	= 200 VDC = 6.3 V R	K/Ib = 10 1	Ma	
Accum.	Hrs.726	866	1004	1286	1490	1795
Test C	naracteris	tic/Tube N	0. 11			
If Eg Mu Sm Ik Eb Gain	•50 125 16•6	•50 125 16•2	288 •59 124 16•7 7•5 179	•50 127 16•0	.45 126 15.9	•32 124 15•5
Noise Cin Cgp Cpk	7.3 3.95 1.73 .014	7.3 3.96 1.73 .013	19.6 7.3 3.95 1.72 .012	7.6 3.95 1.72 .014	7.1 3.95 1.73 .014	7.3 3.94 1.72 .011
Test Ch	aracterist	ic/Tube No	. 12			
If Eg Mu Sm Ik Eb Gain	•25 114 11•9	.30 113 12.6	303 .25 114 12.1 6.1 166	.30 115 12.0	.19 115 10.9	.14 112 11.0
Noise Cin Cgp Cpk	7.6 3.65 1.71 .014	7.5 3.62 1.71 .010	18.2 7.3 3.62 1.71 .013	7.7 3.62 1.71 .014	7.3 3.61 1.71 .011	7.1 3.61 1.71 .014

Life Te	est Condit		= 200 VDC = 6.3 V R	K/Ib = 10 1	Ya
Accum.	Hrs.0	108	245	406	566
Test Ch	naracterisi	tic/Tube No	o <u>. 13</u>		
If Eg Mu Sm Ik Eb Gain	309 •65 104 14•1 5•8 125	.60 104 14.0	.40 102 14.0	•59 105 13.8	.50 103 13.8
Noise Cin Cgp Cpk	18.1 7.5 3.90 1.76 .015	7.7 3.89 1.76 .015	7.6 3.89 1.76 .015	7.7 3.89 1.76 .015	7.6 3.91 1.78 .016
Test Ch	aracterist	ic/Tube No	<u>. 14</u>		
If Eg Mu Sm Ik Eb	309 .50 117 14.8 6.6 135	.50 116 14.8	.45 114 14.7	.39 118 14.6	.35 117 14.2
Gain Noise Cin Cgp Cpk	18.1 7.3 3.46 1.74 .014	7.1 3.45 1.74 .014	6.9 3.45 1.74 .014	7.4 3.45 1.73 .014	7.3 3.46 1.77 .015

EXTENDED LIFE TEST

Life T	est Condit	Eb ions: Ef	= 200 VDC = 6.3 V R	K/Ib = 10 1	Ma	
Accum.	Hrs.726	866	1004	1286	1490	1795
Test C	haracteris	tic/Tube No	0. 13			
If Eg Mu Sm Ik Eb Gain	.59 106 13.7	•59 105 13•6	306 .50 104 13.4 6.9	.60 104 13.5	.45 105 13.1	.40 105 13.0
Noise Cin Cgp Cpk	7.4 3.90 1.77 .015	7.5 3.89 1.73 .015	17.5 7.2 3.68 1.77	7.7 3.88 1.78 .014	7.5 3.88 1.77 .015	7.3 3.88 1.78 .014
Test Ch	aracterist:	ic/Tube No	<u>. 14</u>			
If Eg Mu Sm Ik Eb	•39 118 13.5	•39 118 13•6	309 •45 118 13•9 5•9 145	.45 119 13.8	.25 119 12.6	.21 119 12.8
Gain Noise Cin Cgp Cpk	7.7 3.44 1.76 .014	7.1 3.44 1.74 .015	18.3 7.1 3.43 1.74 .015	7.1 3.44 1.74 .014	7.0 3.43 1.74 .015	6.9 3.42 1.74 .014

6299 Control Tubes

			,	_	
Accum. Hr	s.O	108	245	406	566
Test Char	acteristic	Tube No.	15		
If Eg Mu Sm Ik Eo Gain	308 .50 111 13.2 7.1 137 17.5	.50 110 13.2	.45 109 13.2	•39 110 12•9	.29 110 12.1
Noise Cin Cgp Cpk	7.5 3.57 1.76 .014	7.6 3.57 1.76 .014	7.7 3.59 1.76 .014	7.6 3.58 1.76 .013	7.6 3.62 1.78 .013

### 6299 Control Tubes

Eb = 200 VDC Life Test Conditions: Ef = 6.3 V RK/Tb = 10 Ma

Accum. Hrs.726		866	1004	1286	1490	1795	
Test Characteristic/Tube No. 15							
If Eg Mu Sm Ik Eb Gain	•35 111 12•5	.30 111 12.0	301 •30 112 11.7 7.4 160 18.6	•39 112 11•8	.19 113 10.3	.15 109 .10.8	
Noise Cin Cgp Cpk	7•7 3•59 1•78 •014	7.7 3.60 1.76 .013	7.7 3.59 1.77	7.8 3.58 1.77 .013	7.6 3.57 1.77 .014	7.9 3.57 1.77 .014	

Table V
EXTENDED LIFE TEST

Improved 6299

Eb = 200 VDC
Life Test Conditions: Ef = 6.3 V RK/Tb = 10 Ma

			,							
Accum. Hr	<b>rs.</b> 0	108	215	1406	566					
Test Char	Test Characteristics/Tube No. 1									
If Eg Mu Sm Ik Eb	301 .50 108 14.0 5.9 136	.55 109 14.2	.45 108 13.0	.45 110 13.6	.30 110 12.9					
Gain Noise Cin Cgp Cpk	18.2 7.3 3.50 1.80	7.3 3.45 1.80 .015	7.6 3.47 1.78 .015	7.4 3.46 1.78 .015	7.4 3.48 1.81 .016					
Test Char	acteristic	s/Tube No.	2							
If Eg Mu Sm Ik Eb	303 .30 124 13.2 4.2 163	.19 124 13.4	.25 122 13,1	.20 125 13.7	.19 124 13.3					
Gain Noise Cin Cgp Cpk	17.6 7.7 3.42 1.70	7.2 3.41 1.69 .013	7.4 3.41 1.69 .013	7.6 3.41 1.69 .014	7.7 3.43 1.70 .015					

## Improved 6299

Li

Ac

Te

If Eg Mu

Sm Ik Eb

Ga: No: Ci:

Cg<sub>l</sub> Cpl

Tes

If Eg Mu Sm

Ik Eb Gai

Noi Cin Cgp Cpk

Eb = 200 VDC Life Test Conditions: Ef = 6.3 V RK/Ib = 10 Ma							
Accum. Hi	rs.726	866	1004	1286	1490	1795	
Test Char	racteristic	Tube No.	_1				
If Eg Mu Sm Ik Eb Gain	.19 110 10.9	.39 110 12.8	301 .45 110 13.3 3.8 147 18.2	.48 110 13.4	.30 110 12.6	.30 108 12.9	
Noise Cin Cgp Cpk	7.3 3.47 1.81 .015	7.3 3.48 1.81 .016 ss/Tube No.	7.0 3.46 1.81 .016	7.9 3.46 1.81 .016	7.6 3.46 1.81 .016	7.3 3.46 1.81 .016	
If Eg Mu Sm Ik Eb Gain	.17 125 13.0	.20 124 13.0	301 •25 125 13•2 3•4 169 17•7	.25 125 13.3	.19 125 13.0	.09 124 13.0	
Noise Cin Cgp Cpk	7.8 3.43 1.70 .015	7.8 3.42 2.70 .015	7.5 3.43 1.69 .014	7.8 3.43 1.69 .014	7.7 3.42 1.69 .015	7.8 3.归 1.70 .015	

Life T	est Condit	Et ions: Ef	= 200 VD0 = 6.3 V	; RK/Ib = 10 M	a
Accum.	Hrs.O	108	245	406	566
Test C	naracterist	tics/Tube	No. 3		
If Eg Mu Sm Ik Eb	302 •45 1.27 15•5 8•5 139	•29 127 15•6	•25 125 15•0	.20 129 15.2	.15 129 14.3
Gain Noise Cin Cgp Cpk	17.6 7.8 3.34 1.71	7.9 3.35 1.71 .012	8.3 3.32 1.71 .013	7.9 3.36 1.71 .012	7.8 3.38 1.72
Test Ch	aracterist:	ics/Tube N	0.4		
If Eg Mu Sm Ik Eb	303 •59 105 13.0 6.8 135	.45 105 13.2	.45 105 13.3	•39 106 13.0	.30 106 12.6
Gain Noise Cin Cgp Cpk	17.4 7.6 3.31 1.82 .014	7.8 3.30 1.82 .014	8.1 3.32 1.82 .014	7.8 3.30 1.82 .014	7.8 3.32 1.83 .015

## Improved 6299

Life

Accu

Test

Cgp Cpk

Test

If

Eg Mu Sm Ik Eb

Gain Nois

Cin Cgp Cpk

If
Eg
Mu
Sm
Ik
Eb
Gain
Nois
Cin

Eb = 200 VDC Life Test Conditions: Ef = 6.3 V RK/Ib = 10 Ma							
Accum. Hr	rs.726	866	1004	1286	1490	1795	
Test Char	acteristic	s/Tube No.	3				
If Eg Mu Sm Ik Eb Gain	.19 128 14.3	.25 128 14.3	289 .25 129 14.4 8.1 180 17.4	.25 129 14.2	.19 129 13.3	.05 127 13,2	
Noise Cin Cgp Cpk	8.1 3.37 1.73 .014	8.0 3.37 1.72 .013	7.8 3.36 1.72 .014	7.9 3.36 1.72 .014	7.9 3.35 1.72 .015	7.9 3.33 1.72 .013	
	acteristic	s/Iude No.					
If Eg Mu Sm Ik Eb Gain	.38 1.06 12.3	.39 106 12.3	301 .39 106 12.2 6.4 153 17.0	.39 106 12.1	.25 107 11.4	.19 105 11.5	
Noise Cin Cgp Cpk	7•7 3•32 1•84 •015	7.7 3.33 1.83 .015	7.9 3.32 1.83	8.1 3.32 1.84 .014	7.7 3.31 1.84 .015	7.7 3.31 1.85 .014	

Eb = 200 VDC Life Test Conditions: Ef = 6.3 V RK/Ib = 10 Ma							
Accum. Hr	•s•0	108	245	1,06	566		
Test Char	acteristic	s/Tube No.	5				
If Eg Mu Sm Ik Eb	302 •55 113 16.0 6.7 132	.45 113 15.8	.40 113 15.8	.40 114 15.9	.33 114 15.3		
Gain Noise Cin Cgp Cpk	18.2 7.3 3.43 1.69 .015	8.2 3.46 1.69 .015	7.9 3.45 1.70 .015	8.1 3.44 1.68 .015	8.2 3.45 1.70 .015		
Test Char	racteristic	s/Tube No.	6				
If Eg Mu Sm Ik Eb	308 •59 113 16•5 5•6 123	.50 111 16.4	•59 110 16•1	.50 112 16.3	.45 112 16.2		
Gain Noise Cin Cgp Cpk	18.5 7.2 3.56 1.73	7.5 3.55 1.73 .016	7.6 3.57 1.76 .016	7.7 3.55 1.73 .016	7.3 3.56 1.75 .017		

Life T	est Condit	Eb ions: Ef	= 200 VDC = 6.3 V R	K/Ib = 10 1	Ma	
Accum.	Hrs.726	866	1004	1286	1490	1795
Test C	haracturis	tics/Tube	No. 5			
If Eg Mu Sm Ik Eb Gain	•39 114 15•3	•39 114 15•0	300 •15 115 15•2 5•9 148	.45 114 15.1	•39 115 1/ <sub>1•</sub> 6	•20 115 14•5
Noise Cin Cgp Cpk	7.6 3.45 1.70 .016	7.7 3.45 1.70 .016	17.8 7.6 3.43 1.70	7.6 3.44 1.70 .016	7.4 3.44 1.70 .016	7.4 3.43 1.70
Test Ch	aracterist	ics, Tube N	0.6			
If Eg Mu Sm Ik Eb Gain	.50 113 15.6	•50 113 15•8	305 •49 114 15•3 5•2 136	•59 112 15•3	.10 114 14.9	.Ы 111 14.8
Noise Cin Cgp Cpk	7.4 3.56 1.76 .016	7.6 3.59 1.75 .017	19.0 7.4 3.56 1.75 .016	7.4 3.54 1.75 .017	7.1 3.53 1.75 .016	7•3 3•54 1•76 •018

Life	Test	Conditio			× 200 = 6.3		/Ib =	· 10 Ma	L.
Accur	n. Hrs	.0	108		21	<b>1</b> 5	40	6	566
Test Characteristics/Tube No. 7									
If Eg Mu Sm Ik Eb Gain	1 1 5	309 .49 .14 .3.9 .8 .39 7.6	.49 114 13.9	<b>&gt;</b>	.3 11 13	4	•30 11, 13	5	.25 115 13.3
Noise Cin Cgp Cpk	7 3 1	.2 .27 .72 014	7.1 3.26 1.72 .014		7.0 3.2 1.0	27 73	7.7 3.2 1.7	?7 72	7.7 3.26 1.74 .015
Test (	Charac	teristic	s/Tub	e No	8				
If Eg Mu, Sm Ik Eb	13	16	.49 113 13.4		.25 112 12.	<b>)</b>	.lo 114 13.		.10 86 0
Gain Noise Cin Cgp Cpk	7. 3. 1.	7.9 5 25 68 14	7.1 3.23 1.68 .014		8.1 3.2 1.6	<u>կ</u> 8	7.6 3.2 1.68	<b>7</b> 3	3.26 1.69 .015

# Improved 6299

Life To	est Condit:	Eb ions: Ef	= 200 VDC = 6.3 V R	K/Ib = 10 ;	Ma	
	Hrs.726 Naracterist	866	100 <i>b</i>	1286	1490	1795
		rus/ <u>rube</u>	NO. 7			
If Eg Mu Sm Ik Eb	•25 115 13•4	.30 115 13.2	307 •30 116 13•4 4•6 158	.59 113 11.5	•30 115 13•4	.19 114 13.0
Cain Noise Cin Cgp Cpk	7.5 3.27 1.74 .015	7.3 3.29 1.74 .015	18.4 7.3 3.27 1.73 .014	7.7 3.26 1.73 .015	7.3 3.27 1.73 .015	7•3 3•27 1•74 •015

Test Characteristics/Tube No. 8

If
Eg
Mu
Sm
Tk
Eb SLOW AIR LEAKER
Gain
Noise
Cin
Cgp
Cpk

Eb = 200 VDC Life Test Conditions: Ef = 6.3 V RK/Ib = 10 Ma							
Accum Hrs	•0	108	245	106	566		
Test Characteristics/Tube No. 9							
If Eg Mu Sm Ik Eb Gain	305 .85 100 15.1 3.9 110 18.3	.75 100 15.1	.70 100 14.5	.70 100 15.0	.65 100 15.0		
Noise Cin Cgp Cpk	7.4 3.93 1.70 .020	7.2 3.90 1.71 .020	7.9 3.90 1.71 .020	7.4 3.89 1.70 .020	7.2 3.90 1.72 .021		
If Eg Mu Sm Ik Eb	303 •40 114 14•2 6•7 148	.45 114 13.9	•39 113 13•9	•39 115 14•0	•39 115 14•0		
Gain Noise Cin Cgp Cpk	18.1 7.6 3.09 1.69	7.4 3.06 1.69 .014	7.7 3.06 1.70 .014	7.6 3.05 1.69 .013	7.6 3.06 1.70 .014		

Life T	Cest Condit	Eb Lions: Ef	= 200 VDC	2K/Ib = 10	Ma			
	Hrs.726	866	1004	1286	1490	1755		
Test Characteristics/Tube No. 9								
If Eg Mu Sm Ik Eb Gain	.70 100 14.7	.70 100 14.7	303 .70 100 14.7 3.8 121	.70 100 14.5	.59 100 14.6	.56 100 14.5		
Noise Cin Cgp Cpk	7.6 3.91 1.73 .021	7.2 3.90 1.72 .021	18.2 7.0 3.88 1.71	7.4 3.88 1.78 .021	7.0 3.88 1.72 .021	6.9 3.87 1.72 .021		
Test Characteristics/Tube No. 10								
If Eg Mu Sm Ik Eb Gain	.39 115 13.6	.19 120 11.5	299 .38 115 13.0 6.7 171	.30 115 12.9	.39 115 13.1	.24 114 13.0		
Noise Cin Cgp Cpk	7.4 3.08 1.71 .014	7.2 3.08 1.71 .014	17.6 7.3 3.05 1.70	7.6 3.05 1.70 .014	7.6 3.04 1.70 .010	7.8 3.02 1.70		

Eb = 200 VDC Life Test Conditions: Ef = 6.3 V RK/Ib = 10 Ma							
			-	, == = = :.	a		
Accum.	nrs.U	108	245	1406	566		
Test C	naracteris	tics/Tube	No. 11				
If	309						
Eg	•39	.30	.30	•39	•25		
Mu	119	119	118	120	120		
Sm	15.0	15.1	14.2	15.0	14.3		
Ik	3.8			• •	-4•)		
Eb Cod-	148						
Gain Noise	18.9	~ -					
Cin	7.6	7.1	7.7	7.3	7.2		
Cgp	3.51 1.62	3.51	3.56	3.49	3.51		
Cpk	•015	1.61 .015	1.62	1.61	1.62		
- P	•01)	•015	.015	.017	•016		
Test Characteristics/Tube No. 12							
If	305						
Eg	•50	•50	.45	.40	۱.۲۰		
Mu	105	105	104	105	.45 105		
Sm	14.2	14.2	14.1	14.0	14.0		
Ik	5.4				<b>-4.0</b>		
Eb	139						
Gain	18.0						
Noise	8.4	7.4	8.1	7.8	7.6		
C <u>in</u>	3.50	3.50	3.50	3.40	3.50		
Cgp Cpk	1.72	1.73	1.73	1.72	1.74		
opa	.017	.017	.016	.018	.017		

Eb = 200 VDC Life Test Conditions: Ef = 6.3 V RK/To = 10 Ma								
Accum. Hr	·s.726	866	1004	1286	1490	1795		
Test Characteristics/Tube No. 11								
If Eg Mu Sm Ik Eb Gain	.30 120 14.4	•39 120 15•1	307 •39 120 14.5 4.0 156 18.3	.39 120 14.6	.30 120 14.2	.24 119 14.2		
Noise Cin Cgp Cpk	7.1 3.53 1.63 .017	7.1 3.53 1.62 .015	7.1 3.52 1.62 .016	7.1 3.51 1.62 .017	7.3 3.52 1.62 .017	6.9 3.51 1.62 .016		
Test Characteristics/Tube No. 12								
If Eg Mu Sm Ik Eb Gain	.45 105 13.9	.49 105 13.5	303 •45 105 13•9 5•5 147	.45 105 13.4	.lo 105 13.3	.34 105 13.2		
Noise Cin Cgp Cpk	7.7 3.49 1.75 .017	7.3 3.49 1.74 .017	7.4 3.50 1.74 .014	7.7 3.49 1.74 .016	7.3 3.40 1.74 .018	7.5 3.50 1.74 .018		

#### Improved 6299

Eb = 200 VDCLife Test Conditions: Ef = 6.3 V RK/IB = 10 Ma566 Accum. Hrs.0 108 21,5 406 Test Characteristics/Tube No. 13 308 If .25 .39 .20 .19 .19 Eg 119 11.7 119 Mu 120 12.5 12.5 12.0 Sm12.6 11.3 5.6 Ik 152 Eb 17.0 Gain Noise 8.4 8.1 8.1 8.2 8.2 3.15 3.15 Cin 3.14 3.14 3.15 .Cgp 1.74 1.75 1.76 1.74 1.76 Cuk .012 .012 .012 .004 .013 Test Characteristics, Tube No. 14 If 301 .45 .30 121 .45 Eg -39 .29 122 123 122 Mu 123 14.7 15.0 15.2 15.3 Sm14.6 Ιk 6.2 142 Eb 18.4 Gain 7.3 3.18 7.3 3.20 Noise 7.3 7.2 7.7 3.19 1.73 3.17 3.20 Cin Cgp 1.73 1.73 1.73 1.75 .014 .015 Cpk .013 .014 .015

# EXTENDED LIFE TEST

# Improved 6299

Life 1	Test Condit:		= 200 VDC = 6.3 V R	K/Ib = 10 1	1a				
Accum	Hrs.726	866	1004	1286	1490	1 <b>7</b> 95			
Test (	Test Characteristics/Tube No. 13								
If Eg Mu Sm Ik ab Gain	.19 119 12.0	.19 119 11.7	310 .15 11.9 11.2 5.5 178	.19 110 11.1	.19 119 11.8	.06 119 11.6			
Noise Cin Cgp Cpk	8.0 3.19 1.76 .012	7.8 3.19 1.76 .013	17.3 7.7 3.17 1.70	8.1 3.15 1.75 .014	7.7 3.15 1.75 .014	7.8 3.14 1.76 .014			
Test Cl	naracterist	ics/Tube N	0. 14						
If Eg Mu Sm Ik Eb Gein	•39 122 15•1	.19 123 11.0	300 •39 124 14.4 6.6 148	•45 123 14•7	•39 124 14•6	.29 123 14.7			
Noise Cin Cgp Cpk	7.2 3.20 1.76 .012	7.2 3.20 1.75 .014	18.4 7.3 3.18 1.75 .015	7.3 3.19 1.75 .014	7.1 3.19 1.76 .014	7.2 3.20 1.76 .014			

# EXTENDED LIFE TEST

# Improved 6299

Eb = 200 VDCLife Test Conditions: Ef = 6.3 V RK/Ib = 10 Ma 566 Accum. Hrs. 0 108 245 406 Test Characteristics/Tube No. 15 If 300 .45 .45 109 .39 •39 110 .30 Eg Mu 103 109 15.1 Sm14.1 14.0 15.0 14.9  $\mathbb{I}_{\mathbf{k}}$ 8.1 Eb 151 17.6 7.5 3.山 Gain 7.5 3.44 8.2 7.5 3.45 Noise 7.8 3.43 3.43 Cin 1.92 1.88 1.90 1.95  $\mathbb{C}^{\underline{\mathbf{g}}\underline{\mathbf{p}}}$ 1.91 .015 .015 .015 Cpk .015

# EXTENDED LIFE TEST

			Improve	d 6299			to	I
Life T	est Condit		= 200 VDC = 6.3 V R	K/Ib = 10	Ma		pro	OC
	Hrs.726	866	1004	1286	1490	1795	ai.	•••
	naracterist	cics/Tube	No. 15		,, -	+170	giv	
If Eg Mu Sm Ik Eb Gain	.39 110 14.4	.19 112 14.2	305 •39 110 14•1 8•3 150	.45 110 14.2	•39 110 13•4	•30 108 13•7	nic wit	ck
Noise Cin Cgp Cpk	7.8 3.h3 1.95 .015	7.5 3.山 1.95 .016	17.1 7.5 3.42 1.95 .016	7.7 3.42 1.96 .016	7.8 3.42 1.96 .015	8.0 3.41 1.97 .015	to	

best

good

catho

regul

humid

obtai

coat

-70-

#### CONCLUSIONS

The temperature controller does decrease the operator skill required to perform an uniform exhaust cycle and thereby insures a more uniform product.

The inverted cathode support ring with .00045" cathode foil will give proper cathode temperature and result in better uniformity, increased ruggedness and a better cathode-to-cathode shell connections.

Tubes with three seals of the hard solder construction with coppernickel-gold plating and a-c aging have shown good results or life test with the anode seal at 225° C. Tubes of this construction are superior to the regular 6299 on high temperature operation.

Failure of the 6299 during humidity testing has been found to be due to hydrogen penetration of the base metal of the tube's shell. The best results in minimizing hydrogen penetration has been obtained by a good plating of the tube.

Results from improved alignment and concentricity, optimization of cathode coating, and improved exhaust fixturing are now being applied to regular production tubes. Improved cleaning and plating resulting from humidity testing is also now standard practice.

Increased strength and uniformity in hard solder seals has been obtained by using a finer particle size in the metalizing mix used to coat the high alumina ceramics.

The pilot run has been completed and conforms to the test specification.

The extended life test has completed 1795 hours. The complete 5000 hour life test data and the analysis of mode of failure will be presented in an addendum to the Final Report.

## PUBLICATIONS, LECTURES

#### REPORTS AND CONFERENCES

PUBLICATIONS - None

LECTURES - None

REPORTS

- Monthly Narrative Reports Nos. 1 - 8
Development Of An Improved JAN 6299
by F. A. Marra for the period from
1 May 1961 through 31 December 1961.

Monthly Narrative Reports Nos. 9 - 12 Development Of An Improved JAN 6299 by F. S. Sawicki for the period from 1 January 1962 through 30 April 1962.

Monthly Narrative Reports Nos. 13 - 34
Development Of An Improved JAN 6299
by D. L. Cook for the period from
15 September 1962 through 30 June 1964.

Quarterly Progress Reports Nos. 1 - 3 Development Of An Improved JAN 6299 by F. A. Marra for the period from 1 May 1961 through 31 January 1962.

Quarterly Progress Report No. 1: Development Of An Improved JAN 6299 by F. S. Sawicki for the regiod from 1 February 1962 through 30 April 1962

Quarterly Progress Reports Nos. 5 - 10 Development Of An Improved JAN 6299 by D. L. Cook for the period from 17 September 1962 through 31 March 1964

CONFERENCES - 1. Organization and personnel present:

USASSA

H. P. Blodgett

General Electric Company
A. T. Tomko, J. D. Secord, F. A. Marra

#### CONFERENCES - 1. Place and date:

General Electric Company Receiving Tube Department Scranton, Pennsylvania

September 11, 1961

Subject:

Review status of the contract.

2. Organization and personnel present:

USASSA

L. Coblentz

General Electric Company

J. E. Campbell, J. T. Duncan, F. S. Sawicki

J. D. Secord, H. L. Thorson, A. T. Tomko

Place and date:

General Electric Company Receiving Tube Department Scranton, Pennsylvania

February 15, 1962

Subject:

Discuss what effect the transfer of Production Engineering measures Contract No. DA-36-039-SC-85953 (Type 6299) to Owensboro, Kentucky, would have on performance.

3. Organization and personnel present:

USASSA

S. Vitali, L. Coblentz

General Electric Company

D. L. Cook, L. K. LaDue, F. S. Sawicki,

J. D. Secord, A. T. Tomko

Place and date:

General Electric Company Receiving Tube Department Scranton, Pennsylvania

April 10, 1962

# CONFERENCES - 3. Subject:

Only status of contract and iscuss what effect transfer if I roduction Engineering measures Contract No. DA-36-039-SC-85953 (Type 6299) to Owensboro, Kentucky will have on performance.

4. Organization and personnel present:

USASSA

L 'oblentz

General Electric Company
L. Cook, E. L. Lavis, J. T. Duncan, A. T. Tomko

Place and date:

General Electric Company Receiving Tube Department Owensboro, Kentucky

September 12, 1962

Subject:

Leview status of the contract and discuss the effects of the transfer of Production Engineering measures Contract No. DA-36-039-SC-85953 (Type 6299) to Owensboro, Kentucky.

5. Organization and personnel present:

USASSA

L. Coblentz

General Electric Company
D. L. Cook, E. L. Davis, J. N. McClanahan, A. T. Tomko

Place and date:

General Electric Company 316 East Ninth Street Owensboro, Kentucky

January 15, 1963

Subject:

Feview ~tatus of the contract.

CONFERENCES - 6. Organization and personnel present:

USASSA

Leonard Coblentz

General Electric Company
D. L. Cook, E. L. Davis, A. T. Tomko

Place and date:

General Electric Company Receiving Tube Department Owensboro, Kentucky

April 24, 1963

Subject:

Review status of the contract

7. Organization and personnel present:

USAERDL

Helmuth Kaunzinger

General Electric Company
D. L. Cook, E. L. Davis, A. T. Tomko

Place and date:

General Electric Company Receiving Tube Department Owensboro, Kentucky

June 26, 1963

Subject:

Review status of the contract

8. Organization and personnel present

USASSA

Leonard Coblentz

General Electric Company
D. L. Cook, E. L. Davis, D. L. Dyke, A. T. Tomko

#### CONFERENCES - 8. Place and date:

General Electric Company Tube Department Owensboro, Kentucky

October 16, 1963

Subject:

Review status of the contract

9. Organization and personnel present

**USAEMSA** 

Simon Zucker

General Electric Company
D. L. Cook, L. L. Davis, A. T. Tomko

Place and date:

General Electric Company Tube Department Owensboro, Kentucky

November 14, 1963

Subject:

Discuss specification for testing of preproduction samples.

10. Organization and personnel present

USASSA

Stan Sockalov

General Electric Company

D. L. Cook, F. L. Davis, M. R. Speray, A. T. Tomko

:lace and date:

General Electric Company Tude Department Owensboro, Kentucky

January 24, 1964

Subject:

Review status of the contract and view pilot run facilities.

		<u>Coo</u> ;
IDENTIFICATION (	OF TECHNICIANS	in F
		in 1
A. MAN POWER EFFORT		
TECHNICAL		time
Barrass, Martha Childs, C. G. Cook, D. L. Crawford, S. C. Dyke, D. L.	17 19 1637 23	thre
Grady, B. I. Haberkern, R. J.	62 28	of the
Jeffery, L. F. Kirby, P.	45 2	comp
LaDue, L. K. Marra, F. A. McClanahan, J. N. McDowell, J. K. Moore, G. E.	19 250 7ևև 127 8 10	LaDue
Moredock, D. Morris, M. E.	2 3. F	from
Owsley, W. F. Ringland, R. S.	364 10	Elect
Sawicki, F. S. Speray, M. R.	320 18	the m
Stephens, P. Tomko, A. T.	18 471	1
Winkler, R. H.	20	Corps
		τ
		Depart
		Depart
		year a
		he was

BIO

# BIOGRAPHICAL INFORMATION - TECHNICAL

# Cook, D. L.

A native of Potosi, Missouri, Mr. Cook received a Bachelor's Degree in Electrical Engineering from Missouri School of Mines and Metallurgy in 1960.

He has been associated with the General Electric Company since that time starting as an Engineering and Science Program trainee.

Since 1961, he has worked in Planar tube manufacturing except for a three month assignment in Planar Product Design Engineering.

Mr. Cook had responsibility for technical cognizance and guidance of the contract for the period from 15 September 1962 through the completion of the contract.

## LaDue, L. K.

Mr. LaDue is a native of New York State where he graduated in 1955 from St. Lawrence University. He joined the General Electric Company, Electronic Division Physics Training Program priefly prior to entering the military service.

From 1956 through 1960 he served as a lieutenant in the U.S. Army Corps of Engineers.

Upon leaving the service in early 1961 he joined the Receiving Tube
Department's Planar Design Section. He was with the Receiving Tube
Department's Scranton planar production facility for approximately one
year assigned to small ceramic lighthouse transmitting tubes. In 1962
he was transferred to the Owensboro location as Planar Design Engineer.

# Marra, F. A.

A native of Jessup, Pennsylvania, Mr. Marra earned his Bachelor's Degree in Electrical Engineering from the Pennsylvania State University in 1956.

He has been associated with the General Electric Company since that time starting as a Manufacturing Training Program trainee.

From 1957 to 1961, his assignments have been that of a Factory Engineer responsible for the manufacture of Thyratrons and Ceramic Lighthouse tubes.

Mr. Marra had responsibility for technical cognizance and guidance of the contract for the period from 1 May 1961 through 31 December 1961.

# McClanahan, J. N.

Mr. McClanahan, a native of Kansas, received his Bachelor's Degree in Electrical Engineering from the University of Kansas in June, 1962.

Upon graduation, he joined the Planar and Thyratron Section as a Process Control Engineer, working primarily on the Miniature Ceramic Lighthouse tubes for one year.

#### Morris, M.L.

Mr. Morris is a native of Lancaster, Kentucky. He served as an Airborne Radio and Radar Repairman in the U.S.A.F. from 1954 to 1958.

He spent two and one half years at Valparaiso Technical Institute where he received an associate degree in Electronic Engineering.

Upon leaving school in June, 1960, he joined the General Electric Company in Owensboro, Kentucky, serving as an engineering aide in the Miniature Ceramic Section.

Morri

as a 1

1

a B.S.

Owsley

M tube m

Planar

chemica

H

in 1931

process engines

in 1938

setting

Be

the sal

Hе

chemist

His ass

prepara product:

plating

# Morris, M. E. (Cont'd)

In December 1963, he joined the Ceramic Lighthouse Section, serving as a Tube Engineering Technician.

During his tenure at General Electric, he has continued work toward a B.S. by way of night school.

# Owsley, N. F.

Mr. Owsley has over 25 years experience as a chemist in electron tube manufacturing operations. "e is presently chemist for General Electric Planar-Thyratron manufacturing operations, located at Owensboro, Kentucky.

He was employed by the Engineering section - chemical laboratory and chemical preparations Ken-Rad Tube and Lamp Corporation, Owensboro, Kentucky, in 1933. His assignments were: analytical chemist, chemical preparations, process development and control.\* In 1936 he was transferred to factory engineering as Process Control Engineer. He left the Ken-Rad organization in 1938.

Between 1938 and 1942 he was employed in crude oil production, initially setting up and operating a field laboratory for checking and controlling the salt content of crude oil purchased for shipment to refineries.

He returned to the Ken-Rad organization, February, 1942, as chief chemist for Ken-Rad Transmitting Tube Corporation of Owensboro, Kentucky. His assignments were to set up and supervise the operation of a chemical preparations section, to develop and control processes related to the production of transmitting and cathode-ray tubes, included were electroplating operations.

# Owsley, W. F. (Cont'd)

Mr. Owsley became associated with the General Electric Company through its purchase of the Ken-Rad installations in 1945. He continued with General Electric as a chemist supervising the operation of the chemical laboratory and chemical preparation section serving all of the Owensboro manufacturing operations. He was assigned special projects related to process development and control and in new materials evaluation in the production of metal and glass receiving tubes.

In mid 1951 he was transferred to the General Electric Anniston

Tube Plant organization as chief chemist, later becoming Supervisor

of process control. The balance of 1951, he spent in the planning

and procurement of laboratory and chemical preparation facilities for

establishment in the new plant. He transferred to the Anniston, Alabama

location March 31, 1952.

Mr. Cwsley was transferred to the Owensboro Planar-Thyratron Operation February 1963. His present position title: Engineer, Chemical Process Control.

\* As related to the manufacturing of metal and glass receiving tubes.

## Sawicki, F. S.

A native of Scranton, Pennsylvania, Mr. Sawicki attended the University of Scranton, where he received his bachelor's degree in Electronics in 1958.

He has been associated with General Electric Company since 1954.

From 1959 through 1962 as Factory Engineer, he was responsible for the manufacturing of Magnetrons and Ceramic Lighthouse tubes. This interval Sawic

inclu

Ceram

Assis

\_

for a

guidar

1

30 Apr

Tomko,

M

F

Degree

Force

Base,

Alamos

Tube De

UŢ

the nex

product

Thyratr

Ceramic

Lightho assigne

In

# Sawicki, F. S. (Cont'd)

included a six months period as Process Control Engineer assigned to Ceramic Lighthouse tubes.

During 1957 through 1959 his assignments included engineering Assistant assigned to Magnetrons and Gap tubes.

From 1953 through 1956 Mr. Sawicki served as Electronic Technician for a two and one half year period.

Mr. Sawicki had the responsibility for technical cognizance and guidance of the contract from the period from 1 January 1962 through 30 April 1962.

# Tomko, A. T.

Mr. Tomko attended Villaneva University and received his Bachelor's Degree in Electrical Engineering in 1950.

Following graduation he was recalled to active duty with the Air Force assigned to the Armed Forces Special Weapons Project at Sandia Base, New Mexico and the Los Alamos Scientific Laboratories at Los Alamos, New Mexico.

Upon completion of his tour of active duty he joined the Power

Tube Department in 1952 as Line Engineer on Hydrogen Thyratrons. During
the next three years this responsibility was extended to include the
production engineering of Inert Gas and Mercury Industrial Control
Thyratrons. In 1955 he was appointed Engineer-General Foreman of the
Peramic Lighthouse Manufacturing.

In 1957 he was appointed Manager, Manufacturing of the Ceramic sighthouse Sub-section. From January 1961 through May 1964 he was assigned as Manager, Manufacturing Engineering, Planar-Thyratron Operation.

APPENDIX A

.

Proposed by General Electric Company Owensboro Kentucky 2 December 1963

MIL-E-1/\_\_\_(EL)

# MILITARY SPECIFICATION SHEET ELECTRON TUPE. UHT PLANAR TRIODE

6299

This specification sheet forms a part of the latest issue of Military Specification MIL-E-1.

DESCRIPTION: Low Noise class A amplifier

F1 = 3,000 megacycles

#### ABSOLUTE-MAXIMUM RATINGS


Parem Unit: Maxim	um.	E1 V 6, 6	Eb Vdc 200	Ec Vdc 0	Tb mAdc TZ	Pp W 2 0	tk Sec	Cooling  Conduction	T (s *C 225	. บ	Alt ft Inlimite	d
Minim		6.0 note 1)		-10 (see note	2)		(See	notes 3 and 4)(				4 3 and 5)
TEST CON	DITIONS:	6. 3	175	Adjust	10	(	180 see note 6)	Conduction		•		
PAR. NO.	т	EST		CONDI	TIONS		AQL (PERCENT DEFECTIV	I INSPECTION E) LEVEL	SYM. BOL	LIM Min.		UNIT
	General											
3. 1	Qualifica	tion		Requir markır	ed for J/	\N	***	•••	•••	***	•••	•••
3.6	Perform	ance		(See no	ote 7)			•••				•••
4.5	Holding p	e riod		t = 7 d	ays min						•••	
4. 9, 2	Dimensio	n.		(See fi	g 1}			• ••	•••			•••
	Qualifica (see not		ection									
4. 9. 20. 5	Shock tea	ı t			tages, ha = 20°(see				•••			• • •
	Arengian peri 1 '	producti		angee -			•					
4.8	Insulatio	n of e.ec	trode#	Thk = grid g	-500 Vdc +45 Vůc, rounded ote 11)				Rgk Rgp	0. 25 5. 0		Meg Meg
4, 10, 1, 1	Emie∗ior	1		(max). poak-t 60 cyc -18.0 poak-t 60 cyc 470 oh	Ef = 5 eb = 390 o-peak les, Ec = Vdc, eg = o-peak les, Rg = m, Rk = (see note	1 v = 46 v 10	(See note 10	(See )) note 10)	i.	3 5	•••	mAdc
4.10.5.3	Plate voi	liago		Ec = 0	= 10 mA; ) ote 13)	•			ЕЪ	75	175	Vdc

Par.	NO. TEST	CONDITIONS	AĞL CPPRCENT Dur eq (19 <u>r)</u>	NSPECTION BOL	1- LIMITS	TINU	NOTE 1
	Acceptance inspection part 1 (production) - (Contd)	·n	Mark ex exemp	LEVEL	Min Max		2.
4. 10, 8	Heater current			• 4			•
4. 10. 9	Transconductance			If		0 mA	3.
•••	Power gain (1)	Eb/1b = 10 0 mAdc, Ec = 0, F = 1,200±5 Mc, bandwidth = 10 Mc min (see notes 13 and 14)	(See noto 10)		13.0	- µmhos	4.
•••	Noise figure (1)	Eb/1b = 10 mA, Ec = 0 F = 1, 200±5 Mc (ree notes 13 and 14)	ı	NF	8 9	5 db	5.
	Acceptance inspection part 2 (design)						6.
4. 9.	Low-frequency vibration	Eb/lb = 10 0 mAdc, Ec = 0 Rp = 10,000 ohms (see note 15)	6. 5	L6 Ep	100	m V	7.
							8.
	1 Amplification factor		6. 5	L6 Mu	85.0 140	•••	9.
4, 10, 14	Direct interelectrode capacitance	No voltages (see note 16)	6.5	L6 Cgk	3.0 9.0	րրք	
		too note to,	6, <b>5</b> 6, 5	L6 Cgp L6 Cpk	1.5 2.0 0.025	ألبين	10.
	Power gain (2)	Power gain (1), F = 3, 00° 25 Mc (see notes 13 and 17)	6. 5	L6 Gain			•••
•••	Noise figure (2)	Noise figure (1), F = 3, 000±5 Mc (see notes 13 and 17)	6. 5	L6 NF	13.5	db	11.
	Acceptance inspection part 3 (life)	too motor to mine try					12.
4. 11 and	Humidity Test	(See note 20)	10.0	ΔIſ	10	<b>%</b>	
4. 11. 3. 4	Life test (1)	Eb = 200 Vdc, Rk/Ib = 10 mA, group B	•••	t 1	000	hr	12
4.11-4	Life-test(1) end points	Transconductance		4Sin	25 0	∜de - • rease	13. 14.
4. Il and		Noise ligure (1)	•	anf .		db m- crease	15.
4. 11. 3. 5	Life test (2)	Eb - 200 Vdc. Rk/Ib = 10 mA. Group C. TE = 225°C(m	nin)	t 5	500 1	hr	16.
4.11.4	Life test(2) end points	Transconductance	,	4Sm -	25.0 9		17.
		Noise figure (1)		ANF -	1.0 d	trease to in- trease	18.
4. 9. 18	Container drop	Required					10
							19.
5.	Preparation for delivery	(See not: 18)					20.

Pr 5 2 / 14

#### NOTES:

- 1. Heater may be operated it he 3 solve \*36 percent. The life and noise figure may be affected by this wider variation. The tube is set sated for series heater string operation.
- 2. Grid shall not draw current. Exce the grid-cathode watthe inay cause damage due to extremely small spacing.
- 3. a. Tube cannot be cooled by free radiation and convection, means for conducting and dissipating heat must be provided in order to prevent excessive real temperatures.
  - b. Applications at high attitudes shall be examined carefully to assure that sufficient provision for discipation of heat has been made
- 4. Sufficient conduction or convection cooling, or he h, must be provided for heater, cathode, grid, and anode seals to limit the maximum evelope temperatures to the specified maximum of 225°C under all operating condit. he Where emphysis is placed on long and reliable life, lower tube envelope temperatures in the used
- 5. Altitude is unlimited as the maximum rating of 200 volts is insufficient to cause voltage breakdown at any altitude
- 6. The heater preheating may be 6 6 volts maximum, unless otherwise specified.
- 7. In addition to the paragraphs specified hereon, only the following test and requirements listed in 3.6 shall apply 3.3, 3.3, 3.7, 3.7, 3.8, 4.1, 4.3, 4.4, 4.6, 4.8, 4.9.1, 4.9.21.
- 8. All tests listed hereon shall be performed during qualification, however, this shock test is normally performed during qualification inspection only.
- 9. Apply the force perpendicular to the plane of the grid from the cathode end. Use fixture as shown on Drawing 274-JAN, or equivalent. Electrical tests after shock shall include transconductance and electrode insulation.
- 10. The AQL of the combined defectives for attributes in acceptance in pection, part 1 (production), excluding inoperatives and mechanical, shall be 1 percent. At a raying one or more defects shall be counted as one defective. Standard MIL-STD-105, inspection level II, shall apply.
- 11. Anode and cathode voltages shall not be applied simultaneously. Allowable circuit resistance is 1,000 ohms per volt of supply voltage.
- 12. Preheat I minute minimum at Ei = 5.5 V. Voltages eb and eg must be in phase. Read average cathode current. If the current exceeds the minimum limit and is increasing, the tube is a lift the current exceeds the minimum limit and is decreasing, the reading shall be allowed to another tube is acceptable if the stable reading exceeds the minimum limit. Provision must be made in the test equipment so that switching transients of plate voltage apply no more voltage than the amount specified.
- 13. Preheat 1 minute minimum at 6.3 voits.
- 14. Test in cavity as shown on Drawing 271-JAN, or equivalent. An approved noise source, or equivalent, shall be used for noise figure measurements. Power input level shall be about -75 dbm
- 15. Test in fixture as shown on Drawing 273-JAN, or equivalent. Vibrate in plane perpendicular to the plane of the grid.
- 16. Test in fixture as shown on Drawing 270-. ., or equivalent
- 17. Test in cavity as shown on Drawin, 272-JAN, or equivalent. An approved noise source or equivalent shall be used for noise figure measurements. Power input level shall be about -75 dbm.
- 18. Tubes shall be prepared for comestic or overscas in calent as specified in the contract or order, in accordance with Specification MIL-1,-7° 1 is a management and (container drop) test (a) and container size D shall apply
- 19. Referenced documents shall be of the associated on the differentiation for a
- 20. Test tubes first product, made each year of the state of the state

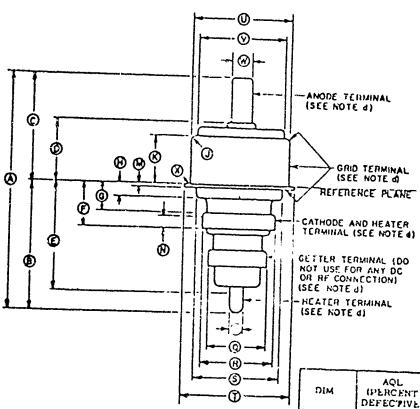

# Notes:

All dimensions in inches, Preship test all tubes for TIR.

Test these dimensions on 10 tubes per month when in continuous production. Failure of more than one tube to most the tolerance for any of these dimensions shall cause that dimension to become a 6.5 AQL, L6 Design Test for all lots in

process.
Eccontricity of contact surfaces shall be gaged from center line of reference, and shall be as follows. Note b shall apply.

Contact Surface	TIR maximum	Reformeo
Anode	0,015	Grid
Cathode	0.020	Grid
Gettor Heator	0.030	Orid
.errol.	0.045	0rdd

	DIM	AQL (PERCENT	INSPECTION	i,	MITS
		DEFECTIVE;	FEART	Min	Mns
į		ACCEPTANCE	INSPICTION,	PART 2 IDES	(GN)
Į			1.0	O. Gett	11,040
:			1.0	0 hi0	Q. (A)O
	<u> </u>		1.0	0.410	0 1/0
i		<b>8.5</b>	1.7)		0.:12
t		0.3	1.01		0 4/5
Ī			1.0	0 1	0 103
L	ACCEPTA	NCE INSPECT	Ote, PART 3 (	PLRIODIC) (S	EL TOTEM
-	(			. U33	
١.					·} <u>-</u>
{-			•••	***	1 Single
١.	<del></del>			3 (4)	10
-	<del></del>			O COH	- 302
-	,			U (40	0.00
H	<del></del>			0 Ubd dia	U Gis dia
⊦	-3			***	0. " 5 din
}-	!:			0 3.10 Jin	0 114 110
}-				•••	0 365 (1)
⊦			•••	0. 401 (14	Ú 407 114
⊩	<del>- \  -  </del> -		•••	(), 4 15: Jin	0 115 dia
-				***	0 3th din
⊢	- <u>W</u>		•••	Q. Qett ilja	0. (1)4 (1)6
L_	X		•••		0, 006 11
					- KINCAN II

Figure 1. Outline drawing.

APPENDIX

В

Limited Production Equipment

#### LIMITED PRODUCTION EQUIPMENT

The following is a description of the limited production equipme at listed under Sub-Item 1-2 of the contract.

1. A-C aging rack (2)

Dimensions:

33" wide 76" high 24" deep

Approximate weight: 325 pounds Voltage input: 115V A-C

Purpose: Specialized equipment for a-c aging of electron

tube type 6299.

Prints: 13700K T6-27-41 (4 sheets)

2. High temperature life rack with recorder (1)

#### Dimensions:

33" wide 76" high 24" deep

Approximate weight: 350 pounds

Voltage input: 115V A-C

Purpose: Specialized equipment for the life testing at

225 C. anode seal temperature of electron tube

type 6299.

Prints: 13700K T5-23-41

3. 50 position life rack (1)

#### Dimensions:

33" wide 76" high 24" deep

Approximate weight: 310 pounds Voltage input: 115V A-C

Purpose: Specialized equipment to perform d-c life


testing of electron tube type 6299.

Prints: 13700K T5-23-42


wher


# LIMITED PROLUCTION EQUIPMENT (CONT'L)


- Note 1: Equipment should be calibrated every three (3) months when in use.
  - Note 2: Faulty positions should be reported for maintenance.

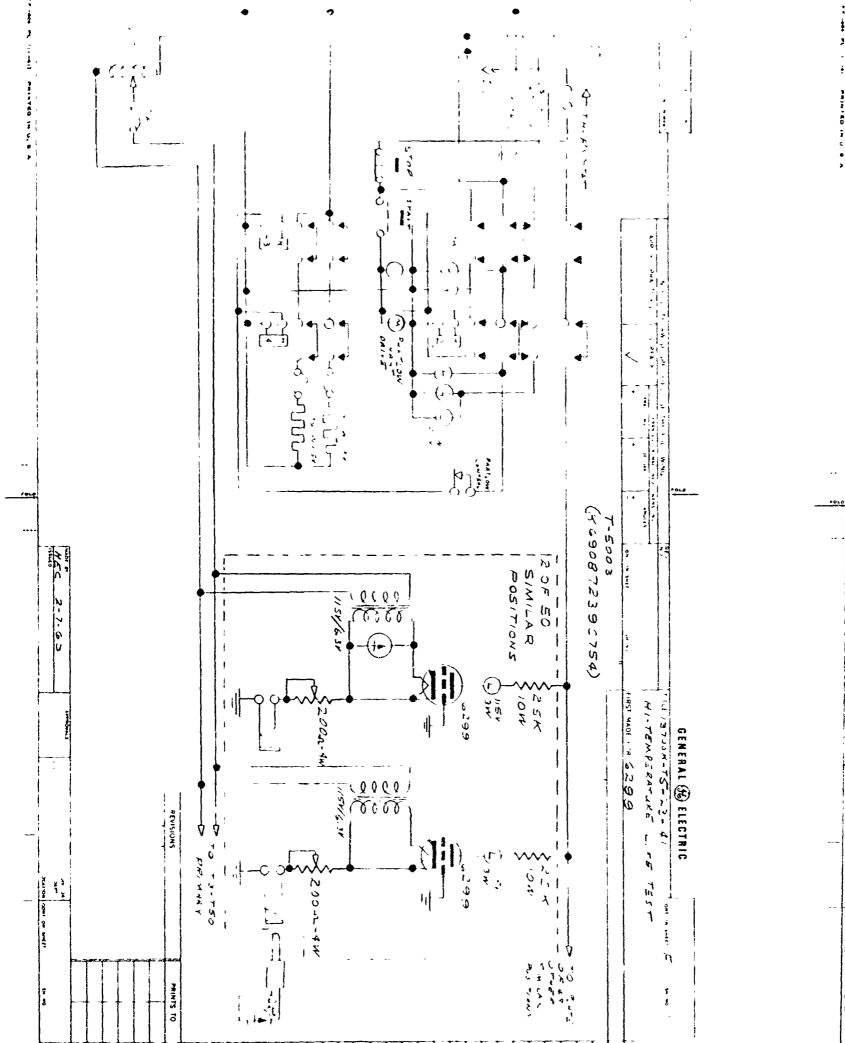

The second secon

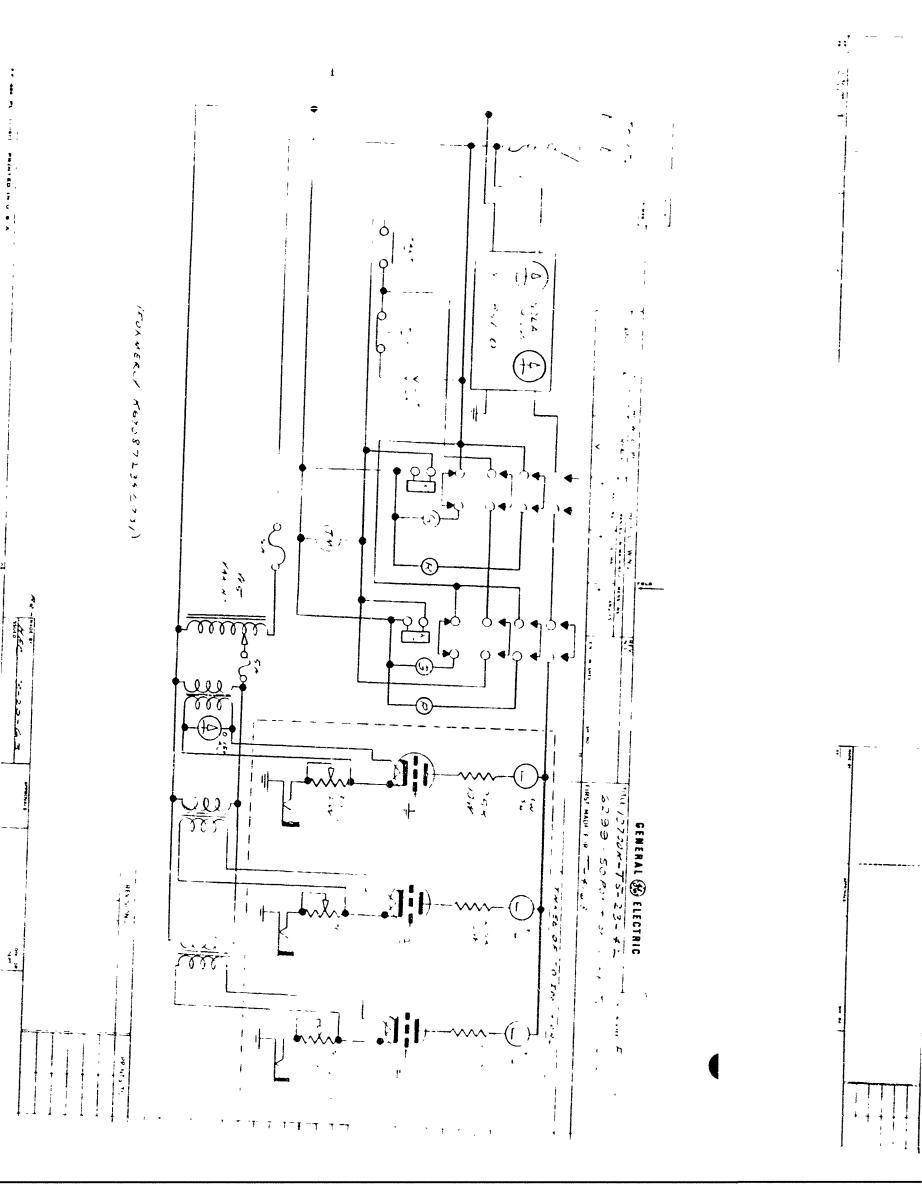

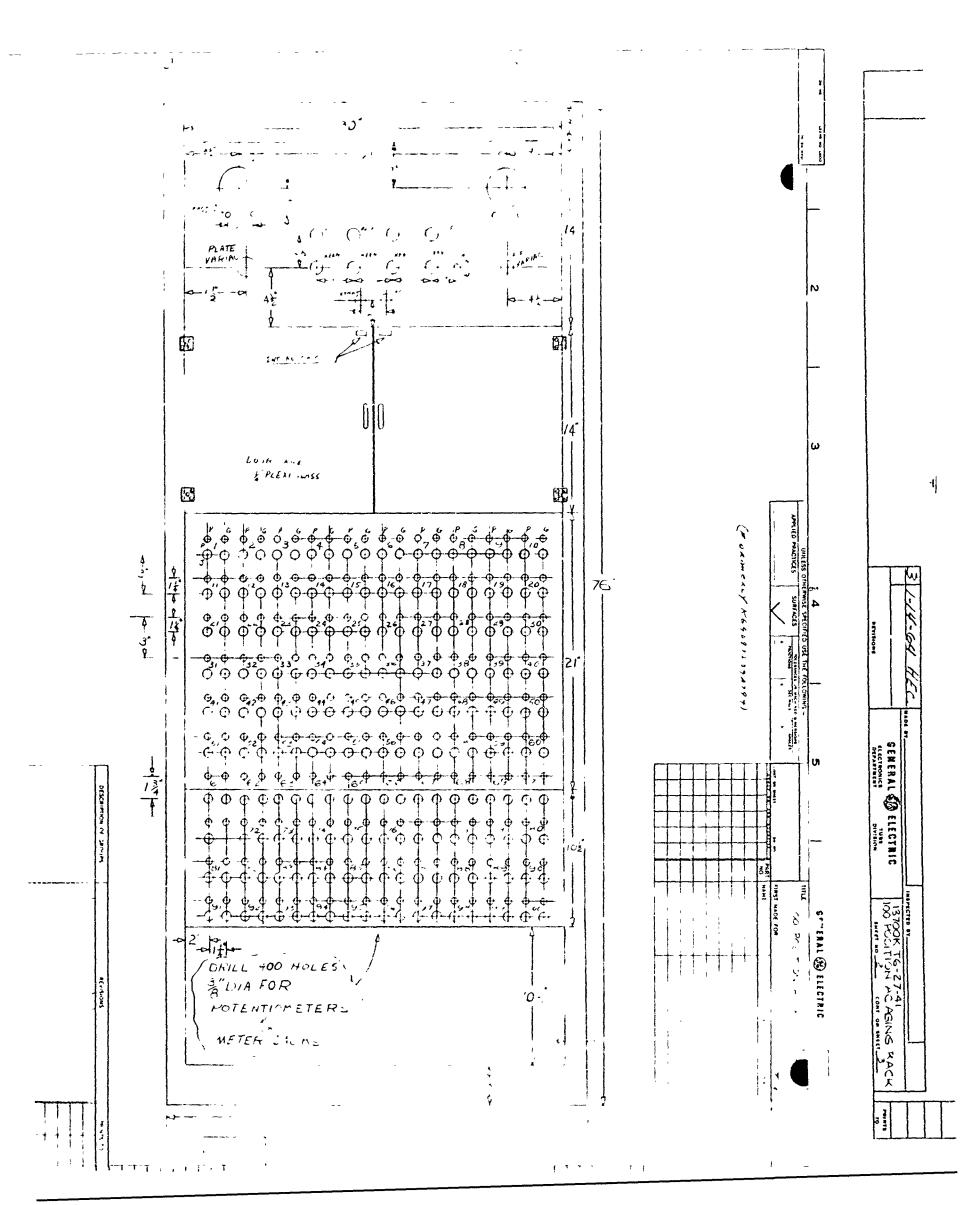

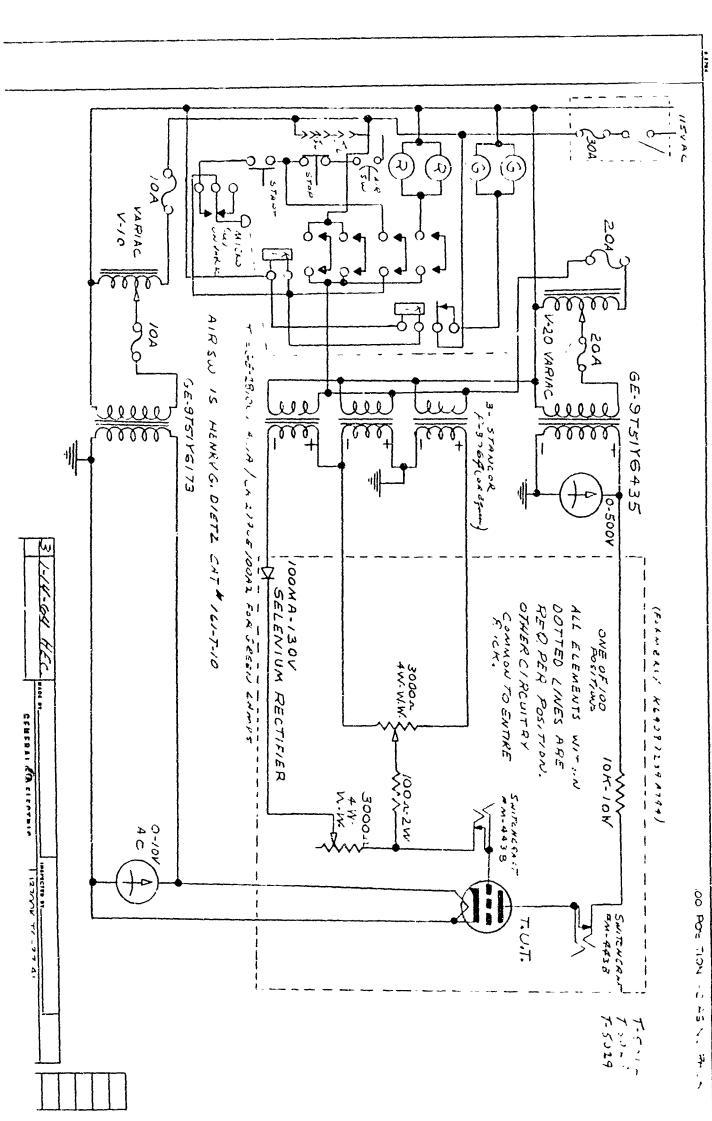

5730x 73.27 +

o o 000 0 9 0 0 დ ა 10 0 0 ; ; > C ) 00 0 0 Ø Q o o r 0.0 0 D 0 0 J Ú Ð 0 ۍ 000 SPACES ESLAC f 0 5 ON **3** 0 ن ټ כ 0 ٥ 0 . . 00 Ð 0 0 5725 - 205 Ģ THE PLANT OF CLASS THEND & 9 ٥ 0 % TO ALLOW AIR TO COOL TUIT ئ 3 Φ 0 00 0, 0 00 Ç 00 2 0 0 0 Φ 0 O Ģ Φ ı, Ð O Φ 00 دار: 33 100 0 Ф c; 00 Φ 0.1 00 3 Φ ð 00 Q 1D 0 00 Φ Φ O i. 3 00 00 000 0 00 D 19 0 Φ 0 00 0 O ٥ Φ 0 D ]**•** O 0 Φ Φ Φ 000 1 0 3 0 1 0 0,1 Ø 00 0 ٽ ون ပ O 0 0 Q i \* 69. 67. 19 00 ٥ 0 0 Φ Ð 0 00 HOLES APPLUX 000 0,0 0.3 00 ф I 00 00 00 ) -ن د ල ට Φ 0 00 0 0000 00 10 000 o. o. 0 0 DIA ١. TUNNED い、モン・・・ VERAL SE CLECTAIC ₹ (II \* 17 1 56 Br. 2. 1.

5. ERAL By ELECTRIC

. . . ---G. ERAL (M. ELECTRIC MAT & TEXTS TE 1. 317

MINITERINAL TO IN CLERK CARLET

ALING COLOR LEFT TOE MEAK NEW

ALS MINITERS TO STORY THE TOP

WITH BOTH TO THE TOP

APPENII. C

Processing Specification

# PROCESSING SPECIFICATION

The processes developed or proven for use on the 6299 in the performance of this contract are as follows:

I. Hard Solder Anode Seal Assembly

Α.	C	omponent Pa	rt	Processes
1.	s-K-K586	Pt. 1	Solder Washer	C1-1B, 06-30
2.	KR3703		Anode Ceramic	Cl-3E, F3-1P, J1-1A, F2-4G 1330C. 45 min. R1E/SCR-1, 20 amp. 30 min. F2-1 950C 15 min.
3.	KR60102		Anode	Normal processing

- B.l. Anode ceramic is placed in brazing fixture. Solder washer is placed on anode ceramic. Anode is inserted in anode ceramic and brazing weight is placed on anode. Fixtures are taken to furnace area.
  - 2. Anode assemblies are brazed F2-1 in a belt furnace with a belt speed of 0.4 feet per minute at 850C.
  - 3. Anode assemblies are removed from brazing fixtures.
  - 4. Anode assemblies are inspected 100% on helium leak detector to check quality of hard solder seals.

IV

## II. Hard Solder Preseal

١.

	Co	mponent Part		Processes
1.	sk-k-586	Pt. 2	Brazing Washer	C1-1B, C6-3C
2.	SK-K-586	Pt. 3	Brazing Washer	C1-1B, C6-3C
3.	SK-X-584		Getter Shell	Cl-lB, C4-lA Cl-2L, F2-4A 1000C 30 min C4-lA, C5-lA/SCRl RlE/SCRl, 25 amp 60 min. (1200 parts with metal pins) F2-l 850C 30 min.
4.	KR70384		Cathode Shell	Cl-lE, Ch-l: Cl-2L, F2-hA 1000C 30 min. Ch-lA, C5-lA/3CRl RlE/SCRl 25amp 60 min. (800 parts with 3mm plastic balls) F2-l 850C 30 min
5.	K-582		Getter Insulator	Cl-2E, F3-1P JllA, F2-LG 1330C RLE/SCR1 20amp. 10 min. F2-1 850C 15 min.

- B. 1. Cathode shell is placed on brazing fixture followed by #3 brazing washer, getter ceramic, #2 brazing washer, and getter shell. Brazing weight is placed on stock taking care to keep alignment. Fixture is taken to furnace area.
  - 2. Preseal assemblies are brazed F2-1 in belt furnace at 650C with a belt speed of 0.4 feet per minute.
  - 3. Preseal assemblies are removed from brazing fixture.
  - 4. Preseal assemblies are inspected 100% on helium leak detector to check quality of hard solder seals.

# III. Improved Cathode And Insulator Assemblies

A.		Component Pa	rt	Processes
	1.	KR3735	Cathode Ceramic	Cl-3E, F3-1P Dip Coat moly manganese F2-2D/S1
	2.	KR70473	Cathode Support Ring	C1-1B, C4-1A C5-2E/SCR1, C6-3D R1A/SCR3
	3.	N11606DA	Cathode Assembly	Normal Processing

- 3. 1. Cathode ceramic is placed on brazing fixture. Cathode assembly is inserted in cathode ceramic. Cathode support ring is inserted with legs between cathode assembly and cathode ceramic. Brazing fixture is placed in the cathode boat. When boat is loaded, the boat is transferred to the furnace area.
  - 2. Cathode and insulator assemblies are brazed F2-1 1110C four minutes in box furnace.
  - 3. Cathode and insulator assemblies are removed from brazing fixture and examined under a lOx microscope for brazing quality.
  - 4. Clean Cl-2C
  - 5. Spray JI-1P
- IV. Heater Ceramic

Cl-3E, F3-1P Coat with titanium hydride

#### V. Final Assembly M1606"

#### Plating Processing

/>CK-l (with metal pins - 4 x 3 min, CAP 30 min.) %-3D RIF/3 (metal pins 200 tubes L amp. 60 min. RIM/S1 (metal pins 200 tubes 10 amp. 120 min.) C6-3D 1 min. RIP/1 metal pins 100 tubes 20 amp 1 min 10 amp 10 min

RIP metal pins 100 tubes

6 amp 20 sec. 4 amp 1 min. 2 amp 18 min.

Barrel Burnish (metal pins & AP2X

# VI. A-C Aging Schedule (6299)

# EQUIPMENT

100 position a-c aging rack

- 1. Place tubes in fixtures. Make certain a positive connection is made on all elements.
- 2. Turn on low pressure air for moderate cooling.
- 3. Adjust filament voltage to 7.0 volts a-c. Allow one minute warm-up time.
- 4. Press plate voltage start button and adjust to 310 a-c.
- 5. Adjust grid current to 8 ma and plate current to 10 ma on each tube.
- 6. If a tube fails to draw current, check its position in the fixture and/or check its characteristics in the static test set. Reject those tubes which are inoperative.
- 7. Repeat Step 5 at 1 hour and 6 hours.
- 8. After 24 hours adjust filament voltage to 6.3 volts a-c.

- 9. Adjust grid current to 6.0 ma and maintain plate current at 10 ma on each tube.
- 10. Tubes are to be removed after 24 hours.
- 11. Report faulty positions so they may be repaired.

# Aging Conditions

Step 1

 $E_{f}$  7.0 vac

 $I_r = 8.0 \text{ ma/tube}$ 

 $E_{bb} = 310 \text{ vac}$ 

 $I_b = 10.0 \text{ ma/tube}$ 

Time = 24 hours

Step 2

 $E_{f} = 6.3 \text{ vac}$ 

 $I_g = 6.0 \text{ ma/tube}$ 

 $E_{bb} = 310 \text{ vac}$ 

 $I_b = 10.0 \text{ ma/tube}$ 

Time = 24 hours

#### Cl-lB

# DEGREASING WITH CHLORINATED HYDROCARBON SOLVENTS

Vapor Degreasing (cool solvent immersion

PURP

#### **PURPOSE**

This method is used to remove non-oxidized oils, greases, fats and such lubricants as are used during forming or other manufacturing operations, or are placed on the work to protect it from corrosion during storage.

EQUII

MATE

#### MATERIALS

Acetone

#### EQUIPMENT

1. Two Dip Immersion Degreaser

PROCE

#### 2. Baskets

#### **PROCEDURE**

- 1. Give the parts a cursery examination for paints or tapes used for color coding. If these materials are present, remove them by washing in acetone before proceeding.
- 2. Parts are thoroughly dried.
- 3. Parts are placed in the basket so they drain easily and liquid solvent is not trapped in the parts.
- 4. Basket of parts is placed in the vapor chamber until the vapor no longer condenses to a liquid on the parts.
- 5. Parts are slowly transferred to the rinse chamber and immersed for at least 30 seconds.
- 6. Parts are again placed in the vapor chamber until the vapor no longer condenses to a liquid on the parts.
- 7. If necessary parts are tilted or retated while still in the vapor chamber to encourage solvent drainage.
- 8. Parts are removed from the degreaser.

# C1-2C/SCR1

# CLEANING WITH WATER, ACETONE AND/OR ALCOHOL

#### **PURPOSE**

This method is used to remove dust and particles.

#### MATERIALS

Denatured ethyl alcohol Dry Acetone

#### EQUIPMENT

- 1. Ultra-Sonic cleaning unit
- 2. Suitable holder
- 3. Container for solvent
- 4. Culture dish
- 5. Tweezers

#### PROCEDURE

- 1. Alcohol or Acetone is poured into container to a height of 2".
  2. Parts are assembled onto the holder, so that the open end of the eyelet is pointing towards the center.
- 3. Holder is placed into the container with the denatured ethyl alcohol so that the parts are just under the surface of the liquid.
- 4. The generator is allowed to operate for three minutes.
  5. The holder is removed and parts are removed with tweezers.
  6. Parts are blown dry with low pressure filtered air.
- 7. Parts are stored in a covered culture dish.

# Cl-2L

# CLEANING WITH WATER, ACETONE AND/OR ALCOHOL

# Ultra-Sonic Cleaning With Acetone

MATERIALS	
Acetone	PURPOS
EQUIPMENT	T. <b>S</b> '
1. Suitable holder or container	<b>b</b>
2. Ultra-sonic generator (GE Cat. #8665966 G-3)	a.
3. Container for solvent	f
4. Watch glass cover for holder	T!
nno annum'i	W.
PROCEDURE  1. Acetone is poured into container to a height of 2".	MATERL
2. Parts are assembled onto the holder or container.	I AT D, CD
3. Holder is placed into the container with the acetone so that	•••
the parts are just below the surface of the liquid. A watch glass	Bath Com
cover is used to keep cleaning solvent from evaporating.	grangenesses and a rest of
4. The generator is operated at 150 ma. for 3 minutes.	Ac€
5. Holder is removed and parts are spread on lint-free paper	
to dry.	B. Dei
PRECAUTIONS	
1. Cleaner should be kept covered when not in use.	C. Ige
2. Use fresh cleaning agent for each cleaning.	det
3. Use only clean containers for cleaning agent.	equ
	D. Nit
	EQUIPME
	A.
	Þ

В. Sh or ch' 0. fo: D. chi

#### C1-3E

# CLEANING WITH WATER, ACETONE OR ALCOHOL

(Ultrasonic-Acetone, Deionized Water-Nitric Acid - Ceramics)

#### **PURPOSE**

The purpose of this process is to clean dense ceramic insulators in such a manner that all conceivable contaminants are anticipated to be present on the parts before cleaning and are effectively removed, and that the resulting ceramic parts are clean to the degree required for use in the making of high quality, reliable electronic tubes. This process uses ultrasonic cleaning of dense ceramic insulators with acetone and deionized water coupled with acid cleaning in HNO3.

#### MATERIALS

NOTE: Deionized Water Used Throughout

ith	Composition	Composition Patio	Them cal_irade	cquirea
Α.	cetone	Acetone alone, rm. temp.		(2 Ultrasonic
В.	Deionized H <sub>2</sub> O	Water alone, rm. temp.	1,000,000 ohm min.	4 (1 Ultrasonic)
C.	Igepal (850) detergent or equivalent	Added to first deionized water bath	Andora Chemicals General Analine & Film Company 135 Hudson Street New York 14, N.Y.	5-10 cc/gal.

No. Baths

### D. Nitric Acid

30% HNO3 - rm. temp.

# EQUIPMENT

- A. Suitable tanks, beakers or other containers for the required baths.
- B. Suitable basket or other perforated container for holding parts. Should be preferably non-metallic, such as nylon, diallyl phthalate or polyvinyl chloride, or a metallic basket lined with clean ceramic chips so that ceramic parts do not contact the metal.
- C. Ultrasonic generator; transducer, either built into tank or suitable for immersion into bath. Capacity 50 watt/gal. liquid, minimum.
- D. Nitric acid resistant perforated basket lined with clean ceramic chips, if metallic.

#### BASIC PROCESS

١

Because at the present state of the art it is not possible to accurately and exactly specify and measure the desired end result of this process, it is necessary to specify the process itself in detail. The described process is a compilation of the best thinking of those dealing with the cleaning of ceramic insulators within the department and is supported by actual and successful application of the process, in detail, within the department. In order to guarantee the attainment of success theretofore obtained with the process, it is necessary that it be carried out as specified and departures from the process not be made without being sure of the necessity for any modifications.

#### PROCEDURE

Note: Ceramic parts should never be handled with bare hands, with woven gloves, with paper over fingers or with metallic tools. It is important to use handling tools or equipment provided with approved non-metallic contact surfaces.

- A. Thoroughly rinse in acetone. Ultrasonorate in acetone. Remove parts from bath with ultrasonic power on.
- B. Ultrasonorate in delonized water to which a quantity of Igepal 85C detergent, or equivalent, about 5-10 cc/gal. has been added. Remove parts from bath with ultrasonic power on.
- C. Rinse in three-step deionized water bath for at least 15 seconds in each step.
- D. Transfer parts to nitric acid resistant perforated basket, if not already so contained, lined with clean ceramic chips if metallic, and soak in 30% nitric acid for 5 minutes.
- 5. Thoroughly rinse parts in the three step deionized water bath for at least 15 seconds in each step.
- F. Ultrasonic clean in deionized water for 5 minutes.
- G. Parts are rinsed in two separate acetone baths for at least five seconds in each bath.
- H. Infra-red dry.

#### PRECAUTIONS AND CONTROLS

- A. Successful processing of parts according to this instruction will depend in large measure upon proper control of the solvents, solutions and equipments called for. Necessary control procedures should be incorporated in corresponding specific standing instructions.
- B. In order to make the cleaning action most effective in the ultrasonic baths, the ultrasonic generator should be adjusted for each case and each batch of parts to produce optimum cavitation within the bath.

# PRECAUTIONS AND CONTROLS (CONT'L)

D. In order to preserve the processed parts in their cleaned condition, it is advisable that they be placed in clean, covered containers after this processing and be so stored or transported to the next operation.

MEASURABILITY OF END RESULT

Parts which have been properly cleaned per this basic process will look thoroughly clean to the naked eye and under a magnifying lens, with no evidence of any stain, soil or "water marks".

#### CL-LA

# ALKALINE CLEANING

# Clepo #6h

# PURPOSE

This method is used to remove heavy metal soaps as well as exidized organic compounds which are not removed by vapor degreasing.

#### MATERIALS

		sition	Engineering	
	Limits Ratio		Chemical Grade	Conc. in Container
Solution #1 Clepo #64 5-10	02 /92] 8	02.	Gum Chemical Co.	100% powder
Deionized water		gal.	500,000 ohms	TOOK boador
	~	5	or greater	
So	lution is used	at boiling te	_	
Solution #2				
Hydrochloric acid	1	part		37% HCl
Deionized water	3	parts	500,000 ohms	,
			or greater	
So	olution is used	at room temp	erature.	
Solution #3				
Ammonium hydroxide	1	part		28% NH3
Deionized water		parts	500,000 ohms or greater	•

# Solution :

37% HCl acid only Hydrochloric acid

Solution is used at room temperature.

#### EQUIPMENT

- 1. Tanks Solution #1 should be used in stainless steel tanks, solution #2 in Pla-Tank plastic crocks or earthenware crocks and solution #3 in eartherware crocks.
- 2. Baskets Stainless steel baskets should be used.

#### PROCEDURS

1. A basket large enough to allow free movement of parts for thorough agitation is selected. A much greater level of agitation is provided if the work is completely withdrawn from the cleaning and rinsing baths and then reimmersed rather than by merely swishing the work about,

# PROCEDURE (CONT'D)

- Parts are immersed in solution #1 for a minimum of 10 minutes. Clepo solution must be 90-100C in order to clean parts thoroughly.
- 3. Parts are agitated in hot water for at least 15 seconds with inlet faucet wide open. Hot rinse water must be 90-1000 to dissolve all of the lepo solution.
- ii. Parts are agitated in cold water for at least 15 seconds with inlet faucet wide open.
- 5. Parts to receive further aqueous cleaning, omit Steps 5 to 11.
- 6. Parts with visible heavy rust are soaked in Solution #4 until clean. Other parts are agitated in Solution #2 until clean.
- 7. Parts are agitated in cold water for at least 15 seconds with inlet faucet wide open.
- 8. Parts are agitated in Solution #3 for at least 15 seconds.
- 9. Parts are agitated in cold water for at least 15 seconds with inlet fauc 't wide open.
- 10. Parts are agitated in hot water for at least 15 seconds with inlet faucet wide open. Parts are shaken to remove excess water.
- 11. Parts are rinsed in acetone for at least 15 seconds.
- 12. Parts are dried with compressed air.

#### TROUBLE SHOOTING

Dirty parts - parts remaining dirty during the process could be caused by:

- 1. Operating temperature of solution #1 is not at temperature specified.
- 2. Hot water rinse is not hot enough.
- 3. Solutions #1, #2, or #3 are contaminated.
- 4. Degreasing prior to caustic cleaning often sets up the drawing compound making it difficult to remove.
- 5. Caustic cleaning will not remove a carbon smut.

# C5/1A/SCR1

# CLEANING WITH ACID COMBINATIONS

# Nitric, Sulfuric (Bright Dip)

# **PURPOSE**

This method is used to remove stains from molybdenum, copper, nickel or monel. Parts should be bright when cleaned by this method. Fernico or iron are not left bright. Oxides are not removed by this process, or they are removed so slowly that pitting results.

#### MATERIALS

Note: Deionized water used throughout

Bath Composition	Composition Ratio	Chemical Grade	Engineering Data Conc. In Container
Solution #1	COMPOSITOION RECTO	Chemical brade	CONTRACTOR
Nitric Acid	l Part		70% HNO3
Sulfuric Acid	l Part		98% H2SÓU
Deionized Water	l Part	1,000,000 ohms o	r
		greater	

Solution is used at room temperature.

Suitable containers for deionized water.

#### EQUIPMENT

- 1. Tanks Pla-Tank plastic crocks or earthenware crocks can be used for tanks.
- 2. Baskets Stainless steel basket should be used.

#### PROCEDURE

- A basket large enough to allow free movement of parts for thorough agitation is selected. Cylinders may be handled with a hooked rod or strung on a wire to prevent contact between them.
- 2. Basket of parts is agitated in solution #1 for 2-5 seconds.
- 3. Parts are agitated in cold deionized water for at least 15 seconds.
- 4. Parts are agitated in hot deionized water for at least 15 seconds.
- 5. Parts are agitated in cold deionized water for at least 15 seconds.
- 6. Parts are rinsed in a 3 step deionized water bath for at least
- 15 seconds in each step.

Note: If next step in processing is plating then omit operations 7 and 8 and go directly to plating bath,

7. Parts are agitated in 2 separated acetone rinses for at least 5 seconds in each rinse.

# PROCEDURE (CUNTID)

8. Parts are infra-red dried.

Parts should not be redipped if metal thickness is held to a close tolerance, since continual dipping reduces the thickness. Not more than 24 hours shall elapse between cleaning and assembly of parts.

#### CLEANING WITH HYDROCHLORIC ACID

#### (Immediately Before Plating)

#### **PURPOSE**

Removal of oxide films and tarnish films - This instruction describes a preferred method for removing oxides and films from steel and fernico parts.

Appearance of part after cleaning - After cleaning the part with hydrochloric acid, the part should have a clean surface free from oil or discoloring stain. The clean metal may be etched or shiny.

#### MATERIALS

		Engineering D	ata
Bath Composition	Composition ratio	Chemical Grace	Conc. in Container
Solution #1 Acetone			
Hydrochloric acid	1 Part		37% HCl
Igepal 630	1 cc/1	Jeneral Aniline & Film	-
Deionized water	l part	500,000 ohms	

Solution is used at room temperature.

Solution "2

Sodium Gyanide 60 g/l 90% DuPont Special Quality Igepal 630 1 cc/l General Aniline & Film 500,000 ohms

Solution is used at room temperature.

Solution #3

Ammonium hydroxide 1 part 30% NH<sub>3</sub>
Deionized water 3 parts 500,000 ohms

Solution is used at room temperature.

# EQUIPMENT

- 1. Tanks Pla-Tank plastic crocks and earthenware crocks can be used for hydrochloric acid, sodium cyanide and ammonium hydroxide solutions.
- 2. Baskets Baskets are stainless steel, nickel, monel, or polyvinyl chloride coated mesh baskets.

#### **PROCEDURE**

- 1. A basket large enough to allow free movement of parts for thorough agitation is selected.
- 2. Parts are cleaned in Solution #1 according to the instruction number on the process cards which describes the operation following cleaning.

			Steps
Operation Following	Immersion	Agitation	Following
Cleaning	Time	Time	Step (2)
RlJ	10-30 min.	2 min	(3)(4)(6)(7)
RLE	10-30 min.	2 min	(3) (4)(6)(7)
RlM	10-30 min.	2 min	(3)(4)(5)
Plf	2-10 min.	2 min	(3)(4)(5)
.uA, dB,RlL	2-10 min.	2 min	(3)(4)(6)(7)
All other parts	10-30  min.	10 <b>-3</b> 0 sec	(3)(4)
(Assembly parts)			(3A)(4A)(5A)(6A)

Parts which are to be plated:

- 3. Parts are rinsed in cold water for at least one minute. Parts must be kept in motion during rinsing. Inlet faucet must be wide open.
- 4. Parts are rinsed in hot water for one minute with the inlet faucet wide open.
- 5. Parts to receive nickel plating operation can now be placed in the plating tank.
- 6. Parts to receive copper, silver or cadmium plating operation are placed in Solution #2 for one to ten minutes. Crocks used for sodium cyanide (Solution #2) will be labeled:

"Solution #2, C5-2E for RlJ only" and "Solution #2, C5-2E"

Parts which do not receive operation RlJ should not be placed in the crocks designated "For RlJ only".

7. Parts to receive copper, silver or cadmium plating operations are placed in their respective plating tanks.

#### All other parts:

- 3A. Parts designated as "all other parts" (assembly parts in the table) are rinsed in Solution "3 for 15 seconds.
- MA. Parts are rinsed in cold water for 15 seconds with inlet faucet wide open. Parts are shaken to remove excess water.
- 5A. Parts are rinsed twice in acetone. Discard the acetone when the specific gravity increases to 0.82. Specifice gravity should be measured with a lab hydrometer in the range desired.
- óA. Parts are dried with compressed air.

#### CLEANING WITH SALTS

#### (Sodium Cyanide)

1. It is important t	hat containers of cyanide a	are not located near any
•	n contact with cyanide, a d	•
acid, is formed.	,	
2. Do not discard cy	anide down the drain, pour	into the steel barrel
		e Erie Plant for disposition.
magness rot blice parpo	de willell with the delie of a	ie pire frame for draboarcion.
marked for one purpo	se willen with be selle to de	de Elle Tranc for disposition.
• •	se willen will be some of a	de Bile Flant for disposition.
• •	Composition Ratio	Chemical Grade
ERIALS		-
ERIALS  Bath Composition		-
ERIALS  Bath Composition  Solution #1	Composition Ratio	Chemical Grade

This method is used for removing sulfides from silver and silver solder.

PURPC

MATER

EQUIPM

PROCEI

ī

а

2

3 i

s

4

t:

So.

I

Solution #2

Acetic acid, glacial

99.5% l part Reagent Grade 19 parts 500,000 ohms or better Deionized water

500,000 ohms or better Deionized water Acetone

EQUIPMENT

**PURPOSE** 

- 1. Tanks Pla-Tank plastic crocks or earthenware crocks can be used. PVC lined steel tanks.
- 2. Baskets Stainless steel, monel or nichrome baskets can be used.

# PROCEDURE

- 1. A basket large enough to allow free movement of parts for thorough agitation is selected.
- 2. Parts are agitated in Solution #1 for at least 30 seconds.
- 3. Parts are agitated in cold water for at least 15 seconds with inlet faucet wide open.
- 4. Parts are agitated in solution #2 for 15 seconds.
- 5. Parts are rinsed in cold water for 15 seconds, with inlet faucet open.
- 6. Parts are rinsed with agitation in hot deionized water for 15 seconds with inlet faucet open.
- 7. Parts are rinsed in acetone for 15 seconds.
- E. Parts are dried with compressed air.

- 18 -



#### C6-3D

#### CLEANING WITH SALTS

# Sodium Cyanide

#### **PURPOSE**

This method is used to neutralize parts prior to plating.

#### SAFETY

- 1. It is important that containers of cyanide are not located near any acid. If acids come in contact with cyanide, a deadly gas, hydrocyanic acid is formed.
- 2. Do not discard cyanide down the drain. Pour into steel barrel marked for that purpose.

#### MATERIALS

Bath Composition	Composition Ratio	Chemical Grade
Solution #1		
Sodium cyanide	l part	96% DuFont Co.
Deionized water	lé parts	500,900 ohms or greater
Igepol 630	1/1000 part	General Aniline and Film

#### Solution is used at room temperature

#### EQUIPMENT

- 1. Tanks Pla-Tank plastic crocks or earthenware crocks can be used.
- 2. Baskets Stainless steel, monel or nichrome baskets can be used.

#### PROCEDURE

- 1. A basket large enough to allow free movement of parts for thorough agitation is selected.
- 2. Parts are immersed in Solution #1 for 1-10 minutes.
- 3. The parts can be transferred directly to a cyanide plate solution if there is no possibility of dripping onto the floor or into other solution. Otherwise, the parts must be rinsed in cold tap water.
- 4. When this operation is followed by a plating operation, parts are transported in a container of Solution #1 and must be allowed to dry or partially dry before being placed in the plating solution.



#### DRY HYDROGEN FIRING

#### EQUIPMENT

Ì

- 1. Suitable hydrogen furnace
- 2. Thermocouple and meter
- 3. Optical pyrometer or equivalent
- 4. Sutiable firing boats
- 5. Rod to push boats through furnace and hooked rod to remove boats from cooler.
- 6. Clean white gloves to wear when handling fired parts.
- 7. Source of dry hydrogen Dew Point 60F to 90F. Line hydrogen may be purified and dried by running it through a copper chip furnace (maintained at 650C) and an alumina dryer (maintained at 35F) or Catalytic Oxidizer, "Deoxo" purchasable from Baker Chemical Co., Philipsburg, New Jersey, or equivalent.

#### PROCEDURE

Parts are loaded in the firing boats then pushed into the hot zone where they are fired at the specified temperature for the specified time.

#### LIMITATION

The specified times and temperatures appear on the appropriate Standardizing Notice and in all cases indicate the period of time for which the parts are to be held in the heat zone. When cemperature only is specified parts are to be brought up to that temperature then pushed into the cooling section. A tolerance of ± 25C is allowed on all specified temperatures. All stated times are in minutes unless otherwise specified.

Parts are pushed into the cooler and then removed when cooled.

#### F2-2D/S1

#### SPECIAL HYDROGEN FIRING

(Coated Ceramic Cylinders)

#### **PURPOSE**

To issue instructions for firing coated ceramic cylinders used in metal-ceramic seals.

#### EQUIPMENT

Hydrogen furnace, opening 6" high x 8" wide with dry hydrogen cooling chamber.

Source of wet hydrogen

Source of dry hydrogen with dew point of -60 to -90F.

Molybdenum firing boats with covers 12" x é" x 5 1/2" high

Molybdenum spacer sheets 11 1/2" x 5 1/2" x .020" - .030" thick

Fire brick, Babcock & Wilson #28

Note: Alundum chips (All) may be used in the bottom of the firing boat in place of the fire brick.

#### PROCEDURE

1. Bottom of hoat is lined with 3/4 layer of fire brick and covered with a specer sheet. Cylinders are placed on sheet with the axis vertical, isolated from each other and from side of boat. (More layers may be built with spacer sheets between if cylinder lengths permit.) The boat is covered.

Note: For ceramic cylinders having wall thickness greater than 1/8" or for ceramics having large mass, all sides of boats should be lagged.

- 2. The filled boat is preheated for 15 minutes on the fore-hearth just inside the furnace door.
- 3. The boat is then heated for 45 minutes at 13000 in the hot zone.
- 4. The boat is pushed into the cooler and left to cool for 30 minutes. (H<sub>2</sub>O temperature 120F.)
- 5. Cooling chamber door (between firing zone and cooling chamber) should be closed when firing or cooling because wet hydrogen is run in the box portion of the furnace while dry hydrogen is run into the cooling chamber.

# F2-4A

# FIRING IN WET HYDROGEN

# EQUIPMENT

- 1. Suitable furnace.
- 2. Wet hydrogen supply, having a dew point of 460 to 495F.

Wet hydrogen may be obtained by bubbling hydrogen through water just before it enters the furnace.

#### PROCEDURE

- 1. Parts are fired in wet hydrogen for specified time at specified temperature.
- 2. Parts are pushed into cooling chamber to cool to approximately 80C.

#### F2-LG

#### HYDROGEN FIRING METALIZED CLRAMICS

#### **PURPOSE**

Hydrogen firing metalized ceramics serves six purposes:

- A. Creates positive bond between metalizing and ceramic
- B. Sinters metalizing to permit strong leak-tight seals.
- C. Removes metalizing binder by converting it to gaseous products.
- D. Causes oxidation in metalizing to insure maximum bond
- E. Degasses both ceramic and metalizing.
- F. Cleans up minor contamination on both ceramic and metalizing.

#### MATERIALS

Ceramic insulators as specified on the drawing.

#### EQUIPMENT

- A. Hydrogen furnace 6" x 8" wide opening, hydrogen atmosphere cooling chamber, or retort type furnace for larger pieces or high production runs.
- B. Source of wet nydrogen (preferably from passing dry line hydrogen through water bubbler).
- C. City gas pilot line for pilot flame and flame curtains (hydrogen dew point -60 to -90F.).
- D. Thermocouple and controller-recorder.
- E. Seals Flo-Scope gauges for measuring hydrogen entering muffle and and cooler end of furnace.
- F. Molybdenum firing boats, 12" x 6" x 5 1/2" high
- G. Alundum chips, minus 20 mesh, Norton Co.
- H. Timer, electric or windup.
- I. Rod to push boats through furnace with brackets to store rod in and keep it off the floor.
- J. Asbestos gloves.
- K. Hooked hollow rod connected nitrogen line for flusning boats before bringing through flame cirtain.

#### PROCEDURE

Caution: At no time are ceramic parts to be handled or exposed to the building atmosphere. The audit check during metalizing, proper location of parts in boat after metalizing, careful transport of boat to and from furnace area, and the inspection which follows will result in entirely satisfactory audit of metalizing and firing.

A. All toats will be loaded and unloaded in the metalizing area by metalizing personnel. These boats will be of molybdenum with the bottoms lined with at least 1/2 inch of alundum chips. Each layer of parts to be fired will be supported above the previous layer with spacers. When the boat is properly loaded, the correct processing card should be added to it and then it should be hand carried to the furnace area for firing.

# PROCEDURE (CONT'D)

Note: Extreme care should be exercised in handling loaded boats since the metalized insulators tend to slide rather easily. This will cause sticking and subsequent rejection of parts.

- B. Check that the furnace is at temperature as called for on the processing card.
- C. See that the water level is to red line as marked on bubbler, and H2 is bubbling through it. If below line, add water. If above line, call foreman.
- D. Preheat boat on fore-hearth just inside furnace door for time as specified on process card.
- E. Move boat to hot zone of furnace for time specified on planning and processing ticket counting from time boat is first pushed into the hot zone.
- F. Push boat into cooling chamber and leave there for time as specified.
- G. Purge hydrogen from boat with nitrogen and then pull boat through flame curtain.
- H. Check off operation completed and initial process card.

#### DISPOSITION

After firing operation is completed, boats will be picked up by Metalizing personnel, carried to metallizing area, unloaded and reloaded with more parts.

#### INSPECTION

Metalized ceramic parts are sorted as called for in Standing Instruction N3-23.

#### PROCESS CONTROL

- A. See that all ' drogen entering hot zone is passed through bubbler and furnace flushed 20 min. with wet H2 before each firing shift begins.
- B. Hydrogen flow according to Selas Floscopes should be 75 cubic feet per hour to the hot zone and 50 cubic feet per hour to the cooler whenever parts are being fired. Lower flow rates will not maintain sufficient atmospheric control in furnace.
- C. Use furnace, firing boats, and spacer plates for firing metalized ceramics exclusively. If used for other purposes, do not use them for firng ceramics again. This furnace must be free from iron and other metal contaminants before it will give good ceramic parts.

Boats are provided to be used exclusively for firing metalized ceramic insulators. These boats should not be used to sinter the copper or nickel plated insulators as boat contamination may result.

D. When new boats or spacer plates are to be put into use for firing ceramics, fire them at the regular ceramic firing cycle before using them with ceramic parts.

#### PROCESS CONTROL (CONT'D)

- E. Mark the position of the rod used for pushing boat into hot zone and come to this position each time a boat is moved to the hot zone. This will increase firing reproducibility.
- F. When converting from line hydrogen (-60 to-90F dew point) to wet hydrogen (through water bubbler) or vice versa, be sure furnace is purged for 20 minutes with 75 cubic feet per hour going to the bot zone and 50 cubic feet per hour going to the cooler.

#### TROUBLE SHOOTING

- A. Air may enter the furnace in the following ways:
  - 1. While a boat is being removed from the cooler Flame curtain at end of tube tends to minimize this.
  - 2. A leak in the furnace.
  - 3. Insufficient flushing or preheating of closed or covered boats.
- B. This air may make parts unusable as follows:
  - 1. Free oxygen will cause scale on metal parts or bands.
  - 2. Air from a leak or admittance through cooling chamber will cause a spectrum color on fired parts.
  - 3. Internal explosion and part distortion or rupture if diffusion is restricted too much.
- C. Remove covered boats from the cooling chamber with care as a combustibal mixture of hydrogen and air may form inside. This will be minimal if the boat is properly flushed with nitrogen.
- D. Dust on boats fixtures or parts usually means sluff accumulations on the hearth. Cool furnace and clean hearth.
- E. All parts must be covered with molybdenum trays. City gas used in the flame curtains has a tendency to leave soot and, or sulpher deposits. If parts are contaminated, it may be necessary to substitute hydrogen for city gas in the pilot flame lines.
- F. Cooling chamber temperatures are important. Keep it high enough to avoid condensate accumulation along the floor of the cooler. Under a hot boat this condensate converts to steam which oxidizes work being cooled. Avoid this condition at all times.
- G. If lack of reproducibility in seal strength is a problem, it may be the result of not using wet hydrogen for this firing or not purging enough before firing shift is started.

#### MA INTENANCE

A. Cleaning - During normal operation, furnaces are bound to get crudded up one way or another. Scot and sulpher deposits will build up at both ends of the furnace due to the constant burning of city gas. Rust accumulates in the cooler sections tecause of the unavoidable sweating problem which crops up every once in a while. Boat lagging

#### MAINTENANCE

### A. Cleaning (Cont'd)

material covers the bottom of the furnace because boats have gaps or holes in them. If the furnaces are not cleaned on a periodic basis a serious degradation in parts' quality will result. Furnaces should be cleaned at least twice a year. The following procedure is recommended:

- 1. Shut furnace down as outlined in procedure under "starting and stopping".
- 2. Wire brush entire cooling chamber to remove all rust, scale, and dust.
- 3. Check all furnace doors for cracks and/or missing pieces. Rebuild or replace if necessary.
- 4. Check cooling chamber for water leaks. Patch and/or replace if necessary.
- 5. Check elements and all brick work. If brick work is badly cracked, and has the "ready to cave in" look, a major rebricking job is suggested.
- 6. Vacuum clean the entire interior of the furnace.

B. Calibrating - Furnace controls must be calibrated periodically to insure the validity of their readings. All work of this type must be handled by the electrical service group. An accurate millivolt source is hooked to the input terminals of the recorder and a set procedure is followed to insure reproducibility of results. There is no need to check thermocouples or thermopiles since they are accurate until they short out. At that time, the indicator will climb past the limit point and the furnace will be shut off automatically. The recorders will be calibrated every second menth with the calibrated millivelt source. The person doing this will then label the furnace with date calibration was completed and his initials. Also, every sixth month a traveling thermocouple will be run through the furnace with resulting readings being checked against the furnace controls. This should be done after shut down periods and before parts are started through the furnace again.

Note: The electrical service group is responsible for the accuracy of the furnaces. It is important that they be notified whenever a furnace controller seems to be acting up. No controls should be tampered with by anyone except people from this electrical service group.

# C. Starting and stopping

1. Ignition of eight inch hydrogen box furnaces.

# C. Starting and stopping (Cont. d)

- a. Close end doors of furnace and open cooler door.
- b. Purge furnace for two hours with nitrogen. Use a flow of 100 cfh. on each hydrogen flow scope.
- c. Turn power switch from off to instrument.
- d. After two hours of nitrogen purging, light pilot lights. Check flame curtains. Open water valve to cooler and close off the water bypass.
- e. Increase nitrogen flow for five minutes to a reading of 200 ofh. on each hydrogen flow scope.
- f. Simultaneously, introduce hydrogen and shut off nitrogen to the furnace. Regulate to 75 cfh. of hydrogen in the hot box and to 50 cfh. of hydrogen in the cooler.
- g. Purge with hydrogen for one hour.
- h. After one hour close the cooler door.
- i. Turn power switch from instrument to heat. Reactrol unit should be reading approximately 80.
- j. Bring furnace to desired temperature in intermediate steps. That is, hold heat constant at various stages to allow brickwork to reach thermal equilibrium.
- 2. Idling of eight inch hydrogen box furnaces.
  - a. Open cooler door.
  - b. Decrease flow of hydrogen to 35 cfh. in the cooler section.
  - c. Turn off all hydrogen leading into the hot box. Maintain
  - 35 cfh. in cooler section.
  - d. Bring temperature down to 900C or 1000C.
- 3. To prepare for operation
  - a. Increase flow of hydrogen to 50 cfh. in the cooler.
  - b. Flow 75 cfh. of hydrogen in the hot box.
  - c. Close the cocler door.
  - d. Adjust to desired temperature.
- 4. Shutting down of eight inch hydrogen box furnaces.
  - a. Turn power switch from heat to instrument.
  - b. Open cooler water bypass. Regulate water flow until it
  - is coming out warm.
  - c. Open cooler door,
  - d. Allow temperature to drop below LOOC.
  - e. Simultaneously, open up nitrogen and turn off the hydrogen. Regulate nitrogen flow to 200 cfh. on each hydrogen flowscope.
  - f. When hydrogen is no longer burning off at either end of
  - the furnace, shut off nitrogen and allow the furnace to go to air.

4. Shutting down of eight inch hydrogen box furnaces (Cont'd)

ľ

Ē

<u>P</u>

g. Turn off pilot lights.h. Open both end doors.

Ì

- 28 -

#### F3-1P

#### AIR FIRING CERAMICS

#### **PURPOSE**

The purpose of air firing ceramics is threefold:

- A. To oxidize all organic and carbonaceous materials and convert them to gaseous products which go off into the furnace atmosphere.
- B. To drive undesirable volatiles out of the body of the ceramic and replace them with air gases which can be removed relatively easily at exhaust without altering crystal phases.

  C. To oxidize any iron deposits and show them as stains or

This instruction, therefore, is written to provide a means of accomplishing these purposes on ceramic materials.

#### **MATERIALS**

Ceramic parts as specified on the drawing.

color variations in the piece.

#### EQUIPMENT

Suitable turnel kil capable of reaching 11000 Silicon carbide saggers
Portable indicator with thermocouple leads.

#### PROCEDURE

- A. Parts come to furnace loaded in carbide saggers covered with mullite lids.
- B. Parts are fired in a tunnel kil with air forced through furnace against the movement of the ceramics. The parts are 7 hours up to maximum temperature and 7 hours of cooling down from maximum temperature. Maximum temperature is 1100C.

# DISPOSITION

Send boats to next station on processing ticket, still covered (usually inspection).

#### INSPECTION

After the boat has cooled to room temperature, lift the cover vertically without tilting or moving it away from covering area over the parts. Give the parts a cursory visual examination for obvious spots, cracks, chips, areas of discoloration or contamination without touching or removing the fired parts. If no defects are observed, replace the cover and send the boat to the next planned station. If defects are noted, call foreman.

#### PROCESS CONTROL

- A. The furtace used for firing ceramics shall not be used for firing any other materials at any time.
- B. Use boats for firing ceramics only. Firing other parts in them only leads to contamination of several batches of ceramics.

#### TROUBLE SHOOTING

- A. If parts show spots, it indicates:
  - 1. The boats are contaminated with something that is being transferred to the parts during firing.
  - 2. Parts were not clean when placed in boats after acetone wash.
  - 3. The even is contaminated with something which is dropping or being splashed on parts during firing.
  - 4. Something near the surface of the ceramic body is being converted to a colored product by air firing (such as iron deposits from the die used in making the part).
- B. Larger discolorations on the parts indicates:
  - 1. Contaminated furnace.
  - 2. Contaminated parts.
  - 3. Non-uniform milling lot at vendors plant.
  - 4. Diffused iron deposits left on parts by vendor's processing.
- C. Parts coming from the furnace cracked, chipped or broken show:
  - 1. Incipient cracks in the part as received from the vendor.
  - 2. Incipient cracks from rough handling in our plant.
  - 3. Thermal shock oven temperature too high when parts placed in oven or removed from oven.
- D. Air firing was first started to oxidize the iron left by wendor and show it up as discoloration areas in the part. Since the problem has been largely corrected, the firing has been continued to insure against falling into the same trouble again. Occasionally one or two are found in a lot of 100 or more pieces.
- E. Conical recrystallization is a condition which vendors have not yet found means of controlling. It is, however, strictly their problem.

#### MAINTENANCE

A. Check the furnace temperature at the beginning of each shift as the first job is run in the furnace.

#### Procedure

1. Set furnace at 1000C (corrected to latest controller calibration factor' and record setting in log book.

# MAINTENANCE (CONT'D)

#### Procedure

- 2. When the furnace has reached equilibrium temperature, insert the thermocouple leads from a portable indicator.
- 3. When this has reached equilibrium, record in a log book the extremes of the temperature cycle against the furnace number, setting and the date.
- 4. If extreme readings are between 9850 and 10150 continue firing.
- 5. If extreme readings are not within 9850 to 10150, stop firing and notify foreman.
- B. Calibrate both portable indicator and controller-indicators according to the controller-indicator calibration schedule and tabulate the calibration correction factory and data of calibration on a tag attached to the instrument and in a book kept in the furnace area.
- C. Whenever a firing of some lot of ceramics in these furnaces causes large volumes of volatiles to pour out of the oven (high boiling solvent, body contaminants, etc.) remove it from service until the furnace can be thoroughly cleaned by firing empty furnace at 1100C for 1/2 hr. before it is used again at 1000C for ceramics. Do this once in 3 months as regular practice to insure no buildup of contamination.

#### JIIA

# SILK SCREEN COATING (Silk Screen Metalizing Machine)

#### **PURPOSE**

To butt or end coat ceramic insulators with a uniform, smooth, controllable layer of metalizing mix.

#### MATERIALS AND EQUIPMENT

- 1. Jig or fixture to hold insulators stationary at some fixed height.
- 2. Jig or fixture to hold screen taunt and in a fixed position.
- 3. Stainless steel mesh screen of proper mesh size and wire diameter.
- L. Teflon tipped squeegee to spread paint evenly on the screen and also to force the paint through the screen and to the insulators.
- 5. Properly adjusted moly-manganese mix.
- 6. Small oven to dry coating after being applied to the insulator.
- 7. Molybdenum trays to load parts on for drying and firing.
- 8. Two 100 ml beakers, one for the mix and the other for acetone or other cleaning solvent.
- 9. Cotton swabs for touch up cleaning on ceramic insulators.
- 10. Pliers for setting the moly trays into the drying oven and also for pulling them out.
- 11. Two sided tape for holding insulators down and in a fixed position.

# PROCEDURE - SETUP

- 1. Place a clean piece of two sided tape down on the parts holding fixture.
- 2. Lay five (5) parts to be coated on the tape in the following pattern.
- 3. Lay the .OLO" shim stock across three of the insulators.
- 4. Lay a flat surfaced object on the shim stock and across two of the micro-adjustment nuts.
- 5. Adjust each mut until it just barely touches the flat surface.
- 6. Lay the flat surfaced object across the other two adjustment nuts and on the shim stock.
- 7. Repeat Step 5.
- 6. Set the stainless steel screen supported by the screen fixture into proper position. The two pins in the parts fixture should come through the screen fixture and the bottom of the screen fixture should rest on top of all four micro-adjustment nuts.
- 9. Check the screen fixture for wobble and make necessary adjustments.
- 10. Place proper number of ceramic insulators to be coated on the sticky tape. The only criteria for loading is that no part should touch any other part.

#### PROCEDURE - SETUP CONTED

- 11. Pour erough mix on the screen to allow coverage of the entire area.
- 12. With the teflon tipped squeegee wipe the paint into the screen using firm but not hard pressure. Continually turn the screen over so that all the screen holes are filled with mix. The last wipe should be made on the bottom side of the screen.
- 13. Place the screen fixture on the parts jig and make one pass with the squeegee.
- 14. Remove screen, examine parts, and made adjustments where necessary.

#### PROCEDURE - PRODUCTION

- 1. Flace proper number of ceramic insulators on the parts fixture.
- 2. Put the screen fixture in place and draw the squeegee across the screen.
- 3. Remove the screen fixture, add paint to the screen if necessary, and work the paint into the screen until all meshes are filled with mix.
- 4. Take the coated insulators from the fixture with tweezers and load them on the molybdenum trays.
- 5. Place loaded tray in the drying oven for approximately 15 minutes.

#### PROCESS CONTROL

- 1. Use nothing but properly adjusted screen mix.
- 2. Do not place excess coating on the screen. It will tend to run on the fixture and eventually on the operator and the insulators.
- 3. Do not leave the mix lying on the screen for long periods of time. The vehicles and binders will separate from the metallic particles and an inhomogeneous mix will result. The screen should be clean of all mix at lunch break and again at the end of a shift.
- i. The teflon on the end of the squeezee will tend to wear over a period of time. Then the insulators on the outermost rows are not coating the teflon should be squared off.

#### TROUBLESHOOTING

- 1. Mix not adhering to the ceramic insulator
  - e. Finder has not been added to the mix.
  - b. The oven is too hot and the bunder is coung curn. Foll
- 2. Fritty particles in the mix.
  - a. he rolling time was not sufficient to tale all the funite 46 and officient.
  - . Le all ullime cycle was not correct carticles of metal have not been reduced in size.
- 3. Mix is not working properly into the screen.
  - a. The mix is too thick. Theck viscosity and add Butyl Carbitol Acetate if necessary.

# TROUPLESHOOTING CONTID

- li. Mix running on the sides of the parts.

  a. Temperature of the room is too high.

  b. Viscosity of the mix is too low. Discard and start using from a new bottle.

# SPRAYING CATHODES (Emission Coating)

#### **PURPOSE**

To provide instructions for applying a uniform coating to the entire cathode surface of cathode and insulator assemblies.

#### MATERIALS

- 1. Cathode assemblies per drawing list.
- 2. Triple carbonate suspension specified on drawing list.
- 3. Acetone

#### EQUIPMENT

- 1. Vented spray booth with spraying disc, motor and other fixtures mounted.
- 2. Paasche spray gun.
- 3. Binocular microscope with light.
- 4. Spraying fixtures.
- 5. Post grinder with carboloy cutter.
- 6. Dial gauge.
- 7. Tweezers
- 8. Cathode dummies
- 9. Precison scales

#### **PROCEDURE**

- 1. The assemblies are ready for use as received from the previous ultrasonic cleaning operation.
- 2. The assemblies are placed in the spraying fixtures face down and carefully centered so the cathode is in the hole in the face of the fixture. The back is then screwed on.
- 3. The magnetic fixtures are arranged around the circumference of the spraying disc. Two cathode dummies are included with each load to check spray density.
- 4. Cathodes are sprayed until .0025" to .0035" of coating has been deposited. If uncertain of spray gun setting, a run containing only dummies should be performed and coating density and height checked.
- 5. Catrode dummies are removed and checked for spray coating thickness. These must be within specified limits.
- 6. Cathode assemblies are removed from spraying fixtures and placed in trays.
- 7. Cathode assembly is grasped by back of ceramic with tweezers and run through track of post grinder, applying light pressure against the cutter. The coating thickness is gauged. If within the drawing tolerance the part is placed in a tray, coating side up for future inspection. If coating is too thick, the part is run through the cutter and regauged, if too thin either the cutter is not properly

# PROCEDURE (CONT'D)

•

adjusted or one of the braze joints on the cathode assembly has come loose. Each assembly must be gauged.

- C. The cathode assembly is inspected under microscope for proper
- coverage of coating, chipped edges, gauges, tilts, etc.
  9. After spraying is completed, the jar of coating is removed and a beaker is filled with acetone and the gun is thoroughly flushed out.

#### HLA/SCR3

#### COPPER STILL PLATING

(Pasket)

### PUE.PUTE

To provide an adherent copper flash on small nickel tubing and wire leads (less than 1/16" diameter x 1" long) for brazing purposes.

# MATERIALS

<u>Material</u>	New Bath Content	Control Limits
Copper Cyanide Sodium cyanide Sodium carbonate Sodium hydroxide "Rocheltex" Deionized water to	902 oz 1320 oz 328 oz 246 oz make up to 164 gallons	5-6 oz/gal 1.5-2.0 oz/gal (Free) 2.0-610 oz/gal pH 12-13 5-10% (volume) 500,000 ohms or greater

Operating temperature 140-160 F

Anode to cathode area = 1:1
Adjust as required to maintain copper cyanide content)

Current density - See Plating Process Cards

#### **EQUIPMENT**

- 1. Plating Tank Plastisol or Koroseal lined steel 24" x 24" x 72" working volume 164 gallons equipped with steam heating coil and indicating automatic temperature control.
- 2. ectifiers separate unit for each of four positions 50 amp. 10 v.
- 3. Stainless steel anodes size and number as required.
- 4. Pinse Tanks stainless steel
- 5. Paskets stainless, approximately " x (" dia.
- 6. Filter immersion type with impeller pump.
- 7. "abor Exhaust Venting System.

- 1. Maintain solution at working volume at determined point approximately 3 1/2 inches below top of tank by addition of deionized water as required.
- 2. Anode Maintenance Proper copper ion content of plating bath will be maintained by use of one copper anode and two stainless anodes on each of two anode bars. Adjustment in anodes will be required as copper anodes errode and are reduced in area. Adjust to maintain approximately the initial balance between area of copper and stainless anodes.
- 3. Anode Area Maintain 4 on each of 2 bars. Copper 1" x 4" x 15".

### PROCEDURE

- 1. Parts are placed in nickel mesh basket.
- 2. Parts are cleaned thoroughly before plating.
- 3. Parts are copper flashed at about 3v for 2 to 3 minutes with agitation of parts to prevent sticking together. (Negative contact is made directly to the basket by means of a wire-clip combination.)
- 4. Parts are rinsed thoroughly in cold running water, 10 sec.
- 5. Parts are rinsed in hot running water, 10 sec.
- 6. Parts are rinsed in acetone for 10 sec. and drained.
- 7. Parts are blown dry with carefully directed compressed air.

#### INSPECTION

All parts should be covered with copper plating.

Bath

Βa

Ν

H

D

Nick Ammc Bori Deic ma

# R1.:/S1

# NICKEL PLATING

(Barrel)

# **PURPOSE**

- 1. To provide an adherent nickel plate to tube parts. Stainless steel, tungsten and molybdenum is struck with nickel from nickel strike, bath to provide a surface for further plating because other plates do not adhere to these metals.
- 2. Plating is to be uniform, unstained, unblistered and of the specified thickness.

# MATERIALS

# 1. Strike Bath

Bath Composition	Chemical Grade	New Bath Content Tith Solution Level 3" Below Top Of Tank	Control Limits
Nickel Chloride Hydrochloric Acid Deionized Water to make up volume	Udylite Corp.	26,100 g 13,750 cc	220-260 g/l 100-150 cc/l 500,000 ohms or greater

# Temperature - Room

# 2. Plate Bath

Bath Composition	Chemical Grade	New Bath Content With Solution Level 3" Below Top Of Tank	Control Limits
Nickel Sulfate (22.19 Ammonium Chloride Boric Acid Deionized Water to make up volume pH	₹ Ni) Udylite Corp	13,200 g 2,800 g 3,300 g	135-155 g/l 20-30 g/l 25-35 g/l 500,000 ohms or greater 5.4-6.0

Temperature - Room

# . Tank

Construction Material	Capacity At Solution Level 3" Below Top Of Tank	Overall Dimension (inches)
Koroseal Lined Steel	llO liter	22 x 2½ x 16 deep
Koroseal Lined Steel	llO liter	22 x 2¼ x 16 deep

#### 2. Barrels

Belke-Porto Plater with 3/4 inch diameter slug contact for nickel plating = 2 quarts.

#### MAINTENANCE

- 1. Sclution Level Maintain level at  $\pm 1/2$  inches below the top of the tank. A marker is located on each tank to indicate the 3 inch level.
- 2. Filtering Plating Solution To determine the cleanliness of a solution, fill a bottle with the solution and observe the solution by holding it up to the light.
- 3. Anode Area Maintain anode areas as follows:

Type Of Plate	Size Of Anode (inches)	Anode <u>Metal</u>	Chemical Grade	No. Of Anodes
Nickel Strike	1/4 x 5 x 8	Nickel	99+% Chemical Co.	u on each
Nickel Strike	1/2 x 5 x 8	Nickel	Rolled Depolarized or cast in carbon	4 on each of 2 bars

#### L. Parrel Maintenance -

- a. Deplate cathode chain contacts used in the Belke-Porto Platers once a day.
- b. Use Belke-Porto Platers for all nickel deplating.

# PROCEDURE

Ì

- 1. The number of parts to be plated in barrel are weighed out.
- 2. Parts are cleaned thoroughly before plating. Only parts which are uniformly clean looking should be plated. Send back any parts having dirt stains or nonuniform appearance because dirty parts are likely to blister when heated later.

ti

# PROCEDURE (CONT'D)

- 3. Parts are poured gently from cleaning basket to the barrel.
- 4. Parts to be struck as specified in striking table, are immersed in barrel in striking tank. For all the other parts, omit Steps 4, 5, and 6.
- 5. Strike parts according to time and current specified in table. Make sure the barrel is rotating and the filter pump is operating during striking.
- 6. Barrel is lifted out of strike solution while still rotating and allowed to rotate with one end resting on the drain board for four revolutions to drain strike solution out of the parts.
- 7. Barrel is transferred to plating tank.
- 8. Plate according to the number of parts per barrel, current and time specified in the table. Make sure the barrel is rotating and the filter is operating during plating.
- 9. Barrel is lifted out of plating solution while still rotating and allowed to rotate with one end resting on drain board for four revolutions to drain plating solution out of parts.
- 10. Barrel with parts still rotating, is placed into cold water rinse and barrel is allowed to rotate for one minute. Barrel is lifted out of cold water rinse while still rotating and allowed to rotate with one end resting on drain board for four revolutions to drain cold water out of parts. (See note.)
- ll. Barrel, with parts still rotating is placed into hot water rinse and barrel is allowed to rotate for one minute. Barrel is lifted out of hot water rinse while rotating and allowed to rotate with one end resting on drain board for four revolutions to drain hot water out of parts. Electric plug is pulled out to stop barrel rotating.
- 12. Barrel is carried to hot water rinse next to Kreider dryer. Barrel of parts is dumped through funnel cover into drying basket submerged in running hot water.
- 13. Drying basket, with parts is lifted out of hot water and into Kreider spin dryer. Parts are spun until dry which usually takes about two minutes with steam heated hot air.

Rinsing and drying must be done carefully and equipment kept in top condition or stains will appear on plated parts causing rejection of tubes composed of stained parts.

Note: If subsequent operation is \*C6-3D, it must start immediately after this rinse. Parts must not be permitted to dry or partially dry between these operations.

#### RLE/SCR-1

#### COPPER BARREL PLATING

#### PURPOSE

- 1. To provide an adherent copper plating to assemblies and tube parts.
- 2. Plate is to be uniform unstained, unblistered, and of specified thickness.

#### SAFETY

Plating Bath - observe safe handling procedures required in working with hot strongly alkaline cyanide solutions. Do not mix with acid or expose to acid fumes.

Venting - Vent bath vapors into vapor exhaust system.

Acetone - Observe safe handling procedure required for volatile and flammable solvent.

#### EQUIPMENT

- 1. Plating Tank Plastisol or Koroseal lined steel  $2h^n \times 2h^n \times 72^n$  working volume 16L gallons equipped with steam heating coil and indicating automatic temperature control.
- 2. Plating Barrels Daniels' 8H Plastic.
- 3. Barrel Rotating Drive Motor/reduction gear driving common shaft providing rotating drive for four barrel positions.
- 4. Rectfiers separate unit for each of four positions 50 amp., 10V.
- 5. Stainless steel anodes size and number as required.
- 6. Contact medium metal pins or copper-clad plastic balls.
- 7. Rinse Tanks stainless steel
- 8. Baskets stainless, approximately 8" x 8" dia.
- 9. Filter immersion type with impeller pump.
- 10. Vapor Exhaust Venting System.

#### MATERIALS

Copper cyanide, 70 - 71% copper	KR02075
Sodium cyanide, 96%	KR0107
Sodium carbonate	K::01429
Sodium hydroxide	KEJ1132
"Rocheltex" (brightener)	KR01414
Copper anodes, CFHC	KT03372
Acetone	KR04358

#### BATH COMPOSITION

<u>Material</u>	"ew Bath Content	Control Limits
Copper cyanide Sodium cyanide Sodium cyrbonate Sodium nydroxide "Rocheltex" Deionized water t	902 oz. 1320 cz. 328 oz. 246 cz.	5-6 oz/gal 1.5-2 oz/gal (Free) 2.0-6.0 oz/gal pH 12-13 6-10% (volume) 500,000 ohms or greater

Operating temperature 140-160 F.

Anode to cathode area = 1:1

(adjust as required to maintain copper cyanide content)

Current density - see Plating Process Cards

#### MAINTFNANCE

- 1. Solution level maintain level 2 2 1/2 inches below top of plating tank by addition of deionized water as required.
- 2. Bath composition control The maintenance of proper balance between area of copper and stainless anodes will assist in holding copper cyanide bath content within limits.

#### PROCEDURE

- 1. The specified number of precleaned parts are placed into the plating barrel, containing the specified type and quanity of contact medium.
- ?. The loaded plating barrel is inserted into one of the four plating positions provided at the plating tank - insert with barrel rotating drive running.
- 3. Immediately turn switch of rectifier serving the position being loaded to "CN". Adjust rectifier control to specified plating current.
- u. Plate as specified time and current.
- 5. Turn rectifier switch to "OFF".6. Immediately raise plating barrel to position above solution level. Drain excess solution from parts.
- Transfer loaded barrel to cold running r\_nse water tank. Immerse barrel until water covers plated parts. Tumble rinse by rotating barrel 10 - 15 seconds.
- 8. Drain to remove excess rinse water. Transfer plated parts to stainless steel basket. Rinse in cold running water with agitation 10 - 15 seconds.

#### PROCEDURE (CONT'D)

- 9. Rinse in cold flowing deionized water 10 15 seconds.
- 10. Rinse in hot flowing deionized water 10 15 seconds.
- 11. Rinse in hot flowing deionized water 10 15 seconds. (Repeat Step 10 but in second tank or tank section).
- 12. Rinse in cold flowing deionized water 10 15 seconds.
- 13. Parts that are to receive further plating application are carried into the next plating procedure or pretreatment without drying.
- 14. Parts not to be immediately transferred to another plating operation are rinsed in acetone 10 15 seconds, dried, and placed in storage or transport containers, omitting cold deionized rinse of Step #12.

#### PROCESS SCHEDULES AND INSTRUCTIONS

- 1. See Parts Process Cards for specified precleaning and preprocessing schedule.
- 2. See Plating Process Cards for specified number of parts per barrel load, type and quantity of plating contact medium, plating current, plating time, and plating thickness.
- 3. See Tumbling Process Card for specified tumbling procedure where tumbling is called for by Parts Process Card.

#### S-RIE/3

#### COPPER, BARREL PLATING

#### **PURPOSE**

- 1. To provide an adherent copper plating to tube assemblies.
- 2. Plating is to be semibright, unstained, free of blisters and of specified thickness.

#### SAFETY

Plating Bath - Observe safe handling procedures required in working with het strongly alkaline cyanide solutions. Do not mix with acid or expose to acid fumes,

Venting - Vent bath vapors into Vapor Exhaust System

#### EQUIPMENT

- 1. Plating Tank Plastisol or Koroseal lined steel,  $24^{\circ}$  x  $24^{\circ}$  x  $16^{\circ}$ , working volume 36 gallons, equipped with steam herting coil and automatic temperature control.
- 2. Plating Barrel Daniels SH Plastic
- 3. Rectifier 50 amp. 12V
- 4. Baskets stainless, approximately 8" x 8" dia.
- 5. Finse Tanks stainless
- 6. Filter immersion type with impeller pump.
- 7. Contact Medium metal pins.
- 8. Stainless steel Anodes 1/8" x 2" x 11 1/2"
- 9. Vapor Exhaust Venting System

#### MATERIALS

Copper Cyanida, 70 - 71% copper	KR02075
Potassium cyanide, 98%	KR0479
Potassium carbonate, Reagent, Anhydrous	KR0478
Potassium hydroxide, Reagent	KR0480
"Rocheltex" (brightener)	KR011111
Copper Anodes, OFHC, 1 1/2" x 5" x 9"	KR03372

#### BATH COMPOSITION

Material	New Bath Content	Control Limits
Copper cyanide	286 oz.	7.2-8.8 oz/gal
Potassium cyanide	464 oz.	0.8-1.2 oz/gal (Free)
Potassium carbonate	72 oz.	6 oz/gal max.
Potassium hydroxide	200 oz.	Ph 13 or greater
"Rocreltex"		8-10% (volume)
Deionized water to m	make up to 34 gal.	500,000 ohms
		or greater

Operating Temperature 160-170 F.

Anode to cathode area = 2:1

Current density - See Plating Process Card

#### MAINTENANCE

- 1. Maintain solution at working volume at determined point approximately 2 2 1/2" inches below top of tank by addition of deionized water as required.
- 2. Anode Maintenance proper copper ion content of plating bath will be maintained by use of one copper anode and two stainless anodes on each of two anode bars. Adjustment in anodes will be required as copper anodes errode and are reduced in area. Adjust to maintain approximately the initial balance between area of copper and stainless anodes.

#### PROCEDURE

- 1. The specified number of precleaned tube assemblies or parts are transferred into the plating barrel.
- 2. Plating barrel is inserted into plating tank with barrel rotating drive on and the bath at operating temperature.
- 3. Rectifier is immediately turned on and set to specified plating current. After initial adjustment duplicate carrel loads may be inserted with the current on followed by slight current adjustment as required. Hold immersion time with current off to a minimum.
- 4. Plate as specified current and time.
- 5. Raise plating barrel to position above solution level. Drain excess solution from parts.
- 6. Transfer barrel to cold running water rinse tank. Immerse barrel until rinse water covers plated parts. Tumble rinse by rotating barrel 10 15 sec.
- 7. Drain to remove excess rinse water. Transfer parts to stainless basket. Rinse in cold running water with agitation.

#### PROCEDURE (CONTID)

- 8. Rinse parts in cold flowing deionized water 10-15 sec. with agitation.
- 9. Rinse in hot flowing deionized water 10 sec.
- 10. Repeat Step 9 in a second hot rinse tank section.
- 11. Rinse in cold flowing deionized water 10 sec.
- 12. Tubes to be nickel plated are transferred to that operation without drying.
- 13. Parts not to be immediately transferred to another plating operation are dried and placed in storage or transport containers, omitting the cold deionized rinse of Step #11.

#### PROCESS SCHEDULES AND INSTRUCTIONS

- 1. See Parts Process Cards for specified precleaning and preprocessing schedule.
- 2. See Plating Process Cards for specified number of parts per barrel load, plating current, plating time and plating thickness.
- 3. See Tumbling Process Cards for specified tumbling procedure where tumbling is called for by Parts Processing Card.

#### LIMITATION

The time of rinsing in hot water in Steps 9 and 10 is reduced to 10 seconds to prevent oxidization of copper plating prior to nickel plating.

#### GOLD, BARREL PLATING

#### PURPOSE

- 1. To provide an adherent gold plate to tube assemblies and parts.
- 2. Plating is to be yellow in color, unblistered and of specified thickness.

#### SAFETY

Plating Bath - Observe safe handling procedure required in working with hot alkaline cyanide solutions. Do not mix with acid or expose to acid fumes. Keep ammonium hydroxide and ammonium salts away from gold drag-out rinses, gold plating and deplating solutions to insure against the formation of EXPLOSIVE gold fulminate.

Acetone - Observe safe handling procedure required for volatile and flammable solvent.

Venting - vent bath vapor into Vapor Exhaust System.

#### EQUIPMENT

- 1. Plating Tank, stainless steel type 304, LO gallon capacity,  $2L'' \times 18'' \times 2L'''$  deep set in water bath tank  $3L'' \times 2L''' \times 30''$  equipped with an 8 pass 3/L'' steam coil bottom mounted, automatic indicating thermostatic temperature control.
- 2. Power Supply: Rectifier stepless voltage control, 50 amp. 9V. capacity, equipped with an amperehour meter of 100 amp. capacity,  $1/\mu$  scale with totalizing dial.
- 3. Plating Barrel Daniels' 8H Plastic entire bottom fitted with 2 nickel plate as cathode.
- 4. Drag-out Tank Plastisol or Koroseal lined steel.
- 5. Rinse tanks stainless steel
- 6. Rinse baskets stainless steel
- 7. Anodes stainless, 18 8 grade.
- 8. Filter immersion type with impeller pump.
- 9. Warm Air Drying Unit Open rectangular tank, approximately 24" x 48" x 24" deep, air input into end supplied with steam heat coil, air filter and fan for clean flowing warm air drying.

#### MATERIALS

Gold Potassium Cyanide Solution
Technic Trushade, 24 kt. (50ml = 1 dwt)

Potassium Cyanide, 98%

KRO479

#### MATERIALS (CONTID)

Potassium phosphate, dibasic, Reagent (Dipotassium phosphate)
Potassium carbonate, Reagent
Acetone

KR01181 KR0478 KR04358

#### BATH COMPOSITION

Material	New Bath Content	Control Limits
Gold cyanide solution	17,700 ::1	8-9 dwt/:al
Potassium cyanide	160 -	3- or/gai rree;
Potassium phosphate		
(Dibasic)	160 oz	3 (. / 41
Potassium carbonate	16) oz	4-15 oz/gal
Deionized water to make	e up to $40$ gallons	500,000 ohms
		or greater

Operating temperature 145-155 F.

Anode to cathode area = 1:1

#### MAINTENANCE

- 1. Solution level maintain working of the plating bath 3 1/2 inches below top of plating tank by transferring solution from the drag-out rinse tank as required. Use deionized water for make up of drag-out rinse volume. Maintain fluid level in water bath plating tank jacket as required.
- 2. Maintain plating bath gold content by additions of Trushade gold concentrate solution based on ampere hours indicated on meter, confirming gold content by gravimetric analysis performed at intervals of one week. At the lower current densities with cathode efficiency at 70%, the replenishment would be 17 dwt. (850 ml Trushade gold concentrate solution) for each 5 ampere hours (20 meter untis) of plating. Five ampere hours of lating will reduce the gold centent of a 10 gallon bath from .5 dwt/gal. (midpoint of operating range) to 8.07 dwt/gal.

#### PROCEDUPE

- 1. Place specified number of precleaned parts into plating barrel barrel will have been preloaded where gold strike procedure SI 13700 RlP/1 is specified to precede this plating operation.
- 2. Turn rectifier switch to "on" position and set voltage control to approximate first step position. Turn barrel rotating drive on.
- 3. Insert loaded plating barrel into plating tank, contacting (with current on) the cathode contact in a minimum time.

#### PROCEDURE (CONT'E)

- 4. Immediately adjust voltage control for specified plating current.
- 5. Plate as specified time and current schedule.
- 6. Turn rectifier switch to "off" position.
- 7. Raise plating barrel to drain position and drain of excess solution.
- 8. Transfer loaded plating barrel to drag-out rinse tank and tumble rinse for 10 15 sec. Drain excess solution into drag-out rinse tank.
- 9. Transfer parts to stainless steel basket.
- 10. Rinse in cold deionized water for 15 30 sec.
- 11. Rinse in hot deionized water for 15 30 sec.
- 12. Rinse in hot deionized water for 15 30 sec.
- 13. Rinse in acetone for 10 15 sec.
- 14. Drain thoroughly and dry in warm air.
- 15. Remove from basket to storage and transport containers or to next process.

#### PROCESS SCHEDULES AND INSTRUCTIONS

See Parts Process Cards for precleaning and preprocessing schedules for additional processing.

See Plating Process Cards for specified number of parts per barrel load, plating current, plating time, and plating thickness.

See Tumbling Process Cards where tumbling procedures are called for in Parts Processing Cards.

#### LIMITATIONS

This gold plating bath is not designed to produce a bright plate deposit. Burnishing may follow plating where a bright finish is required as an external final finish on completed tube assemblies.

All rinsing is in flowing deionized water with agitation, except for drag-out and final acetone rinse.

#### RlP/l

#### GOLD STRIKE BARREL PLATING

#### PURPOSE

To provide an adherent gold strike plate on a nickel plated substrate upon which a heavier deposit of gold may be plated in a convential gold plating bath.

#### SAFETY

Plating Bath - observe safe handling procedures required in working with hot strongly alkaline cyanide solutions. Do not mix with acid or expose to acid fumes.

Vent vapors into vapor exhaust system. Large volumes of hydrogen are liberated at the cathode during plating with this bath; therefore, the vapor and spray produced must be vented into an exhaust system.

#### EQUIPMENT

- 1. Plating tank Plastisol or Koroseal lined steel  $24^{\circ}$  x  $24^{\circ}$  x  $16^{\circ}$  having a working volume of 36 gallons, equipped with a stainless steel heating coil and automatic temperature control.
- 2. Plating barrel Daniels' 8H Plastic equipped with a solid nickel plate covering entire bottom as cathode.
- 3. Anodes stainless steel, size and number as required to provide an anode equal to the cathode area. Equal anode area provided for each of 2 anode bars.
- 4. Rinse tanks stainless steel
- 5. Rectifier 50 amp., 12v
- 6. Filter immersion type with impeller pump.
- 7. Vapor Exhaust Venting System.

#### MATERIALS

- 1. Gold concentrate solution, technic
  24 kt. industrial (20 ml = 1 dwt)
  2. Potassium cyanide, 98%
  3. Potassium phosphate dibasic, keagent

  KR0479
- (Dipotassium phosphate (Dipotassium phosphate) KRO1181

#### BATH COMPOSITION

Material	New Bath Content	Control Ligits
Gold Concentrate Solution	720 ml	85-1.15 dwt/gal.
Potassium cyanide	23h cz.	4.3-6.5 oz/gal. (Free)
Potassium Phosphate		
(Dibasic)	112 oz.	2.1-3.1 oz/gal
Potassium Carbonate	None	15oz/gal. max.
Deionized water to make up to	36 gal.	500,000 onms resistance
		or greater

Operating Temperature 112-118 F.

Anode to Cathode area = 1:1

Current density - See Plating Process Card

#### MAINTENANCE

1. Maintain solution at working volume - at determined point approximately 2-2 1/2" below top of tank by addition of deionized water as required.

#### PROCEDURE

- 1. The specified number of parts to be plated are placed into the plastic plating barrel. Parts shall have been pretreated to insure that they are clean and free of any acid residues.
- 2. The loaded plating barrel is inserted into the plating tank with the barrel rotating drive running and the bath at operating temperature.
- 3. The rectifier is immediately turned on and set to the specified plating current.
- 4. Plate as specified current and time.
- 5. At the end of the plating cycle lift the plating barrel to the drain position and drain excess solution from parts.
- 6. Immediately transfer loaded plating barrel to cyanide gold plating bath (RIP) without intermediate rinse.

#### PROCESS SCHEDULES AND INSTRUCTIONS

- 1. See Parts Process Card for specified precleaning, plating and rinsing schedules.
- 2. See Plating Process Card for specified number of parts per barrel load, current density and time schedule.

#### LEGITATION

This hold trike bath AP/1 composition is compatible with the bath composition of Syanice Gold lating atm riP; therefore, the small amount of chemicals carried over, as drag-out, into Gold dating tath PI' will do no norm. Mosever, this strike bath small not be used, without inter eliaberinsing, in continuous.

The plating bath control limit of 15 oz/gal, maximum set for potassium carbonate is an estimated value. The actual concentration limit must be determine through additional operating experience.

#### REA/SCR-1

#### BARREL FINISHING

#### PURPOSE

This method is used for depurring, cleaning, descaling and for surface refinement of most metals.

#### EQUIPMENT

Closed polygonal (vertical) barrels lined with neoprene, or its equivalent Bins for storing tumbling media.

Stainless steel graduated scoop (4 cup).

Glass bottle, graduated in cunces (4 oz.)

Suitable loading and unloading equipment.

Stainless steel mesh screens and vibrating equipment.

#### MATERIALS

Alumina chips, (Lord Chemical Company), sizes #1, 3, 4, 8, 12 and special sizes, (#1 is the largest)

Compound	<u>Use</u>	Cutting Life Of Compound (Hrs.)
ſτX	Fine abrasive for light burrs and low micro-inch finishing	2-4
3A	Fast cutting during life, then a gradual breakdown to polishing action.	3-6
6A	Same as 3A, but a coarser abrasive	3-6
HS-9	Same coarseness as 6A but used especially for hard metals. Will breakdown to fine polishing action in 20-24 hours.	6-10
24-48	Alumina - used for cleaning caramics (Norton Company)	0-10

Cleaning compounds (Lord Chemcial Company).

- a. GW (neutral)
- b. MC-3 (alkaline)

Finishing and burnishing compound (Lord Chemical Company)

- a. Cap (for copper and lead)
- b. Hi-Brite (other metals except nickel)
- c. DL (for nickel)d. AP2X (Copper and lead)

Descaling compound (Lord Chemical Company)

DL (for oxide removal)

Steel burnishing pins (Hartford Steel Ball Company) 1/16" diameter x 1/4" long tapered on ends.

#### MATERIALS (CONTIL

Steel burnishing comes (Hartford Steel Ball Company)
1/8" double comes

hust preventatives

- a. Mireral oil (Esso-Fractol A)
- b. Watershed (Heatbath Corporation)

Acetone

#### PROCEDUPE

1. Alumina chip-media are washed by tumbling with hot water and 1 to 4 oz. GW for 5 minutes. (if necessary)

- 2. Media is rinsed well with warm water.
- 3. Parts to be tumbled are added so that the total load of parts and media will settle to 50-60% of the barrel volume during tumbling.

Note: a. Fragile parts must be handled with care to prevent distortion during loading and unloading - may require alternate loading of parts and chips in layers.

- b. Geometry of the parts will determine the initial height of load.
- c. To prevent damage to heavy parts during tumbling, select or add a larger size of chips.
- 4. The amount and type of abrasive compound to be used is added based on experience.
- 5. Tap water is added to desired level usually 1 to 6 inches below load level. Abrasive action increases as water decreases.
- 6. Barrel is closed and rotated at desired rpm. Decrease the speed of rotation as mass and/or fragility of individual parts increases. Time and rpm. must be based on experience normally 8-25 rpm. for cu. ft. barrel and 20-60 rpm. for l cu. ft. barrel.
- 7. Barrel contents are rinsed well with water.
- 8. For copper and lead: CAP is added for cleaning and finishing.
  - a. Tap water is added to load level.
  - b. Barrel is closed and rotated at desired rpm. for 1 hour.
  - c. Barrel contents are rinsed well with water, the load is dumped with care, and parts spearated from chips by screening or vibrating equipment.
  - d. Parts are rinsed in acetone and blown dry.
- 9. For all other metals: Add MC-3 for cleaning.
  - a. Hot tap water is added to load level.
  - b. Parrel is closed and rotated at desired rpm. for 10-30 min.
  - c. Barrel contents are rinsed well with water.

of (.

ace

ivalent.

#### PROCEDURE (CONTID)

- 10. Operation 9 is followed with a brightening or burnishing process:
  Add Hi-Brite compound.
  - a. Tap water is added to cover the load with 1 to 2" of water.
  - b. Barrel is closed and rotated at desired rpm. for about l hour.
  - c. Barrel conterts are rinsed well with water, the load is dumped with care and parts separated from chips by screening or vibrating equipment (except steel and nickel).
  - d. Parts are dried in Kreider Dryer.

#### 11. For steep parts:

- a. Operations 10, 10a, 10b are performed.
- b. Barrel contents are rinsed well with water.
- c. Water is added to load level.
- d. Watershed is added.
- e. Barrel is closed and rotated at desired rpm. for 10 min.
- f. Water is drained from barrel.
- g. The load is dumped with care and parts separated from chips by screening or vibrating equipment.
- h. Parts are dried thoroughly in Kreider Dryer.
- i. Parts are dipped with agitation, in rust preventing mineral oil and drained,

#### 12. For nickel parts:

- a. Operations 10, 10a, 10b are performed.
- b. Barrel contents are rinsed well with water.
- c. Water is added to cover load.
- d. DL is add.
- e. Barrel is closed and rotated at desired rpm. for 1/2 to 2 hours.
- f. Barrel contents are rinsed well with water.
- g. The load is covered with clean water, the barrel is closed and tumble rinsed for 5 minutes.
- h. Step 12f is repeated, then load is dumped with care and parts separated from chips by screening or vibrating equipment.
- i. Parts are rinsed well with clean acetone and blown dry.

#### bbe calification (Normalia)

Lord ham, ic pound	Abl. #1 3/4 ft.3	<del>-</del>	Fbl. 3: 7 1/2 ft. <sup>3</sup> Amount-(cups)
4X	<u>.</u>	15	1(
ÄE	$\vec{1}$	4 1/2	5
6A	1	$l_1$	5
HS -9	Ĩ	5	7
N-3	1/4	1 1/2	î
Hi-Brite	1/2	3 1/2	_
CAF	1/2	j 1/2	5
AP2X	3 oz	22 oz	3. 02
G' (liq.)	l oz	4 oz	6 <b>o</b> z
LL (liq.)	5 oz	24 oz	32 cz
Watershed 'lic	1 1/2 or	, oz	32 -
Heatbath Corp.	•		

#### PROCESS CONTROL

Barrels and chip-media should be kept clean and sharp of periodic p min. runs with hot water and p. Intervals will vary with the application. Chips should be screened to insure proper size, especially if wedges of chips are likely to occur.

Mixing of compounds in a water slurry may be necessary with tubing or shells up to 3/8" inside diameter, to prevent packing of compound in the inside diameters.

Use hot water with 10-3 and GW.

Do not use W as a final rinse on steels, since it is a wetting agent Never leave a DL charge in the barrel when the barrel and parts are stopped; it may spot soft steels when not in motion.

#### SAFETY

Locsen door clamps slowly with care to "bleed" pressure which has built up during tumbling.

L solution is phosphoric acid, essentially; handle with care and avoid contact between it and cyanide.

APPENDIA

Se	rial	Number	

### MANUAL OF INSPECTION AND QUALITY CONTROL PROCEDURES COVERING ELECTRON TUBE TYPE 6299

Order Number 6008-PP-61-81-81

Contract Number DA-36-039-SC-85953

General Electric Company
Electronic Components Division
Tube Department
Owensboro, Kentucky

E.L. Davis

E. L. Davis, Superintendent- Planar & Thyratron Production

J. L. Finney, Supervisor-Test & Quality Control

J Emailin

J. E. Martin, Supervisor-Process Engineering - Planar & Thyratron Production

Date lesued	Supercedes	Section	Page
August 7, 1964	New		ii

#### DISTRIBUTION:

U

I

Y

C

N

T

R

OL

M

A

N

U

A

Initial distribution of this manual is shown below:

#### GENERAL ELECTRIC COMPANY:

Serial No.	Holder
1.	C. E. Albrecht
2.	J. D. Campbell
3	E. L. Davis
4.	W. R. Elliott
5.	J. L. Finney
6.	J. F. Madole
7.	J. E. Martin
8.	H. L. Thorson
9	R L Watson

#### U.S. ARMY ELECTRONICS MATERIEL AGENCY:

Serial No.	Holder
10.	George C. Munger, Contracting Officer
11.	George C. Munger, Contracting Officer
12.	George C. Munger, Contracting Officer
13.	Stanley A. Sokolove, Project Engineer
14.	Stanley A. Sokolove, Project Engineer

I

Y

N

T

R

0

M

A

N

U

#### CONTROL:

This manual is unclassified with respect to military security, but is considered to be Company and Army confidential in accordance with SIG 434 SIP 3016 (SPL), Exhibit II, Paragraph 2b.

Obsolete or revised material should be destroyed by the holder.

For additional copies of this manual, contact: Manager, Engineering Administration and Application Engineering, General Electric Company, Tube Department, Owensboro, Kentucky.

#### TUBE DEPARTMENT

## GENERAL DELECTRIC

Owensbere, Kentucky

Date Issued	Supercedes	Section	Page	
August 7, 1964	New		ıii	

#### TABLE OF CONTENTS

L I T

Y

С 0

N T R O L

M

N U A

L

SECTION I	Pages
Introduction	I- 1
Organization Charts	I-2 through I-15
General	I-16 through I-21
SECTION II	
Flow Chart, 6299	II-1
Receiving Materials Inspection	II-2
Cathode Assembly	JI- 3
Coated Cathode and Insulator Assembly	II-4
Heater and Cathode Assembly	II-5
Grid Making	II-6
Grid Assembly	II-7
Preseal Assembly	II-8
Anode Assembly	II-9
Exhaust and Sealing	II-10
Aging	II-11
Plating	II-12
Acceptance Tests	II-13
Commercial Service and Warehouse	II-14 through II-15
SECTION III	
List of References	III-1
Exhibits 1 through 23	

Date Issued	Supercedes	Section	Page
August 7, 1964	New	I - INTRODUCTION	I - 1
	والمنازل والمنازل والمنازل المنازل والمنازل والمنازل والمنازل والمنازل والمنازل والمنازل والمنازل والمنازل	المراقع	

#### INTRODUCTION

The electron tube type 6299 is a high-mu metal and ceramic triode intended for operation as a grounded-grid class A radio-frequency amplifier at frequencies as high as 3,000 megacycles. Features of the tube include small size, planar electrode construction with close spacing, inherent rigidity, and an envelope structure convenient for coaxial circuit applications.

The purpose of the contract was to evaluate certain areas of advanced tube manufacturing techniques and to apply them where feasible to JAN 6299, resulting in a more reliable and better performing tube. The objective requirements for the improved tube are Signal Corps Technical Requirement SCS-90 (Improved JAN 6299) and operation at a tube temperature rating of 225°C. The areas investigated were:

- 1. Improved alignment, concentricity and ceramic strength.
- 2. Improved anode to ceramic seal.
- 3. Temperature control at exhaust.
- 4. Improved application of cathode coating.
- 5. Improved cathode mounting.
- 6. Improved processing for higher temperature operation.
- 7. Improvement in humidity testing.
- 8. Improved exhaust fixturing.
- 9. Extended life test and tube failure analysis.

QUALITY

CONTROL


M A N U A

L


#### EFECLBIC CENEB

Owenshore, Kentucky

٤ -

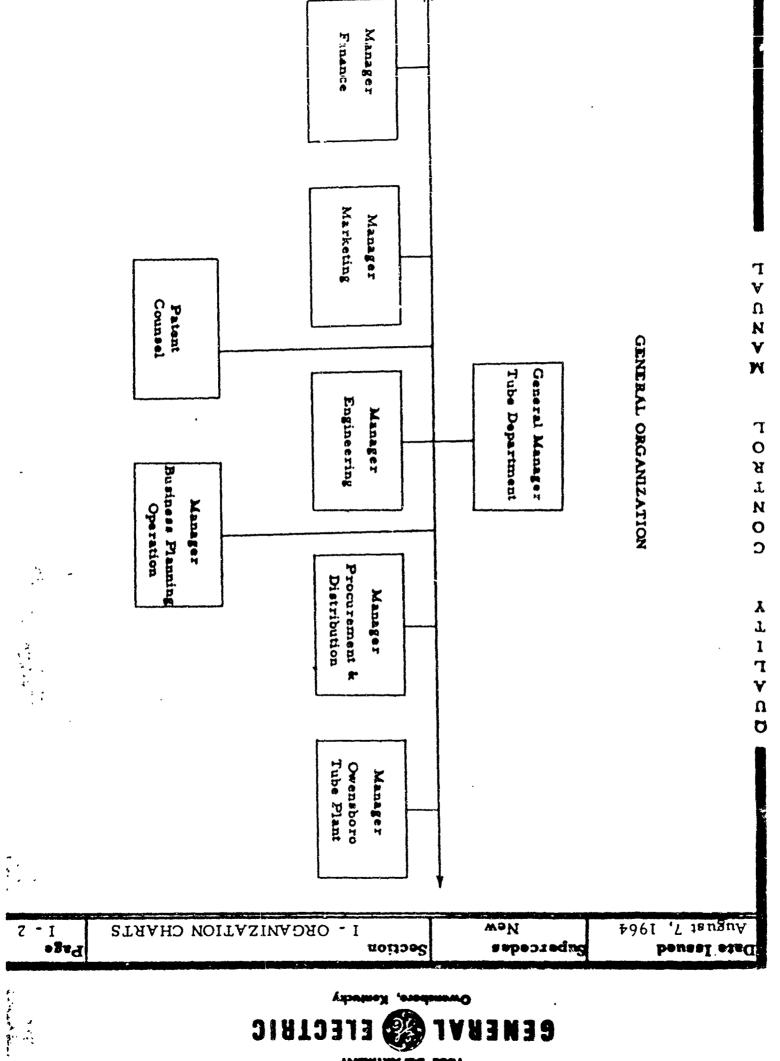


Page I - 3

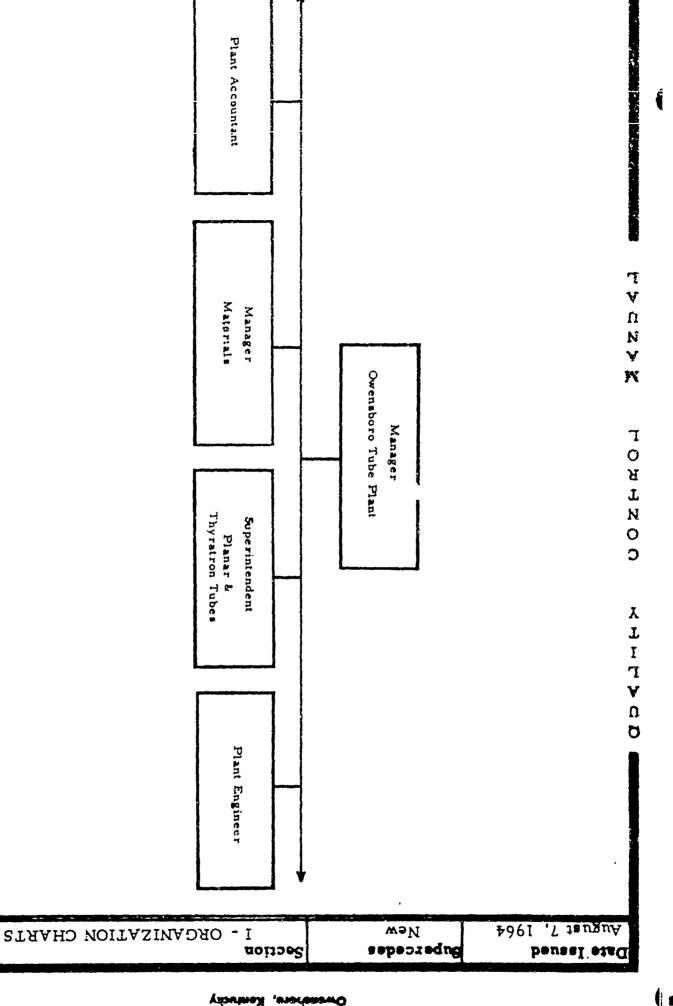

**Page** 1 \_ 4

#### ELECTRIC CENEBYF


Owensbers, Kentucky

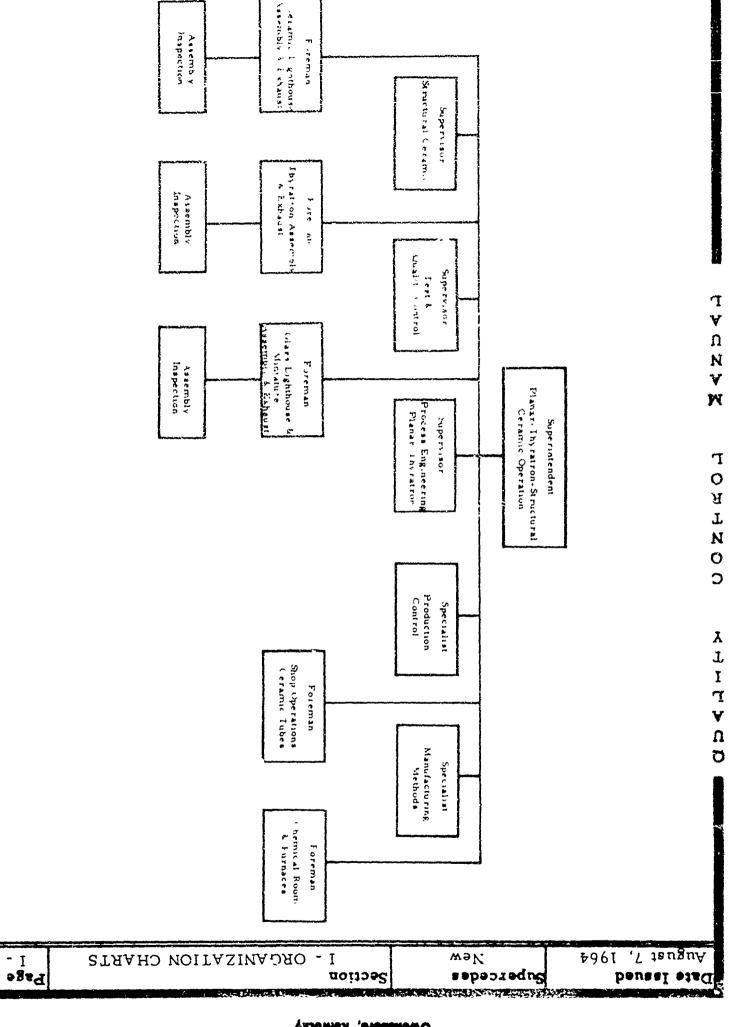


THEMTRASS SEUT

### GENERAL 🚳 ELECTRIC


Owensbere, Kentucky

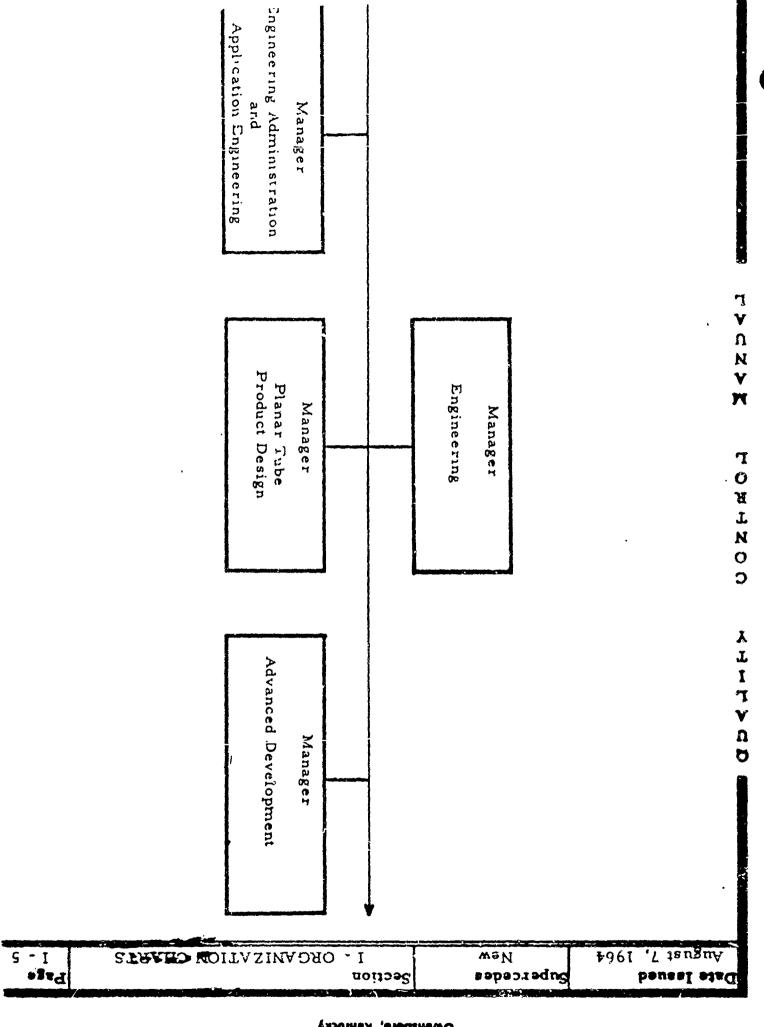

# GENERAL ELECTRIC

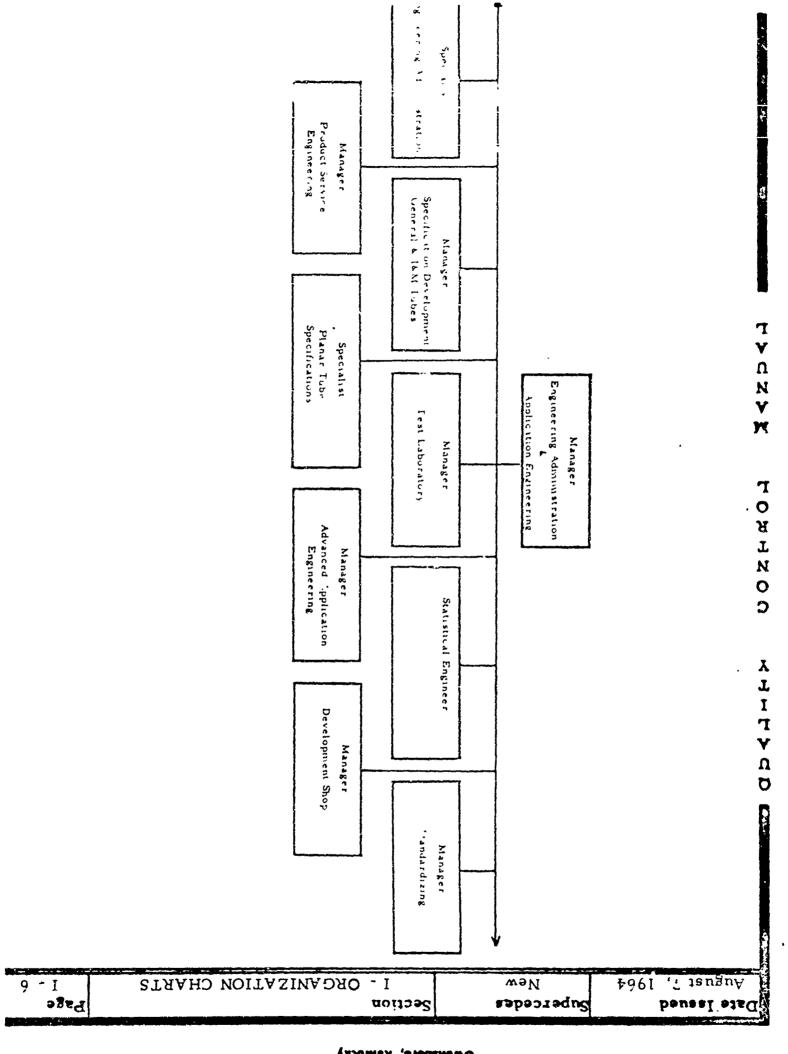

l

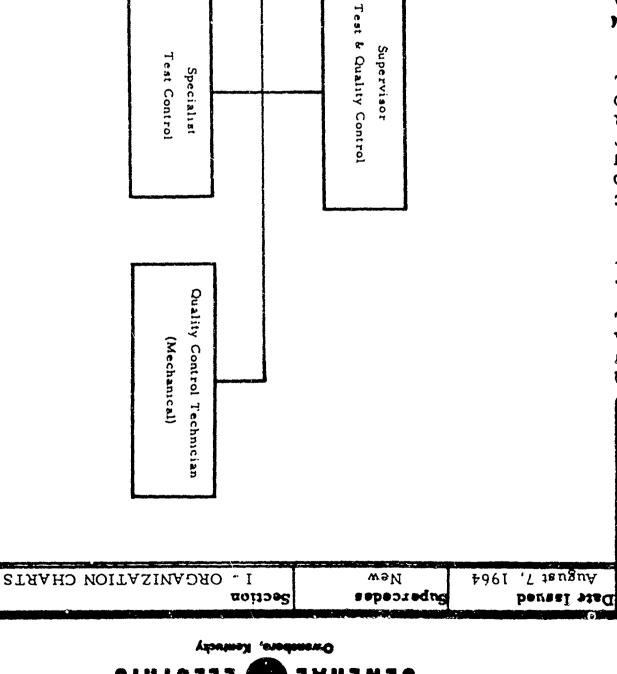

Supervisor

YUUAA

M

7

CONTRO

QUALITY

ELECTRIC CENEB

THIMITAL BOUT

Test & Quality Control Foreman


Specialist

Page I

THEMTRASSO SEUT

### GENERAL 🚳 ELECTRIC


Owenshore, Kentucky

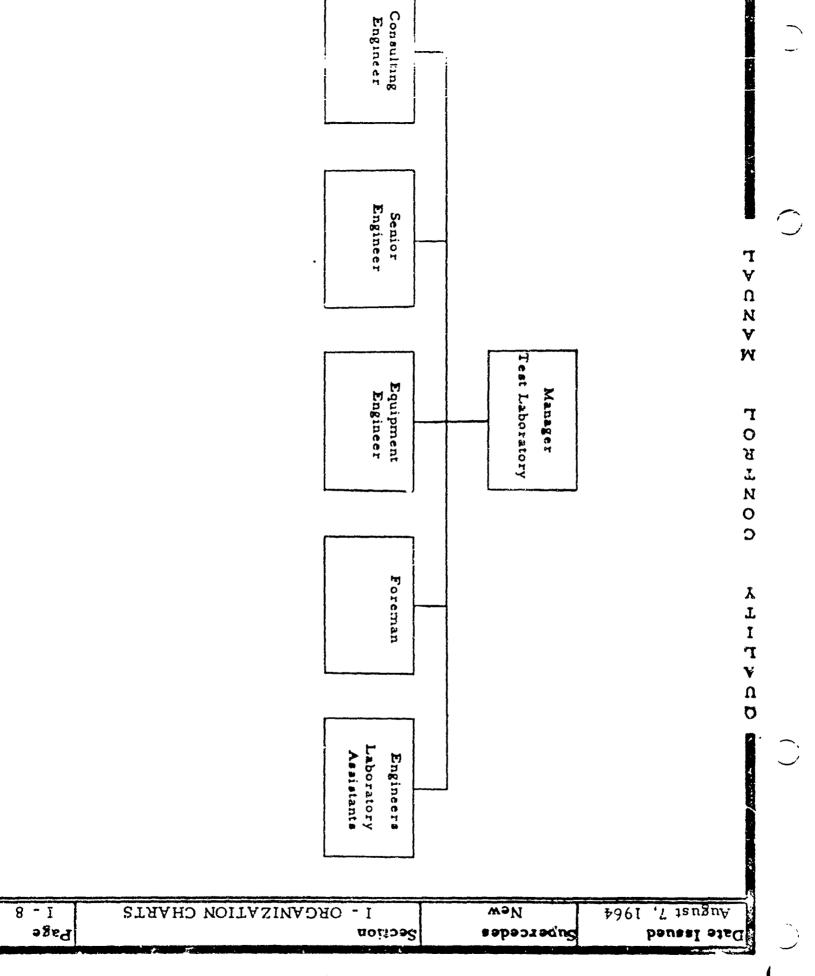

weN .

a abaor equi

ELECTRIC

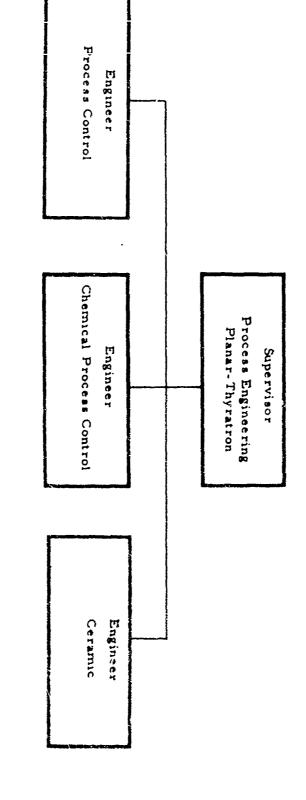

T N N W

г 0

CONTR

QUALITY

4961 ,7 18uguA

Densel etsa

01

Section

I - ORGANIZATION CHARTS

6 - I

Page


THE DEPARTMENT

# GENERAL 🚳 ELECTRIC

Swembere, Kentucky


0I - I

Page

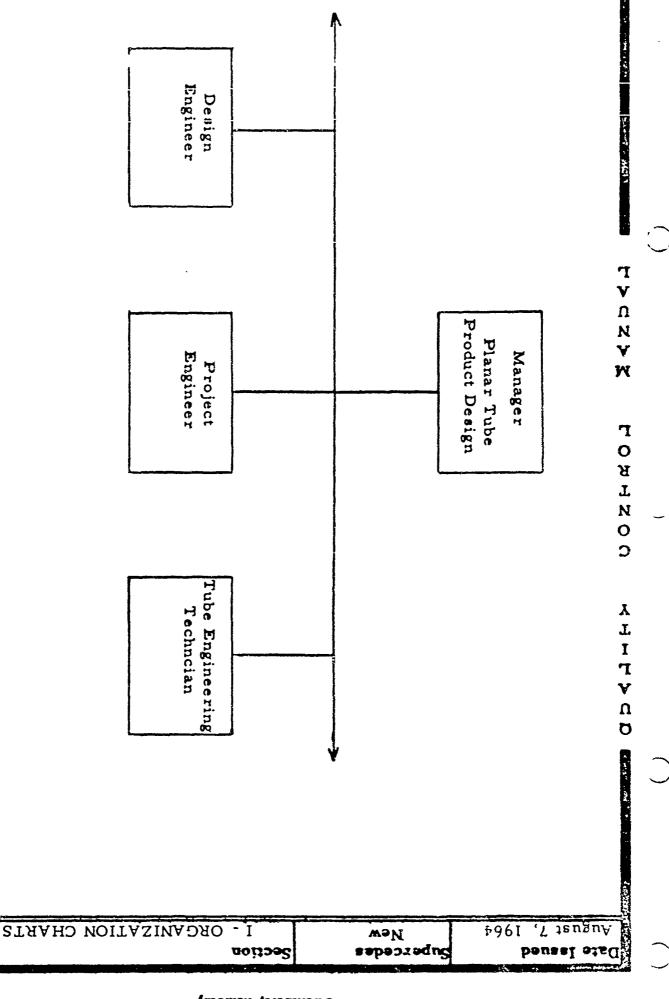




1-15

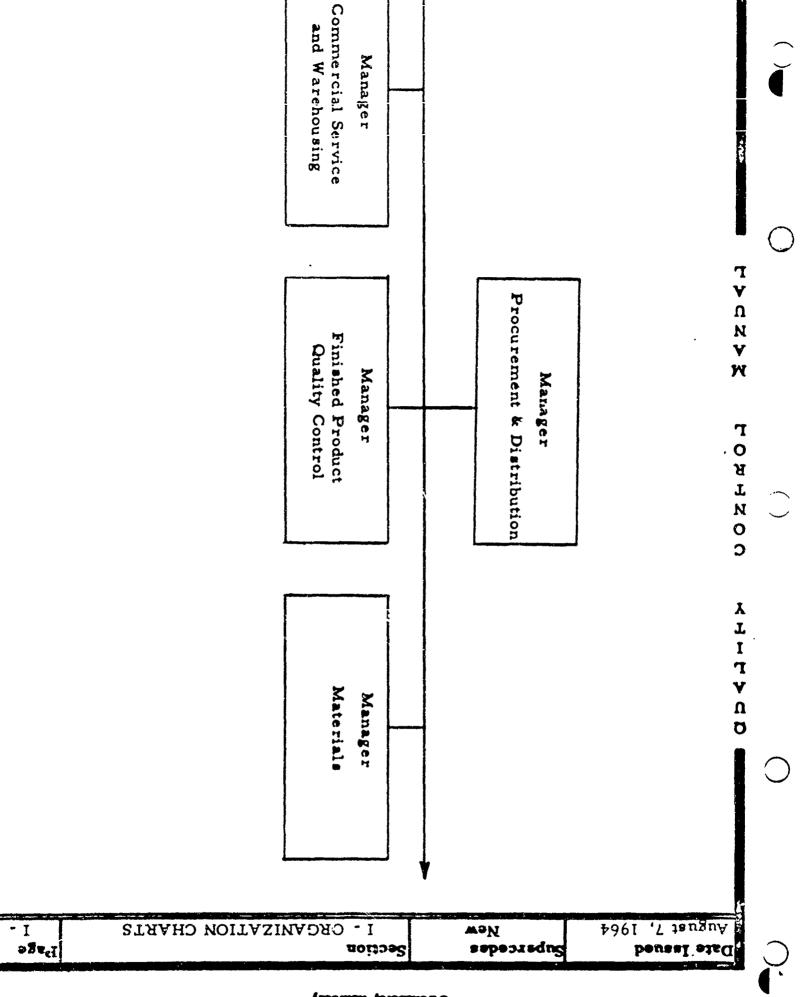



# GENERAL 🚳 ELECTRIC


Owenshore, Kentecky

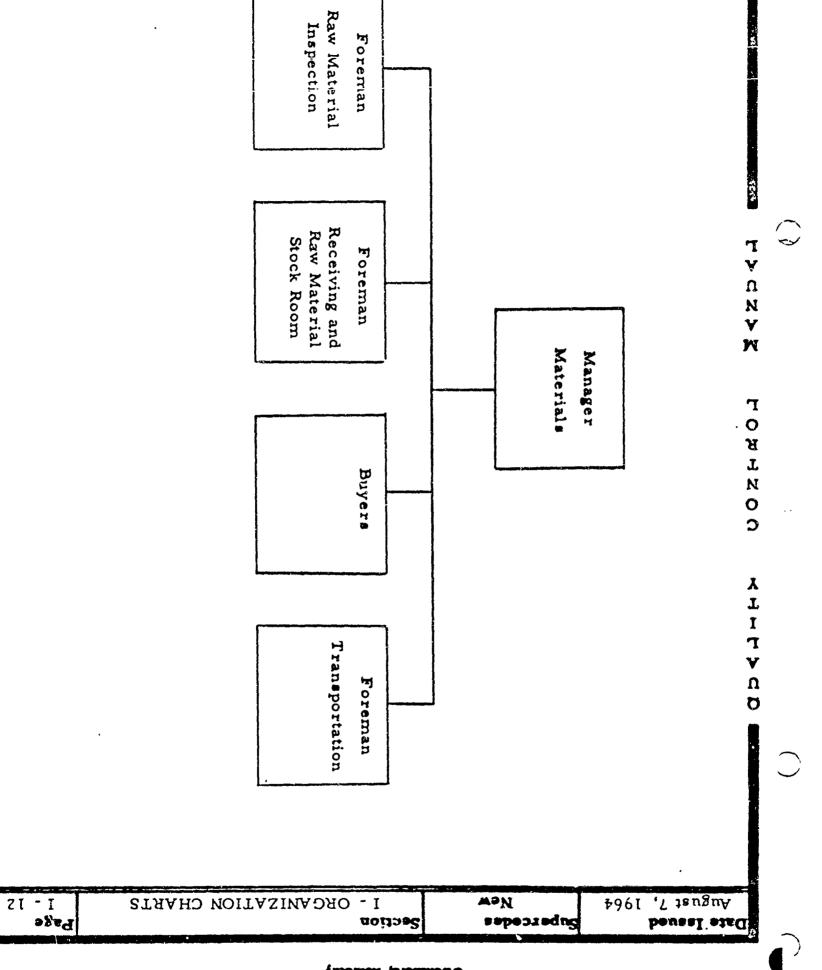

3

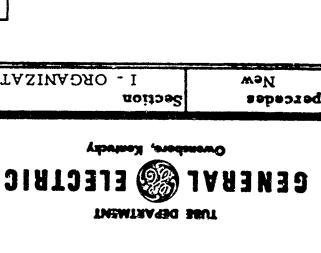

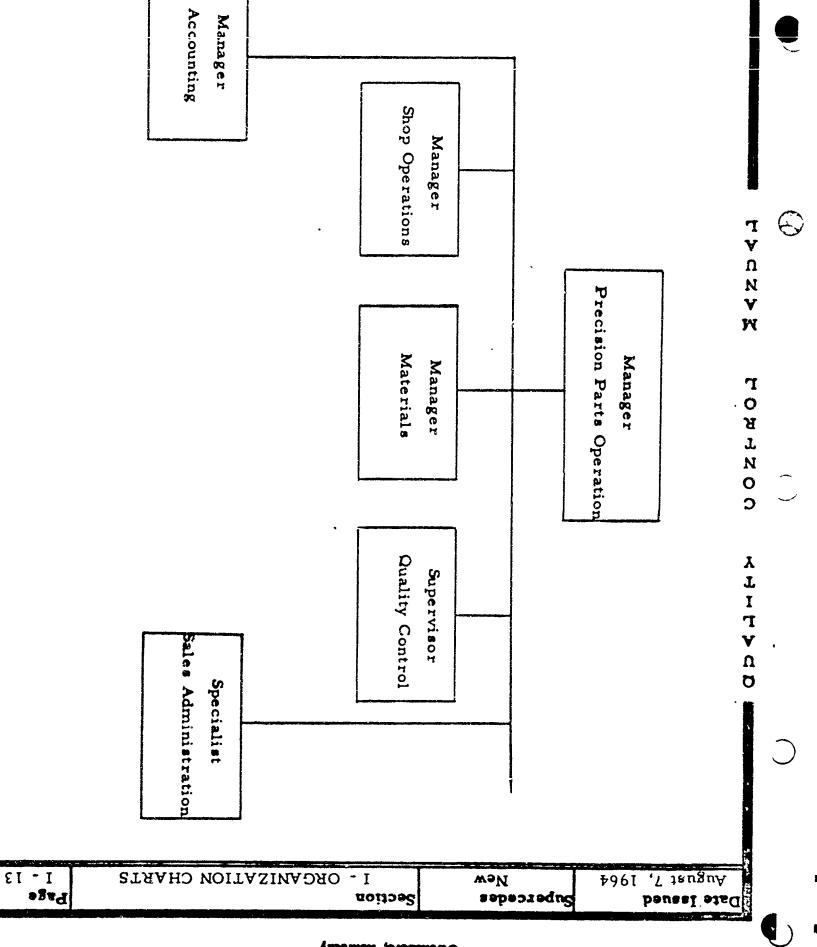


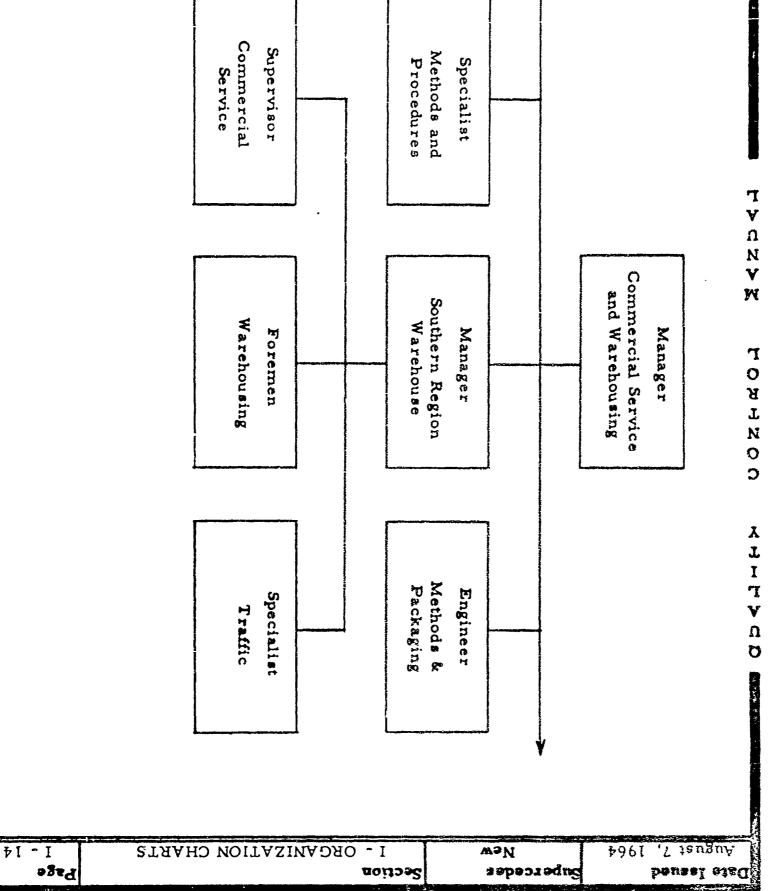

### GEKERAL 🚳 FLECTRIC

Owenshers, Kentucky

L I I

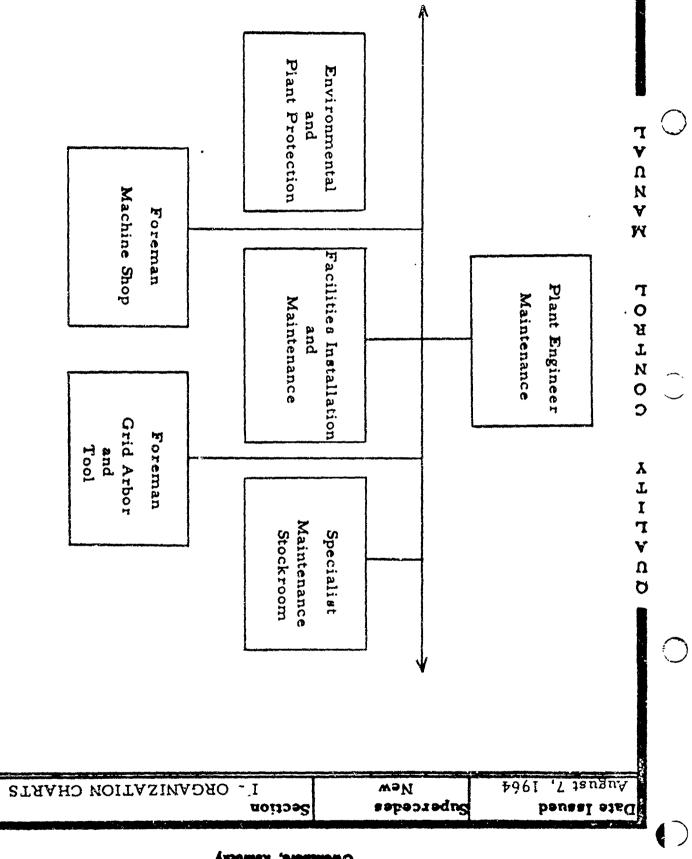

QUALITY

CONTROL

MANUAL

M



Date Issued	Supercedes	Section	Page
August 7, 1964	New	I - GENERAL	I - 16

#### GENERAL NOTES

- I. QUALITY CONTROL DATA FEEDBACK AND ANALYSIS
  - A. Fest records from the Engineering Test Laboratory and Test and Quality Control are fed back to process engineering and management for product control.
- II. TEST EQUIPMENT
  - A. Each section is responsible for the maintenance and calibration of its test equipment.
- III. TOOLS AND GAGES
  - A. Each section is responsible for the maintenance and calibration of the tools and gages used within the section.
- IV. ENGINEERING CONSTRUCTION AND TEST SPECIFICATION CHANGES
  - A. Alteration Notices (AN's) and Temperary Alteration Notices (TAN's) on construction and test specifications are issued, and controlled by a positive integrated system as covered in Department Instruction #7.1-8 (Classification Engineering).
- V. TUBES REQUIRING MILITARY QUALIFICATION INSPECTION
  - A. When it is necessary to have samples available for "In-plant" qualification testing the Engineering Administration Section is responsible for:
    - 1. Securing the necessary data;
    - 2. Testing tubes in the Engineering Test Laboratory and Finished Product Quality Control;
    - 3. Writing design and construction information;

Date 1	EBUSC	!		Supercedes	Section		Page
Augi	et 7,	196	4	New	_	I - GENERAL	I = 17
			4.	Obtaining cons	truction ph	otographs;	
			5.	Informing the	Quality Ass	surance Representative	e in Charge
				when "In-plant	qualificat	tion testing is requeste	ed;
			6.	Making arrang	ements wit	h the $\Omega$ uality Assurance	e Representative
				in Charge to w	ritness "In-	plant" tests when such	tests have been
				authorized by	proper auth	ority;	
			7.	Preparing the	qualificatio	on test report.	
		в.	$Th\epsilon$	Project Engine	eer is respo	onsible for supplying E	Ingineering
				· ·	-	ohic samples and up to	
			tion	n details.			
	VI.	IND	UST	RIAL SECURIT	Y		
		A.	The	e plant Security	Officer is	responsible for mainte	nance of
			ind	ustrial security	and, where	e required, military se	ecurity.
7	VII.	MII	LIT A	RY COGNIZANO	CE		
		A.	Qua	ality assurance	cognizance:	(U.S. Army), Cincin	mati Procure-
			me	nt District, U.S	5. Army, 55	50 Main Street, Federa	al Office
			Bui	lding, Cincinna	ti 2, Ohio.		
		В.	Sec	urity cognizanc	e: (U.S. N	avy), Inspector of Nav	al Material,
			430	0 Goodfellow Bl	vd., Buildi	ing 101, St. Louis 20,	Missouri.
		c.	C	stract auditing o	ognizance:	(U.S. Air Force), Ci	ncinnati Air
		<b>.</b>	501	•	•	con Smitt Building Of	

C. Contract auditing cognizance: (U.S. Air Force), Cincinnati Air Procurement District, 3rd Floor, Swift Building, 9th and Sycamore Streets, Cincinnati 2, Ohio.

## VIII. RESPONSIBILITIES OF ENGINEER - PROCESS CONTROL

1. Analyze shrinkage, cost and quality information and determine objectives which are consistent with the broad function of supplying engineering direction.

17

ve

IJ

T Y

C

O N

T

R O

L

M

A N

U

A

<b>Date Issued</b> August 7, 196	Supercedes 4 New	Section  I - GENERAL	Page
3	Danmard to show		
2.		and long range plans for improvements a and quality and manufacturing processe	-

manner.Organize the available resources of equipment, personnel, and other factors at his disposal to efficiently obtain his objectives.

Organize own work and time in the most efficient and effective

- 6. Direct efforts toward the manufacture of products mat meet engineering specifications and which are competitive in quality and costs.
- 7. Provide manufacturing with timely, accurate and effective instructions for reducing costs and improving product quality.
- 8. Pursue a program of self-development and contribute to the technical education of others within the department.
- 9. Provide engineering leadership within the plant by contributing new and/or original ideas for solving problems associated with manufacturing.
- 10. Implement plans for and continuously maintain an aggressive shrinkage and over-all manufacturing loss reduction program and institute corrective measures as deemed necessary.
- 11. Responsible for working with Design Engineering regarding process, specification and production problems. Recommend manufacturing processes and contribute whenever possible to the design of new tubes.
- 12. Set up techniques for following product quality and initiate corrective measures as deemed necessary.

1		PROPERTY AND RESIDENCE PROPERTY.		أأكر بالمراطيبي والمراطات
1	Date lesued	Supercades	Section	Page
١	August 7, 1964	New	I - GENERAL	I - 19
7				

- 13. Initiate inspection standards for incoming parts and in-process production and evaluate sample parts from vendors; and is responsible for determining the necessity for and the extent of process controls and inspections.
- 14. Analyze, appraise and interpret the measured results of work done and make known and readjust work of measuring as necessary.
- 15. Maintain records and reports to indicate the effectiveness of his work.
- 16. Consult the Supervisor Manufacturing Engineering regarding matters of importance in his area of responsibility or of any matter that affects the relationships with others.
- 17. Confer with other Engineers, and Specialists in his subsection regarding related problems.
- 18. Consult with other subsection personnel as required to fulfill his duties and responsibilities.

F

C

I

N

U

19. Consult with other engineering and manufacturing components as needed regarding problems in his area.

### IX. IDENTIFICATION OF REJECTED MATERIAL

U

I

Y

C

O N

T

R

0

L

M A

N

U

A. Rejected material, in Shop Operations, Ceramic Tubes, is tagged, analyzed and scrapped.

## X. STANDARDS CALIBRATION PROCEDURE AND SCHEDULE

- A. Primary standards are in general checked once a year by a laboratory traceable to the Bureau of Standards.
- B. The primary standard for measuring voltages and currents is a standard cell and is calibrated as per "A" above.

I - GENERAL

- The secondary standards are meters calibrated by using the standard cell. This is done approximately every 3 months.
- D. Meters are calibrated periodically against the secondary standards. Meters are tagged with their date of calibration. All removable meters are calibrated monthly. The permanently located meters are calibrated every 90 days with an additional calibration at seasonal changes, such as summer to winter, and in the event of any question on results.

#### XI. INSPECTION NOTES

The first phase of this contract specifies a production rate of 1000 tubes per month. In-process inspection is accomplished by trained operators in a bench inspection set-up under the Foreman-Glass Lighthouse & Miniature Assembly and Exhaust, under the surveillance of the process engineer.

The following additional information is presented:

- I. Reference Documents are:
  - Standardized construction drawings for type 6299.
  - Standardized process specifications for type 6299.
- II. Changes in parts, tolerances, limits, processing instructions, and inspection procedures are authorized by Engineering TAN's or AN's.

ซ 1 T Y

> C 0

> N

Ţ R

0

L

M A N U

Q U

ALITY

C

0

N

T

R

0


L

M

A

M

U A

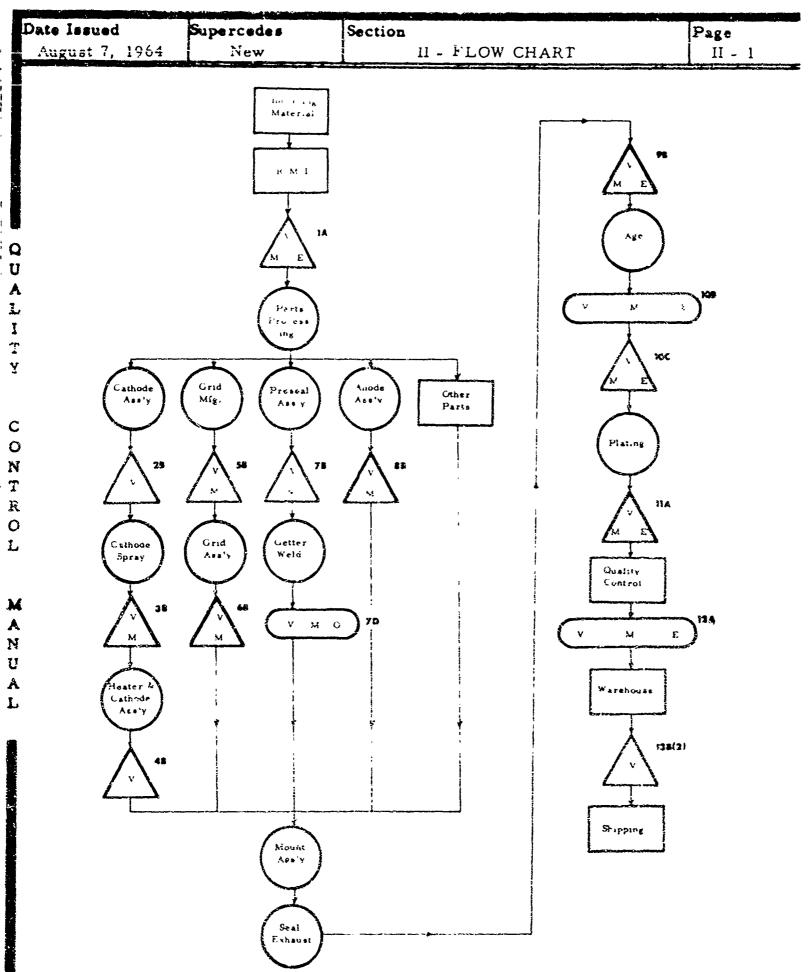

Date Issued	Supercedes	Section	Page
August 7, 1964	New	II - QUALITY CONTROLS	II - 2

# INSPECTION STATIONS

# 1. RECEIVING MATERIALS INSPECTION

1

T

Y

C

O

N

T

R

0

L

M

A N

U

- A. Process: Collect, inspect, and distribute incoming parts and raw materials.
  - (1) Inspection Procedure: Incoming stock is identified according to purchase order or contract. Material is sampled in accordance with internal inspection specification, (see index). Visual and mechanical inspection is performed in accordance with this specification. Material is either accepted to stock or returned to supplier.
  - (2) AQL's and sample sizes: Inspection specification, (see index).
  - (3) Clastification of defects: Inspection specification, (see index).
  - (4) Calibration of test equipment Calibration is conducted in accordance with TM-100.
  - (5) Reference document: Inspection specification index, and TM-100.
  - (6) Changes in parts, tolerances, limits, etc., are authorized by:
    Alteration Notices or Temporary Alteration Notices originated
    by the Process Control Engineer.
  - (7) Changes in inspection procedures are authorized by: Process Control Engineer.
- B. Exhibits: Section III, exhibits 1 through 9.

QUALITY

CONTROL

M A N U A C

ONTROL



	والمساوات والمساوات والمساوات		
Date Issued	Supercedes	Section	Page
August 7, 1964	New	U - QUALITY CONTROLS	II - 3

- 2. CATHODE ASSEMBLY
  - A. Cathode Assembly Process
  - B. Inspection Procedure
    - (1) After cathode assembly, cathodes are inspected under a 10X microscope.
    - (2) AQL's and sample sizes: 100% inspection.
    - (3) Classification of defects: Burrs, torn, malformed foil.
    - (4) Inspection instruments: 10X microscope.
    - (5) Forms used: Miniature Ceramic Shrinkage Report, Exhibit #10;

Route Process card, Exhibit #11 is a sample of this type of card.

	Date Issued Supercedes Section Page					
-	te lesu		64	Supercedes New	Section II - QUALITY CONTROLS	Page II - 4
	3.			O CATHODE ANI	D INSULATOR ASSEMBLY	
		В.	Insp	ection Procedur	·e	
Q			(1)		nsity is checked each run;	
U					ight is checked after milling cathode:	
A L					de is inspected under a microscope for v	isual
I			( 2 )	defects.		
T Y			(2)	AQL's and sam		
					l cathodes are checked for density;	
С				b. 100% inspec		
O N			(2)	c. 100% inspec		
T			(3)	Classification o		
R O				a. Density, hi		
L					ight, high or low;	
			(4)		ode; chipped or insufficient coating.	
M			(4)		uments: 10X microscope, dial gauge, ba	dance
A N			(5)		dummies (control cathodes).	_
บ			(5)		xhibit #10; Exhibit #11; Cathode Assemb	oiy
A				Shrinkage Repor	rt, Exhibit #12.	

QUALITY

C O N T R O

L

M

ANUAL

C

ONTROL



Date Issued	Supercedes		Page
August 7, 1964	New	II - QUALITY CONTROLS	II - 5

- 4. HEATER AND CATHODE ASSEMBLY
  - A. Assembly Process
  - B. Inspection Procedure
    - (1) After heater is welded into coated cathode and insulator assembly, a 10X microscope is used to inspect heater coating, weld and cathode face.
    - (2) AQL's and sample sizes: 100% inspection.
    - (3) Classification of defects: Open or weak welds, chipped heater coating, cathode coating chipped or dirty.
    - (4) Inspection instruments: 10X microscope.
    - (5) Forms used: Exhibits #10 and #11.

1	Date Issued	Supercedes	Section	Page
	August 7, 1964	New	II - QUALITY CONTROLS	II - 6
1				

## 5. GRID MAKING

1

T

Y

C

0

N

T

R

0

M

N

- A. Grid Manufacturing Process
- B. Inspection Procedure
  - (1) After winding, grids are placed under a 10X microscope, inspected and trimmed.
  - (2) AQL's and sample sizes: 100% inspection.
  - (3) Classification of defects: Windows, copper balls, poor spacing, overlapped wires.

U

ĭ

T

Y

C

0

N

T

R

0

M

N

Ū

- (4) Inspection instruments: 10X Binocular microscope.
- (5) Forms used: Exhibits #10 and #11.

Date Issued	Supercedes	Section	Page
4 August 7, 1964	New	II - QUALITY CONTROLS	<u>II - 7</u>

6. GRID ASSEMBLY

T

Y

C

0

N

T

R

0

M

- A. Assembly Process
- B. Inspection Procedure
  - (1) All grids are inspected with a 10X microscope for visual defects.

    Grids are then checked for vibration.
  - (2) AQL's and sample size: Visual inspection 100% inspection.

    For vibration, lots sizes to 300 are sampled using MIL-STD-105,

    Level II, 2.5% AQL; for lot sizes over 300, 1.0% AQL.
  - (3) Classification of defects: Windiws, copper balls, poor brazing, poor spacing, overlapped wires, lint and dirt, poor tension on wires.

(

ħ

T

R

C

L

- (4) Inspection instruments: 10X microscope, vibration equipment.
- (5) Forms used: Exhibits #10 and #11.

Date Issue	id	Supercedes	Section	Page
August 7	1964	ivew	II - QUALITY CONTROLS	8 - II
. 7.		AL ASSEMBLY seal Assembly Pro	ocedure	
	•	pection Procedure  a. Assemblies a	ve inerested under a 10Y misroscope	
Q U A	(1)	b. After preseal	are inspected under a 10X microscope.  Lassembly and braze, assemblies are likers with helium leak detector.	
L I T Y	(2)	AQL's and sample a. 100% inspecti		
c	(3)		Defects	
O N T	(4)	b. Leakers.	embly, poor solder flow.	
r O L	(4) (5)	Forms used: Exh	nents: Helium leak detector, 10X micraibits #10 and #11.	oscope.
M A	C. Geti	ter welding proces	s	
A N U A L		er the getter has be	een welded, the operator makes a check	(for

QUALITY

CONTROL

M A N U A L

Date Issued	Supercedes	Section	Page
August 7, 1964	New	II - QUALITY CONTROLS	II - 9

8. ANODE ASSEMBLY

C

0

N

- A. Anode Assembly Process
- B. Inspection Procedure
  - (1) a. After anode assembly and braze, assemblies are tested for leakers with helium leak detector.
    - b. Assemblies are inspected under a 10X microscope for visual defects.

T Y

0

N

T

R

U

- (2) AQL's and sample sizes:
  - a. 100% inspection.
  - b. 100% inspection.
- (3) Classification of defects:
  - a. Leakers.
  - b. Anode not seated; burred, defaced anode.
- (4) Inspection instruments: Helium leak detector, 10X microscope.
- (5) Forms used: Exhibits #10 and #11.

Date lesue	ed .	Supercedes	Section	Page	Date
August 7,	196		II - QUALITY CONTROLS	II - 10	Aug
. 9.		HAUST AND SEALIN			
	в.	Inspection Procedu			
			and sealing, the tubes are checked for in	noperatives.	Q
		(2) AQL's and san	aple sizes: 100% inspection.		บั
		(3) Classification	of defects: Open and shorted heaters, a	ir-leakers,	A
		grid-anode sho	orts.		L I
		(4) Inspection inst	ruments: Heater voltage power supply.		Ť
			Exhibit #10; Manufacturing Record, Exh	nibit #13.	Y
					C
					0
					N T
				•	R
					0
					L
					M
					A
					N U
					Ā
					L

	THE RESERVE OF THE PERSON OF T		
Date Issus i	Supercedes	Section .	Page
August 7, 1964	New	II - QUALITY CONTROLS	II - 11

#### 10. AGING

- A. Aging Process
- B. Daily Quality Control Check
  - (1) After exhaust, sealing and aging, tubes are tested as specified by Process Engineering.
  - (2) AQL's and sample sizes: 100% inspection or 56 tubes per day.
  - (3) Classification of defects: As specified by Process Engineering.
  - (4) Inspection instruments: Various electrical test sets.
  - (5) Forms used: Daily Quality Control Check, Exhibit #14.

### C. Initial Test

- (1) a. All tubes are tested for inoperative defects after aging.
  - b. All tubes are tested for characteristics assigned by the Process Engineer after aging.
- (2) AQL's and sample sizes:
  - a. 100% inspection.
  - b. 100% inspection.
- (3) Classification of defects:
  - a. Shorts, opens, leakers.
  - b. Specified electrical characteristics.
- (4) Inspection instruments:
  - a. Inoperatives test set.
  - b. Applicable electrical test sets for specified characteristics.
- (5) Forms used: Exhibits #10 and #13.

QUALITY

NTROL

CO

# SERERAL ELECTRIC

Owenshore, instudy

Date Issu	•d		Supercedes	Secti	(n	Page	Date Augu
August 7	196	4	New	<u> </u>	II - QUALITY CONTROLS	II - 12	at Proper
. 11.	PL.	ATIN	r <b>G</b>				
	A.	Plat	ting Process		1		
	B.	Fina	al Test and Inspe	ection			
		(1)	Inspection Proc	edure			Q
			a. All tubes a	re teste	d for inoperatives.		U
			b. All tubes a:	re teste	d for characteristics assigned by	the	A L
			Process En	gineer.			I
			c. All tubes at	re inspe	cted for visual defects and for con	ncentricity.	T Y
		(2)	AQL's and same	ole size	3:		
			a. 100% inspec	ction.			С
			b. 100% inspec	ction.			0
			c. 100% inspec	ction.			N <sub>.</sub> T
		(3)	Classification o	f defect	s:		R
			a. Shorts, ope	ns, lea	kers.		O L
			b. Specified el	ectrical	l characteristics.	,	
			c. Mechanical	defects	and concentricity.		M
		(4)	Inspection instru		·		A
			a. Inoperative:	s test se	et.		N U
					al test sets for specified characte	ristics.	A
			c. Concentrici			<del></del>	L
				,5	-		

(5) Forms used: Exhibit #10.

#### Owensbore, Kontucky

Date Issued	Supercedes	Section	Page
August 7, 1964	New	II - QUALITY CONTROLS	II - 13

#### 12. ACCEPTANCE TESTS

- A. Process: Finished Tube Accaptance Test
  - (1) Inspection procedure:
    - a. After factory tests, tubes shall be submitted to Test and Quality Control for complete electrical and mechanical tests in accordance with the applicable MIL-E-1 test specification, MIL-STI-105, and other referenced documents.
  - (2) AQL's and sample sizes: AQL's and sample sizes shall be in accordance with the applicable test specification.
  - (3) Classification of defects: Defects are defined by limits on the applicable test specification sheet.
  - (4) Inspection equipment used: The conventional equipment used for testing tube type 6299 has received approval and is listed in the List of Miniature Ceramic List of Production Test Facilities dated 18 June 1962. The equipment used for the improved version of the 6299 has received approval and is listed in the Improved Miniature Ceramic List of Test Facilities dated 15 October 1963.
  - (5) Forms used:
    - a. Product Acceptance Sampling Record, Exhibit #15.
    - b. Median Control Data, Exhibit #16.
    - c. Life Test Tube Location Card. Exhibit #17.
    - d. Life Test Data, Exhibit #18.
    - e. Life Test Status Report, Exhibit #19.
    - f. Master Shrinkage Symbol List, Exhibit #20.

D**at**a Au;

UALITY

CONTROL

MANUA

	والمناف والمات الماتوات الأوالية	The same of the sa	
Date Issued	Supercedes	Section	Page
August 7, 1964	New	II - QUALITY CONTROLS	II - 14

Date Issue

August 7

#### 13. COMMERCIAL SERVICE AND WAREHOUSE

#### A. Commercial Service

- (1) Order Service: Orders requiring government inspection are received from customers or via other sales offices and edited by Commercial Service Clerks.
- (2) Order Service clerks release material for inspection and shipment as required by purchase orders. Copies of this release authorize inspection of material, as indicated, and packaging/ packing and shipment of material.
  - a. Instructions for tube branding are furnished the Branding Department and Warehouse by Commercial Service.
  - b. Instructions for packaging and unit packaging marking, when required, are furnished the Packaging Department and Warehouse by Commercial Service.
  - c. Container marking labels are prepared by Commercial Service and furnished to the Shipping Department.
  - d. Packing lists, invoices, shipping documents, etc., are prepared for each shipment by commercial Service.
- (3) Reference documents. Commercial Service and Warehouse Procedures 2.7, 2.12-1, 2.15, 2.15-1, 2.13-1, 3.1-1, SI 13700K.

#### B. Warehouse

C

0

N

T

R

0

- (1) Tubes that require completion of life test prior to shipment, are transferred to Warehouse after all other tests have been completed. These lots are placed in 'life-held' status until a notice of satisfactory completion of life test is received.
- (2) Prior to branding, tubes are inspected 100% by branding operator for type. Each set-up is checked for accuracy and legibility by the set-up operator. After branding, spot checks are made for proper brand. Marking permanency tests are

U L T Y

C 0 N T R 0

M N U A



		Y CONTRACTOR OF THE CONTRACTOR	
e lesued	Supercedes	Section	Page
igust 7, 1964	New	II - QUALITY CONTROLS	II - 15

made on tubes branded for government use, in accordance with method 1105, MIL-E-1.

- (3) Tubes are either bulk packaged or unit packaged as required by purchase order.
- (4) Shipping Department places labels on shipping containers, places invoices, packing lists, etc., inside the containers, seals containers and releases material to carriers for shipment.
- (5) Reference documents: Commercial Service and Warehouse Procedures (see paragraph 12. A. 3).
- C. Exhibits: Section III, Exhibits 21 through 23.

Date Issued	Supercedes	Section	
August 7, 1964	New	III - I	EFERENCE DOCUMENT
Drawing Accepta Military Bas Q MII A SCI L I MII T MII Y	cocuments not attace List N-11606, drance Specifications Specifications: Sic Section, MIL-EL-E-1/48413; L-7001/91; L-STD-105; L-E-75. rcial Service & Warner Street Service & Warner Specifications	for type	5299.

30Y1R01

- 1

Zmet	<del>/ a ndrobliv lag</del> a mariamas e	e Georgia, este seus segrit e esté spis	n bete men an an <sup>l</sup> egter ter	a materbalant-appe \$400	,	hand an antimother and a	-
ENERAL  ELECTRIC OWENSBORO TUBE PLANT	RAW M	Aterial inspi	ECTION REF		ERIAL NO.		
OWENSBORO, KY.			· · · ·	. 2	ATE		-
Material Inspected Fers		Date Rec'd		Pedi Ne,		•	
Approval of Regulac Shipmen		A-ni,		Order No.		•	
Approval of Test Lat		] Redd .		Ne.			
Approval of Die Samples		] Vender	· · ·	Doles			
Engliseering Complaint		Tube Type	Met Na.	. Die No.	Lat Na.		
ictory Complaint		] Description		Lecotten		••	
Inspection Time	· · · · · ·	Sample Site		Sempled By	inspected By		
		Summary of Inspec					
		EXHIBIT	2				
			•		· ·		
	· :			• .	,	•	And desirated by Angregue for the Angres
		Disposition of	Moterial				
ejected Criticises	d Disapp	preved	Approved	Waive			
ont listled	Number Speek	Speel :		Regulation . Number /		·	
olection Salved Bys	Returned to Stack		Report .				
							***
				territo en del Parellyco	MATERIAL SERVICES	- The state of the	Talibadelly to be from a man,
	ر من المراقع ا والمراقع المراقع المراق						
		外公理。		With the second			

....

BlueAT						-	Industrial		er i speciel er de se				
23			-			i	Miracraft						
1. Pi							Sylvania						
(a)				<b>S</b>	VENDOR RATING	등 ( )			1 de 10	,			
SS	CURREN	CURRENT NONTH		YEAR.	YEAR-TO-DATE		e terminal variables in surface to	CURREN	T MONTH	. 11	YEAR.	TO-DATE	
ROGREA	Recid	Def.	Def.	Amount Rec'd	Amount Def.	% Def.	NOCINE	Amount Amount Rec'd Def.	Amount Def.		Amount Amount Rec'd Def.	Amount.	- - -
OSTITERS ter Elec.		-			•		W.B. Driver		~~				
19							My. Electronic						
(3)					,		Driver-Harris			-		***************************************	and speciments that
, X							Sylvania				***		
1 1													
ney	*F. 65 Mary	<del></del> ;-		•	-10,000		Dover			~	•		7-44 <del>4</del>
ve. Bulb							Sigmund Cohn						
Bula.							Clove. Wire	-		-			
							resaut.		***************************************				***************************************
TACC TITOTAT			  -				Kenbar	*****		-		AT	
dgeville		<u></u>	•										
an					<b>&gt;</b>							***	
					/-		W.S. Driver		•			wydę o Spine	
DLY W. BARE					S. S		Techaloy						
					(A)	ş <sup>y</sup>				-AEL			
	-				**************************************	*	· ·						
UT W FITT				-		1	ממוא ע ממווא				•		
ın.							Cleve. Wolds						_
er	-		_				Carolina Wolds	-		-			
vania			_	<del> </del>			R.C.A		-				
			_				Sylvania			-		-	
MI. W.BARE						-	# 510						
ver-Harris								1					-
. Driver			_							-			manageres rest den
Slec.							11. SUPP. W.	~~			-		
								-			-		Anna Minesella Prod
108				-  -			Xy Klas						-
							***						•
	-							***************************************		wo	100		

LOOD AS LOOD

	-						1	-	-		 		
			-										
			-			25	P	-		_			
		-	-			Amer. Panicor	An					<b></b>	
						Cleveland Weld	0						E. Co
						L S Was a substitute of the su	ρ,		-				
:		-	-			Claveland Ting	2		-	1			e <b>3</b>
			-			HINTER OF HALIFOR	<u>.</u>	-					erican Elec.
***************************************		-	-		-	Fansteel	u ×						
						Engelhard	ा च						arolina weld
						Western Gold	F.		- -	-			S.STEN I : ADS
	•					Superior	S						
						Romac	B						TETURATA
			-			Kanco	Zi.						uperior
						Sunair	S K						recision
			-	- -		•	<b>&gt;</b> 計						S.CATHODES
						par		* 50					
						Art Wire	A	JIC JIC					1 d 101
						J.& H.	٤	ik					>   E
		-				C. A.	В						- 13
-						ylvania	(A)		^	-			Develand Wind
						Micro Stamping	-						
						#510	, , , , , , , , , , , , , , , , , , ,						Or corun IIII
						Truelove							D.
			- -			recision							Mamonite
		-	٠			SKIELDS & ETC.	10:						Mansol
						7							Coors Forc.
						טוידטוו טדיא	· · ·						Anerican Lava
			-			Intan City			:				23. INSULATORS
						R. C. A.							
						Srlvania							Victory Filleran
		AT-COLOR	<b>.</b>	<b></b>		Precision Fil.							COKIT
Det.	Date	Rec'd	Der.	Def.	Rec'd		100	Def.	Hec.'d	ve.	vel.	1,65.7	22. YICK SPACER
	R-10=DATE	Amount CSAR-	1	Amount Amount	Amount	VENDOR	88	Amount	Auno	' જ	Amount	Amount	VENDOR
				TOTAL PLANT	adello.	CLASS		TEAR-OI-FARY	. YEA		CURTENT NONTH	CUR.	CLASS
	コニュ		TOD			<b>À</b> : : : : : : : : : : : : : : : : : : :	RATINC	VERIDOR RA		بر ر بر ر		×	- zous
			-										
									-				
		_		-									

	e L	1	•	AS B)	i.! 2(	· ·	IR	0	-) : :		_
							=	•			`.
TUBE ( )		100 Mg	VENDOR RATING	ING	ر : : : : : : : : : : : : : : : : : : :		<b>3</b>	(S) :		3	
CLASS - CUR.	Amount	TEAR  **Amount	TEAR-TO-DATE	R C	CLASS	CURRENT	HINOM INS		TEAR-	R-10-EAJE	
29.BASE PINS Rec'n	. ver	Def Recid	Def	Der.		Rec'd	_per_	Def.	Rec ld	Def.	D
30.BASES											•
Loranger											
National liec.											
Pioneer Slec.				<b>&gt;</b> -							
Hech. Ir 3' ron							,				
				<b>^^</b>							
					The state of the s						
		~~		-	×××						•
JI, SOLER				-	A A					-	
Handy & Harmon				-	*						
restern 711			ì						٠		
				-						-	
32. XI'S   NI				****							
3			-								
MEMOLIN C. F. F.S			•								
										<del></del>	į
				-							
-									•		
										-	
											# - # - # - # - # - # - # - # - # - # -

TTERS	Oet <b>ter</b> Blec.	Kemet	King	R.C.A.	1	5
-05000 -10000				ration of the second		AR-
	•	•				нэ нэ нэ
.608						M31 M31 '731
					,	ate
LASS BULBS	Pitney •	Cleveland Bulb	Corning , -			6. N
11000 11900						NITA NITA NILA NICA NICA
•	•					
.eces	•					) its
ASS BING	Bridgeville	Logen	EXELLE			7 N
15000 - -20000						Kile N21Z N25Z
·					-	
·• •				,		,
Pounds		·	, .			ete
LT WIRE	Dover			,	•	TU
2000 <b>0</b> 2 <b>1000</b>		Profession				
A-B :						
ome	•			* <b>,</b>	1.0	
ors .						
					in the second	
			i sale in the sale in		and the second second	

द्यान प्रा Sigmund LATED Sylvania 138 UN Cohn 1-20000 AR-21000 **Н130 М13**J 1130 H13E HI3L HI3D XI.3P XC.3R **`~3**X aters NI. WIRE Kentucky Eayr. 6. BARE Driver-Harris W.B. Driver Kemat Sylvania Electronics Stall Mlla-H N17A EXHIBIT 52 N21A-B-H N25A N27A ;ters NI. WIRE Kentucky W.B. Driver Driver-Horris Sylvania PLATED Electronics KILE-F-L-N N213 ¥253 'eters Gleveland TUNGSTEN Sigmund Dover. Kassel Rembar ORID WIRE Luma Wire Conn

S

Pr Si JU.

TARIW 44UE		······································	- All Call Say Million of Caster Cast			CITY
NI.	W.B. Driver	Techaloy			•	. U. SUP
•						
	•			7		,
Pounds		•		, and the state of		[ In ]
SUPP.W. NPS	Cleveland Welds	Garolina Wolds	Sylvenia	Kontucky Blectronics	<i>#5</i> 10	R.J.A. il. CR.
-23 -65						G-9;
			EXHIBIT 53			
Pounds .		\	, , , , , , , , , , , , , , , , , , ,			In F
SUPP.W.	Sylvenia	Kentucky Electronics			,	J. SUR
-38						I-27 8-63
Founds					-	In P
SUPP.W.	Kentucky Klectronics	#510				FRA.
-67 -68						NOT!
Pounds						

HTMCH

-					
SUPP.W.CU. TUBE CLAD	Kentucky Electronics	Sylvania	\$510 .		
. 37					
•	<b>:</b>		••	`	
In Pounds	•				
il. CR. CU.	W.B. Driver	#510	- Albertania de Chamana de Albertania de Albertania de Chamana de Albertania de Albert		
<b>C-92</b>			3,5		
			EXHIBI. 5		
In Pounds	·				
SUPP.W. MISC.	W.B. Driver	Carolina Welds	Keystons		·
I-27 8-63					•
In Pounds					· -
FRAME O. SUPP.ROD	Dover (Pieces)	Dover (Coils)			
KUL-					
			1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		

TING YATER	TAL PARTS SUMMAR	c skeet		CITH			
chi mise-j	<i>\$5</i> 10	Dover					
) .1-25000 R-26200					,		
2-28000 2-28200		• *		· ·			
ieces							
FIL. RIBEON	Sigmind Cohn					eradicamente di Allen.	
x8-ji7000 x8-ji3000 ·							
·:		Part .	E.M. I. E.				
NICA SPACERS	American	Ashville	Ford	Kuse-Liborty	Industrial	Me.	
XR-30000 KR-37000					·		
XSI.	•	<u>.</u>					
•					The second secon		
Pieces		1					
CON'TD	Reliance	Sylvenia	United Mineral	Viotory	And Survey Manager Man		
						and division and d	
						* ************************************	

28	Corburund	u.z.	Diamonite	Mansol	Coors Porcelain	American Leve	JLATORS
1		,		,		• .	,000 ,000
					,		
	·					,	. B
28				Klec.Day.Corp.	Sylvenia	Cleveland Wire	TER .
		•					5 <b>000</b> 1000
	•			EXHIBIT 5		•	. •
	-			EXHIL		· •	ra
√. `~49.			Sylvania	Superior		Precision	THODES
KR KR KR						e	8020 2000
Pie ———	0.B.	DKE	Eleo. Bases	Amarican	Cleveland	Carolina	TEM .
٥٥.	G.B.	Electrio	Ing.	Electric	Welds	Welds	EADS
XR-XR-							1000
<b>≠</b> ->, ->, }		,					₽#
Fiec							
. •			AND THE RESERVE TO THE PARTY OF			•••	:

SOLDE Cleveland 8 & F AEO: Handy & Cleveland Hunter Spring ingolhard Tungaton Panic Harmon Matala Welds oy Oz. WIRE KESH **Vabricated** Metal EXHIBIT 58 BASE Bead Chain PINS KR-87013 KR-97011. ICR-87015 XR-87017 Pieces Machanical #510 National Elec. Pioneer Blec. Lorenger O. BASES Instrop KR-80000 DR-83000 Maces

Solder	Harmon	Western Gold					_ Materio:
	·			•			'Distribu
y 01.							*
					,		COTICE
WIRE NESH	Neward Wire	Nevark Wire	,	`			· · ·
	(Pounds)	(*1eces)					
	a 7 Aprendistrict Apprendistrict		5 5		,		PART NU
•		. <	EXHIBIT 5			,	VENDOR
	. 4						ANUFAC
	. 4.37 (2)				•		DESCRIP
					•	•	AHOUNT :
				•		٠,	REASON
•	-						
					·		
						:	
				The second secon			
						•	189031
	•						


	restricted hateria	L REPORT		·
1	•		Date	
Histribution:	·		ć	
which cannot be	e used in regular	production and is	tock the following a not returnable to way, please initiat	vendor.
PART NUMBER	revision	HATERIAL		
VENDOR	DATES RECEIV			
WNUFACTURING DATES	•	Tube types		
Description				
AMOUNT RESTRICTED	DATE	RESTRICTED	req. no.	
REASON POR RESTRICTION:		G. H. I. B.		
Jieposition of Material			S.O. Number	ау :

									•
	_		-		. -				
•			-						
•									
				•					•
				<			-		
									•
				\\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\					
				i di					
				25/3					
				/-					•
						•			
							·	·	
				·					
	•	•							
TOTAL			:	,			TYPE	DESCRIPTION	Part#
JAVTA		ON	SECTION		SECTION TO	SE		FROM	-143
				•	• •				
	DATE	· DA	. •		,	SHEET	MOVE	MATERIAL	
***************************************					•	•			Ö
							•		
						•	•	•	
P		•	•						

$\overline{}$		i								
	DEFEC	RYE MATER	DEFECTIVE MATERIAL SUMMARY	· ·	•	•	Ýear 19			the state of the s
5-	<b>د</b> و.	Date #el-	Supplier	Part No.	Amoun! Rejected	Defect	\$ %	Olspesifica	Date.	Aspend No.
						c				-
				The same of the sa						
	A.	THE TRANSPORT OF THE PERSON IN		•				•		
										•
1		-				•	•			
					X3				•	
						J. J. G.				
					٠			•		
						<				
									es per communication of the property of the person of the	
										4
-								٠	•	
			•	•						
1										

# G DUNC I WE VALUE OUT ON

ato	. Lot #	XX: -	! . n :	0.D.	1 ~		ដៃវុ <b>ឲ</b> ដែល	3		Rocos	3	Visual	iction
7		ren arritanistra particular de la como de la	OK K	Largo	97:031	0%_	Large	Small	ок	Unicr	Over		 
							<u> </u>						
	•							•					1 
	•				·								
									,				
								der Chapter fortage a pro-		And the Control of th			
				and to the state of the state o				<u> </u>				<u> </u>	<del>(</del>
	•	<u>                                     </u>		alminika go gin da, a							,		<u>.                                    </u>
-	- Thursday - Albertages -			-									
			-					,		- <del></del>		<del></del> -	·
	-											<u>;</u>	
										-		·	! :
				waterings are			,						<del> </del>
	•										 	,	
													; ;
													<u> </u>
							• .	•					
tga:gappii/Sure 44													
-													
一			-						-				
												-	 
					EXHI	BIT					-	1	1
	dunggravitation	4 4 4 4 4 4				सम्बद्धाः	AND THE RESERVE		-				

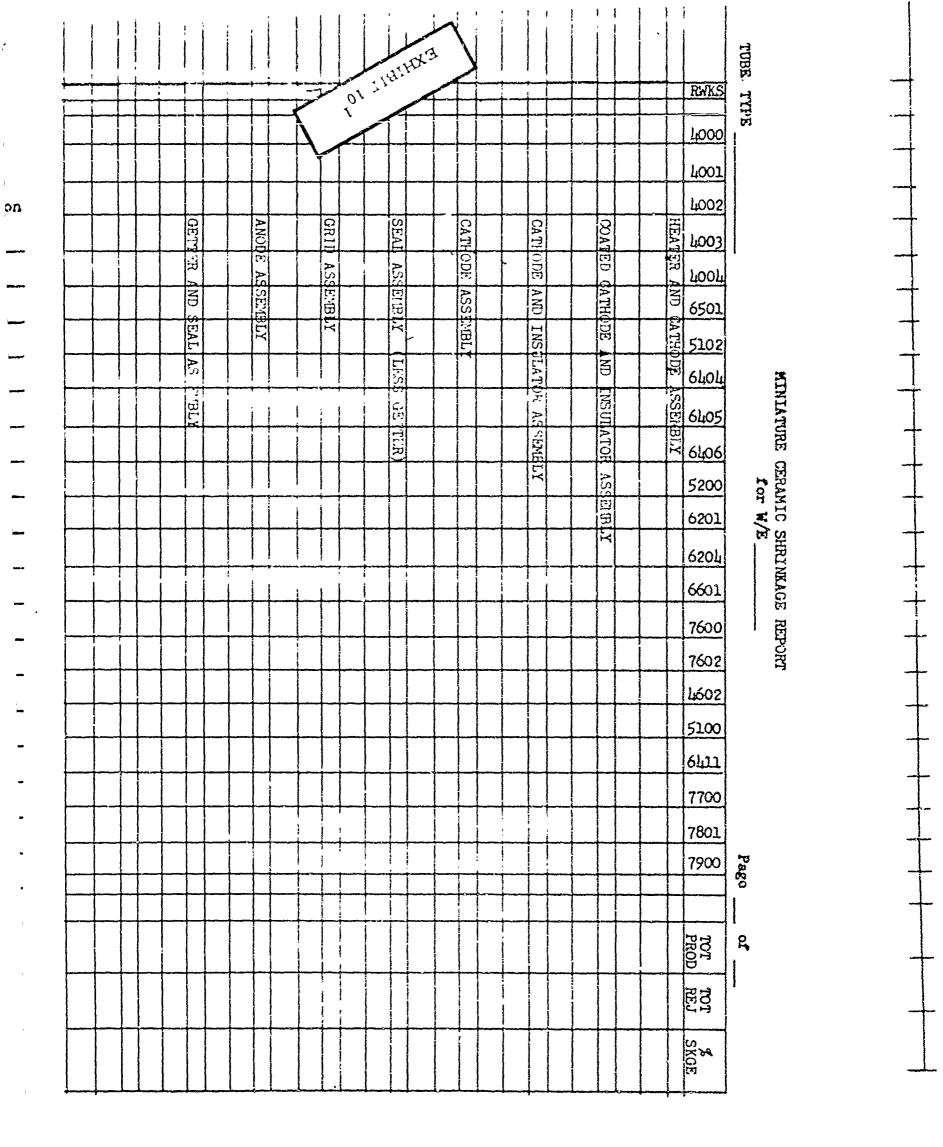

						+				1	+	+	+	+	+	+	+	+	+	-						
						11					11	1	+++	++	++	-	+	+	+-	11						
											1	+-		+	+	-	TCL	ELECTRICAL	•	REJECTS	1	123	THESTIF	उपर	<del>- </del> `	
						$\prod$							╁╍╁			-	-	-								
														+					1	_		$\perp$				,
											1	+	+	+-	-	+	-	-				SZ.	K CHECK	LEAK		to be seen
			1									†	1-1	-	+	-			-	-		1				
												+	+	-			-	-	_	_		<u> </u>			، معید	202
	-			<u> </u>								<del>                                     </del>	$\dagger$	-	-	-	ICAL	TECTRICAL		REJECTS	•	TEST	TIAL	THI		1.7
																										HIH
															$\dashv$		_	-		_					1	y:3
													+	+	-	_	-		-			_			1	
										1	<b>†</b>	<del>                                     </del>	1	-	-	<u> </u>	-		ਨ	DAGING	H AND	H VI	GETTER .	130		
¥ SKOE	rej Tor	TOT PROD	9090	9100	9032		9742	9741	9212	9211	9252	9003	90 <u>52</u> 9053	9051	9022	9000	9017	2000	9042 9043	30/13 30/17	2207	2205	220 <u>j</u> i	9720	::Mi	
																			-							
															ICAL	MECHANIC	·	VISUAL	A N	E	TRUL	TEST	FRESHIF	IFI.		
												<del>                                     </del>	$\left  \cdot \cdot \right $				<del>                                     </del>				1 1					
												1	_	_	-		_	_	_		REJECTS	PE	LSUABOL	1.23		
SKOE SKOE	LOT	TOT		2207	9720	1110	1000	2000		5300				4002	1001	4300	14200	1,000	5300	7200		5100			Ή₩K	
			e,	***************************************	Fage	*64						Í		_	For		•								TTPE	1 PEN1
,	4	Ä	-	-	-	-		3	-	÷	EPPORT	(7) =	SHRINKAG		CERMA.IC	•	HINIAIURE	ME -	-	2		-	_		٦ -	é
						+	. 744.00		+			-	1		_				-					:	_	
						+-			+			+-	1		_				+-			-	+			
		-	-		-	-		<b>201</b>	+			+	+		+	+		<u> </u>				-	<b>-</b>		•	

S-1/191		WIA	PLANAR SHRING AGE REPO	OF 1	Date W/E	N/E	
	CHECI	AUST	AGINO	INITIAL TES	· PRESHIP TEST	SIP	
Tube Type	Total Total % Imput Rej. Rej.	Total Total % Input Rej. Rej.	Total Total %	Total Tot	Total Inoper	Elec. Rej.	10 84 10 84
2822							
201,0							
20LOA							
2012							
2013							
2016							
5450							
6299							
7391			<b>&gt;</b>				
76144							of the state of th
7784	The state of the s		3.5				
			BIF				
			31				
61412			000				
577	A THE RESIDENCE OF THE PARTY OF						
¥6605			4				
5420							
6897/2¢39B							
5288							
7289					The state of the s		
							may only a communication of the Prince
market and the second					AND THE PROPERTY OF THE PROPER		
The state of the same of the s							

hvg. No. <u>N-11606-AN</u> Pt. No	
exciption Coated Cath & Insul Asm Tube 6299	1644
Naterial (N11605-AP) No. Phs No. Phs	
I. 1. Clean Cl-2C/SCR-1	MT
2. 2. Spray J1-1P (30 asm/load) & check	
3. 2/30 for coating thickness	MT
4.3. Mill coating to size & check coating	
thickness on dial indicator	HT
4. 4. 100% inspection	INSP
7. 5. Coat I.D. & O.D. J5E	
. 6. 100% inspection	INSP
0.	
2	
KEED TICKET WITH LOR	1.764.8 IL.E.

EXHIBIT 11

# CATHODE ASSUMBLY SHRINKAGE REPORT

S-4140 DATE

Symbol	Rej.	Received	% Shrg.
5002			
5103			
5203			
6201			
6202			
6203			
6507			
6205			
£206			
7002			
7003			
7GQ1			
7600			
7900			
TOTAL	E.70	HEIT 12	

	Approximate there represents the desiration of t			AND THE PARTY AN				2 7 Trac			Dik Lankage Test		Pawer Out Test		Walse and Gain Test		U' Trat		3 F Ace	A C Age	D C YG.	Palse Age	hitivata and ige		Flash Cottor	Clean teranto	Emove Lead and		Echayst (82)	, , , , , , , , , , , , , , , , , , ,	Wald Mi Ribbon	Returned Ass.	6789ATIDE	
			-		_		Ţ								!-		<u></u>	+ ! +		L	L.		-				† +			<b>†</b>			22	
	4-4	L	-	+		L	+	   <del> </del> -	<u></u>		_			٠.	-	Ļ	-	i <del>} -</del> -	L	Ĺ	_	Ĺ	ļ	<u> </u>	j	<u> </u>	-	ļ.	+-		_	-	CHE CHE	1
			***************************************														ikkapra y kairinningkalaana parahan parahan manakan kambana kambana ka			A			Marketta Automorphische des la companya de la comp	de la company de	AND THE PARTY A STREET, AS A STREET, AND THE PARTY AS A STREET, AS A S	PROMET PARTY I ALIEN MENTENERS (STREET) PROFESSION OF THE PROFESSI	سيدسيدوا أباراج والمحوط مفسوسية واستجم ويرب إداراه والمح	Andrea de la lora salata de la companya de la comp					A MITTANA CONTRACT	
			T	1		T	Ť	 Ť	Ť	1									í				-			†	<del>-</del>		T				9000	4
	1 !								1	ļ			ا		\(\frac{1}{2}\)	Lik	! sir	3.3		>			•		1		•		1					45. LEVIS
ECH-205-B	and the second s	with the second	,			name (Alameter											N. S. Line	3		Ho. 1 Down(1) [13] (3)	Set Pass 1.5	ZHADST I					HATES		CAUSIONS COATING KIX	CATHODE BEST VATETIAL		NALE OF THE PARTY	NOME TARE	And the state of t
-	•	· ·				newpolanee e	and the same of th					-				315	SUF	3		(2) 1837 (1) Livor	- 1	EXHADST DATA					ELATERS		CATANOM COATING HIX			1	NO.	ACCAL AND THE PROPERTY OF THE

1

		80 - 1 - S
	ماسية بنسليدا سيلسند في وسلسسياب في الساد المسيلية و	
RUM NC 321 B 0301 H). IBM RF2 TIM2 RF3 010 COCO "CC11C1	TA BEACH TANCE	24.461
CHANGI DAIA		1 1 1
		!!!
		4, 9 %
BINE		
3	and the same of th	
***************************************		
	Tite a proper description of the control of the con	I.,
		; ;
	-	,
		100
Title Management and the second secon		
***		
Capitalism en	00 me	
		•

. Ε. ζ


Ē ;

: [

# QUALITY CONTROL SECTION PLANAR THYRATRON — OWENSBORO PRODUCT ACCEPTANCE SAMPLING RECORD

(Signature for Government)  Date	ACC ()  REJ. DAYE	DAYE	¥60	A .	DATE	****	<b>2</b>	w
The state of the s			TOTAL	<u> </u>		1	* A OBJESS	
								_
QUANTITY ACCEPTED			mary management was				The same of the sa	1
demonstration and the state of	M H		***************************************			_ <u></u>	1	••••
tot bisposition						:	*** *** ***	•
ARMAN SAMAN AND AND AND AND AND AND AND AND AND A								
	The second or second se	<b>→</b>						Ì
	And the Control of th	4	Noise				The party of the same of the s	
		>	Pwe Gain			· •		
(Signature for Contro tor)		+	Cgk			<u> </u>		_
			C&p					•••
•	1-Short	+	O I					
mitted for Government Acceptance.	Kgp		C. M. D. C.	STATE OF THE PARTY AND ADDRESS OF THE PARTY AN	T CHARGE !	THE PERSON IN	A ~ > recensory	VINCTURE.
Having been found account to	THE RESIDENCE AND ADDRESS OF THE PERSON OF T			-	- The second			
for the Applicable Inspection Position.	Resh		Erd					And The
listed on the Government Classification of attributes	Rhish		lc					
This material has been included	Rksh		Sm	 		<del> </del>	!	æ
	- 1		47				· ·	
	Opens		Ibk					
u .	DERECIS	The second secon	11	ARCHITECTE   1944	To be the first to	TOWN ICONOMISSION OF STREET		
	THE PROPERTY OF THE PROPERTY O	<del>-</del>	DEFECTS	1	~		ייני גכוז	
	DEFE, TS		DEFECTS		   		POUND	
	DEPECTS		DEFECTS		<u> </u>		ALLOWID	
PEMANYC	<b>1</b>	.65 1.0	104	6.5	2.5	10	107	
LOT SIZE DATE	SECOND		SECOND	$\downarrow$	1		SECOND	
	FIRS?		FIRST				~	3715
LOT No. TUBE TYPE	INOPERATIVE	ELECTRICAL	ELECT	<u> </u> 	NICAL	MECHANICAL		ROUP
The state of the s		T					-	

S-2257-C PLANAR-THY RATRON LIFE TEST TUBE LOCATION CARD Sample Size Tube Type Kind of L.T. Let # Rack # Shelf # Secket # Rest. Comp. Reading Periods Off Life On Life Int. Hrs. Acc. Hrs. Date 1 100 200 250 250 300 400 500 750 1000

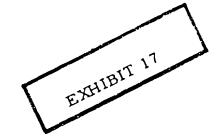

						AVANTA ARRONNA ARRONNA IN INCIDENTALIA CARRENTA BARRA		Particulation of the Particula	
TILD AVER	ng agus de Corto		RECELL	A CONTRACTOR	Ž				
3.111 3803			OHTEN LARC TO	•			भ व्यक्त	ना नामाचन त्या	Apper appreciant 4 to a
_PRODUCTION REP			PLANAR	~•	TRON		- T. T. P. P. T.	ON TAKE SELECT	
vo. of Tubics -	·		E CTRON: TUBE		TEST 'ATA		30,000		emerges at all alminosters
	,		-				Disc	Disc After	\$ 0 25 mg
Ter Interests		the second of the			1		**************************************	To make the second seco	
On The				,	· Brysnige	-	12.00	1	endere e
In'erval Hours	•	a de la companya de l			دست	The state of the s			<b>}</b> -
Ac . Bours		-	1			-	*****	· · ·	t- <del></del>
TABLE TO SEED TO THE TABLE		-		1			***************************************	;	<b></b>
		1 1						,	
	:	:	name a sa	1		Community based to a second	<del>                                     </del>	•	<del>-</del>
			entent d	a					<del></del>
	* =			-			Therefore the same of the same	<del>                                     </del>	,
		1	· ·	_	4 +			<del></del>	3
4	• •	a many a many a						!!!	
		,		(3) 	-				
	-			HIFT	-				1
					See Property of the Property o				,
į	4 5		1	BOOK OF					
. ,	•		+	+					i
							or and the table of the second		
;		D. A. C. Color C.			-				
			***************************************				The state of the s		
* * * * * * * * * * * * * * * * * * * *									
1	-								
				<del> </del>					4
demonstrate of contract of the									

this and his states of the sta

PLAMAR-THIRATRON LIFE TEST STATUS REPORT

imis and bean
JTD land me
JTD

120 Juniotes
120 Juniotes
120 Juniotes
120 Julian in
120 Julian in
120 Julian in
120 Technique
120 Robins in
120 Robins in
120 Technique
120 T

3-2546				i i			- Annie mangeman principie dell'annie man	· · · · · · · · · · · · · · · · · · ·	. St. de la constante de la c
	Date LT Started	Date LT	Quantity Prod.	Kind of	Reading 100	D000	Disposition Life De	Design	
									The designation of the second state of the sec
	e de legament de metros en	***************************************	A STATE OF THE STA						Annua per 1 con mileta desagnamente desperante esta esta desperante de la constitución de
	e per vides indexe de france in au								1
	v -quarettennegette danet denieng								
		· ·					<b>&gt;</b>		
			;						
	,	-					3		
							PHY A		
	: · .						1150	and the same of th	THE REAL PROPERTY OF THE PROPE
	; ; !	,	degrade in the second				61		The same of the sa
***************************************	4 11 11 11 11 11 11 11 11 11 11 11 11 11		,			ļ			
	And the second of the second o	, ,	,					<b>₹</b>	
					0	,			
	and the same of th						***************************************		- Total - Tota
-besterrasse				1	n-parketin				

9.00

## مين سمير مرايد به حجر

San Bridge	And and Annables
new late defendant dus to administration	god hadden committee anded
" New Posterior as also aff	1784 fred/has married amount
1 Miles Accounty to the second	فيتربسه وللمستحدد بماريتساهم) الكلا
IN Salal defadin	The franchistant accountly amount
In Panning on educat	900 Annilow bearing anded
Alle Annie Antonie in manual	505 fatherfly enemantly averted
the title because in automics on automic	5100 Parking out of assuminately 5100 facilities and of assuminately
the days been an extensive	SAV Andran and of arrangely
1900 And and around 1900 Polited and aspirabel	541 collecte has one of amendicante
Part Polist excised loses to bull	300 (added that out of amendously
The Malland equipment assurement about	pill toubles out of flat on belled
1970 Sandy count agency	5.00 fredher met of flut on talled 5.00 Andrian and of flut on talled
The Comment and asserted a parameter.	500) (ashed has out of first on build
real table and analysed on all proclams	\$200 Amelou'Am and of fund on suited
1900 Walanted defend	100 hard/har out of you decreased in
	EDI mulayed ha and of you
	SDV food motor to
then and blood passends	TED Chicago defect
State Sandya account come	630 Park was nelso have
ATV Heater record develop ATM Frakes berned out	ENU fact has authorized
Jed balan annul apar	6.01 calline defections
180 Salles council deviled	ATT A
للمياه المتلاطبينية الكلا	ally there in activities all the control of the con
ABI Ambangad street	ally inches die an estante
ADI Amtonomia del 1 ADI Amtonomia di desal	bill calous apoint defections
ARM American Marie Janet	bill (pelade atoi, any defactions
ATT Sudantino della	0401 year ocfocsing
ATT forder state about the	6400 Grad bassed 6401 Asian on paid mish
AND Sundaness about	the large paid mass
ANG Fertus-shall shoul ANG (returnshall shoul	6475 Burlion great many
Not founded does	the burns pard many
AND Cathedraude dead	\$407 yard season seed beauth dryseless blast these on good
	otel and ment of purposes stated
	44.0 four sector freedominal
Americand forms	66.1 hand famps defeations
frede and these \$10 land own deforters	APP Anda defections
He lad an any	69W roads off at tures 69M Arms may brank
1980 land man bruten	best Defortion boules
JPD band stree for short JPPA band more shorted	blish Employ deforters on missing
JES Land mans are close externally	ATO Sensor agrand defection on mining
216 last man purely begant arbitral	6701 layordine golden 670 farten engridall defertine
JES Tob/tomonic at passely algorid	490 may mil delater
1920 Bana dafaatsaa	URD Unicated defaut
194 Bor Samman comment 194 Gra through sung	
191 has making defeating	gratures I was not seem to you
JACK Reductive defeative	POST CARRIAGE SENTENCE
All Adian discovers security	ANI I channel on long defection
1909 Britished default	1001 (athele and sq esfective
	press (ashers making the
	707 by your reads on makinda but
	12th Piology colockers
410 Inches ship of or combal	THE bone outs as persons
the factor consister should be constain	7201 Feeling breatered 7201 Feeling stored on descripted
title father continue object on people	TOP Plating 186
40) Called exchange as a price of an application of an application of the called an application of the	1205 Places all
10.9 Heads unardistric thingsel on catalod USS develop anastricus ritinsel on catalod	7,00 there ordered board from
ALT testy enculates	2007 processes though gold procley
*JED Admical exchanges in comment	7000 Farest defective 7001 Interest posts and get
144 Algula metalleging defective begins fining	700 Testal deference des la course manages
MA Tolgoth antalligues infantion of see froing	into reach period and an included
199 Ti-Aphada assails proj defective 1990 Beforkers uponcionion serial each	har oriothin mil
Me Materia seri, burtes pie	THE CHANGE WITH THE PARTY OF TH
the Andrews was making and shall	1960 (by made on antimbe defending
1881 Seferitive real, and and stall tenders	Almen andrews
1900 Africa only made shall 1900 Passached failus	PEC! Dodden broad grands.
	700 theired defeat

Files.  BEEP Child secretary other than at social  Differ that arrange at another security
3194 44
\$15° Bull counted at words send
ADJ Bull amount of part and
\$204 Bull combad by millon brighting
\$335 Bull defeating were apprehen der
\$100 Deforture yours
IN the houses in com
I'M ha leves so show
EM) ( means or always in place
Less ) for more analysis and
4.01 can about an anched abound
Afti ites exected mates matter
ATI COM SERVED SO PRESE
SAN Come by clear to proce
8,00 Ash surgious and defection
the Antonios and defection and
870 Ataliangless and defecting and
AUI Autorian out defecting and
AND Archemica out defection and
BES Astalongines and deletion and
100 And in second control
\$101 flow ohio wil sended
NO I delesse montopolis
EAS Special-close and defending
Was defeating that to making
5700 loss privates in surgesty
870: tomo melacio en inid
870V Imms production on month
Sto prefer brains
Prio University defeat
waster of the



920 to onemo	<u>يميوڙ</u>
= 4 manual and	يمغ ممن
MIN I company high	سر
accel Sand polos has mesenes "Less	***
1950 long pulse has smaller legal	* *
929 Hood point two sections (Ed) 9201 comp points two sections (Ed)	
9008 E manen	4 , Ja
1911 Island amond high	y
1012 Talorent amount & w	24
ACU . March annual high	
1000 through amount from 1000 term prompt amband	3,
1031 Peland person has	۸ ۲
47.9 (¥ , mar. ) 14.98	n.
1011 the grad current	3,
9001 barbarrastinda barbara kuph	34
90% Indiana lake het 90% Indianahan lake het	موالا
9004 year-truck larrys had	امود عد
90% I alandonall language high	
10% Angaders and willing high	· 6.
NOS Amplion food inclines here NOS Amplions food missions high formately	
905) Ampeters foud contage high fautoff! 9550 Ampeters foud witage too fautoff!	٠ ٤٠
2055 Practice Good willings high	سري - در
PCE: second directory good among high	4
the most division and arrived for	44
97) I meet senem, god wilege high	-
924 speech division, gold valdage has	۳.
90"1 for fracting servered bank	- 3.
1070 See freeling processes they	
1000 fred menson 1000 fred derde blum	
90kr Block and	4/
108) (ment potential	4 Q
12th that many	
4040 Anne frame high	ميدو عد
93.1 two employers term factors 9213 Roya employers term factors	,
NSI Avec anciones had	بر <u>ح</u> د
NSD Admit andreway are	مو مدل
AND Admit amountage has as automat for	10 54
The solution of the state of the state of the second of th	
9600 spacetim facions (defect arthurs)	
This Julia stant wadoble on cheam than	
17) Whiteless we hold at the server	
PLD malan bearings	
PCAP Caree was exceeded	
906, med in Eginy in proceedation 949; high interchal bearsonn, whilepe has	
9152 High potential bearings, without high	Ų
1/di carter increase anti-	4
9721 - 97.9 Leaves and fire understang breedern	
9701 Aude mileye high 9704 Auste wildaye him	to
9771 Amongsed converty high	مة مو
4773 Andonyand separate process	
4773 Cathriany and capacity high	مون انون
9779 Cathological expectly flor 9775 Cathological Security No.	مي مي
9775 Calbula-ands separate high 9776 Calbula-ands separate low	نعرا
9777 Carlant correctly high	<b>(</b> *
9778 Out, and separate has	مسي
1771 Rentermethole seperate hard	( <b>&gt;~</b> c
1780 Brahamachula aguaily har 1800 Vascable mination	بن
1801 Fand vibration	V-VLS
MOU doing and procepturies	1.14
•	# £ A

ſ.

10.

Ze W

32.

36

3 C

AND REALINITY TO DAT					.45 346
FRICE ADDISONALINE CONTINCT OF INDUCTION OFFICE	day this designation in the	المحادث والمحادث والمحادث والمحادث	7. Ch. O. / V.	इति नहत्र	77. 1 11 L XII,
)					
MATORITO PILOU BUR LIB REGINO DAVINE VOILDA L	and the second seconds	The control of the co	ा । तिस्ति <b>द</b>	MILAGI.	52 P. O. NG.
O. HABE CF PRIME CONTINUETOU-CITY-STATE	th the Eventual Hypothetisty		वित्र जाएक कर	ifais ha	i shansi ordera
12. Hamyfacturki on Warringer Leiptra From—City—State	d de Mariannanamionnen	n squadquarky strett 426	I VO'DELL	कि जिस्ही	IPPLE?
IN SHIPED TO-LIRE FOR	The state of the s	,	12 mice o	1,2-11-115	O'HENTION I.O.
		, •	Tá sitip:iai	ग ०त्यस	III.
			> hagaint		TECK G-I COLTENET
Lerustalis (Nea mira Gifteen)			in, aloas i	ystait	id hit saudic
A DATE GISTRED   21. STAL NUMBERS   22. DIL ON EFFICIENCE DO 22	a can na	24. Kouth	iG		Aces - sector consequences or content
A 40 STORY TOTAL COLD STREET BOOK A CONTROL OF A CONTROL	RICT CLES BY	CENTRES	CUAINTY	LIMI)	- YOVAL CUST
				ļ.	
	A STATE OF THE STA	7			,
	HIB.T 2.	1		1	<b>V</b>
	HIB	ì			•
				· :.	
		11,	1	•	4
		·	1	<b>1</b> <b>5</b>	1 *
		`	.	1	!*
			Andreas and	The second section is a second	
				And the second projection which and	
				the major transported declar supple 1 configura-	-
				The many times declared the control of the control	
				The state of the s	
				The state of the s	
32. APPROPRIATIO-1	C. sances aut	THE STATE AT	THE SECRITION IN	AN PRINT GO	GA GCYSO.1140.12CC/Y A7 LY
32. APPROPRIATIO-1	DAYR	17	KCHIICKER		
	DAYR	17	KCHIICKER		ev ecamins, account of the
32. APPROPRIATIO-1	DAYEL  34. CLASS—C	ODE JE ACCOM	IGHLCKLIG HIS HO. ATRACO ACI	AC men	
2. Appropriation  2. Hivoice Housho  1 Census that tan items risks Elekain have oven inspected by the or 1-sde by supervision, the scenes to contact, and have been excepted, excep-	DAYEL  34. CLASS—C  IN L. I CERTOY II  Wer are as Ce.	ODE JE ACCOM	IGHLCKLIG HIS HO. ATRACO ACI	AC men	Veures thoma reser appression of per
2. Appropriation:  2. Hivoice housino  1 census finatan items listed herain have den inspected by he or 1-spe is supervision, fact comporated continues, and have been accepted, excep- is supervision, fact comporated continues, and have been accepted, excep- is supervision.	DAYEL  34. CLASS—C  in L. I Camboy 11  We are as C.	ODE JE ACCOM	IGHLCKLIG HIS HO. ATRACO ACI	AC men	Veures thoma reser appression of per

TURY, NO. WIT. 000 CONTROL NE SHIP TO 37 CONTRACT NO. S - COLLECT S - POR PT. OF SHIPMENT FACKING IMPROTION SALK ALMS CAMMIEN DO. SCO. NO. VE. 178. NO. CHT 600, SORE CUSTOLISH SWEET NO. BHIPTED OVANTITY ORDERED SUME TARE KRY, DKILIVERY UNIT PRICE F. THIBIT u 12 13 51

CONTR -OBDER	NO.			FSN	
		makerangan Chambrookel Touribers	• •	ELECTRON TUB	ES
ب 2004ء	MPS 1744 A - 1 PMM ) M M 2153 A 5 115	••		QUANTITY	1
FECIM.	General Electric Company Owensboro, Kentucky	<i>y</i> • • •	• • • •	TYPE NO.	
			•	PKG./PK. LEVEL	
TO:	an-a		• •	DATE PKD.	
_				GROSS WT.	
)		•		CONTAINER NO.	0F
		•			
•	•			Processing and Community of Com	,
		• .			
•	·	•		•	
	ACT OR NO.			FSN	
	•			ELECTRON TUB	ES
	,			QUANTITY	
FROM	GENERAL ELECTRIC COMPANY OWENSBORO, KENTUCKY			TYPE NO.	
•			<u> </u>		
. // .		IBIT	23		
70.		EXHIBIT	23	PKG./PK. LEVEL	
70.		EXHIBIT	23	PKG./PK. LEVEL	per-administration descriptions and s
<b>70</b> .		EXHIBIT	23	PKG./PK. LEVEL  DATE PKD.  GROSS WT.	per-administration descriptions and s
70.		EXHIBIT	23	PKG./PK. LEVEL	CF.
<b>TO:</b>		EXHIBIT	23	PKG./PK. LEVEL  DATE PKD.  GROSS WT.	CF.
<b>TO</b> :		EXHIBIT	23	PKG./PK. LEVEL  DATE PKD.  GROSS WT.	CF.
<b>TO</b> :		EXHIBIT	23	PKG./PK. LEVEL  DATE PKD.  GROSS WT.	CF.
ONTE	LACT OR	EXHIBIT		PKG./PK. LEVEL  DATE PKD.  GROSS WT.  CONTAINER NO.	CF.
TONTE		EXHIBIT		PKG./PK. LEVEL DATE PKD GROSS WT CONTAINER NO.	CF. OF
TONTE	LACT OR	EXHIBIT		PKG./PK. LEVEL  DATE PKD  GROSS WT CONTAINER NO.	CF. OF
ONTE	CACT OR NO.			PKG./PK. LEVEL  DATE PKD  GROSS WT CONTAINER NO.  FSN ELECTRON TUE  QUANTITY	CF. OF
ONTE	ACT OR NO.			PKG./PK. LEVEL  DATE PKD.  GROSS WT.  CONTAINER NO.  FSN  ELECTRON TUE  QUANTITY  TYPE NO.	CF. OF
ONTE	CACT OR NO.			PKG./PK. LEVEL  DATE PKD GROSS WT CONTAINER NO.  FSN E LECTRON TUE QUANTITY TYPE NO PKG./PK. LEVEL	CF. OF
FROM	CACT OR NO.			PKG./PK. LEVEL  DATE PKD.  GROSS WT.  CONTAINER NO.  FSN  ELECTRON TUE  QUANTITY  TYPE NO.  PKG./PK. LEVEL  DATE PKO.	CF. OF
ONTE IDER FROM:	CACT OR NO.			PKG./PK. LEVEL  DATE PKD.  GROSS WT.  CONTAINER NO.  ELECTRON TUE  QUANTITY  TYPE NO.  PKG./PK. LEVEL  DATE PKO.  GROSS WT.	CF. OF
ONTE	CACT OR NO.			PKG./PK. LEVEL  DATE PKD.  GROSS WT.  CONTAINER NO.  FSN  ELECTRON TUE  QUANTITY  TYPE NO.  PKG./PK. LEVEL  DATE PKO.	CF. OF

•

. . .

٠